Brownfields Inventory Update Village Center

East Hampton, Connecticut

Town of East Hampton

East Hampton, Connecticut

September 2015



146 Hartford Road Manchester, Connecticut 06040



September 30, 2015

Ms. Carla Sylvester Chair; Brownfields Redevelopment Agency Town of East Hampton 20 East High Street East Hampton, CT 06424

RE: Brownfields Inventory Update Village Center East Hampton, Connecticut

Dear Ms. Sylvester:

We are pleased to submit the enclosed Brownfield Inventory Update report for the abovereferenced site. The Brownfields Inventory Update was conducted at the request of the Town of East Hampton and in accordance with the task authorization dated September 2, 2015.

Thank you for the opportunity to conduct this work. Please contact the undersigned if we can be of further assistance.

Sincerely,

Murchalik

Stefanie K. Wierszchalek Hydrogeologist

Dil John

Daniel R. Jahne, LEP Associate

146 Hartford Road Manchester, CT 06040 1 860.646.2469 800.286.2469 f 860.533.5143

www.fando.com

Connecticut Massachusetts Rhode Island South Carolina




Table of Contents

Brownfields Inventory Update Town of East Hampton

1	Intro	oduction	1
	1.1	Brownfields Definition	1
	1.2	Scope of Services	1
2	Over	rview	2
	2.1	History	2
	2.2	Setting	3
	2.3	Existing Infrastructure & Utilities	
		2.3.1 Natural Gas	
		2.3.2 Sanitary Sewer	
		2.3.3 Community Water System	
3	Villa	ge Center Brownfields Inventory Update	5
	3.1	Properties Modified/Renovated/Reused Since 2005	5
	3.2	Properties Removed from Brownfield Inventory	9
	3.3	Remaining Brownfields Inventory	
4	Sum	nmary	11
5	Refe	erences	2
Tabl Table		Summary of Brownfield Inventory	
Table		Summary of Village Center Parcels in CT Regulatory Programs	
Figu	ires		
Figur	re 1	Site Location Map	
Figur	re 2	Site Plan	

Appendices

Appendix A	Sensitive Receptor Survey Update – Table 1 & Figure 1 (AECOM, April 2009)
Appendix B	Site Fact Sheets
Appendix C	EDR On-Demand Results





1 Introduction

Fuss & O'Neill, Inc. was retained by the Town of East Hampton (the Town), to conduct a Brownfields Inventory Update in the Town's "Village Center". The Village Center is comprised of a mix of residential, commercial and industrial parcels located to the south of the Pocotopaug Lake in East Hampton, Connecticut (Middlesex County). These properties include addresses along Main Street, Skinner Street, Summit Street, Barton Hill Road, Walnut Avenue and Watrous Street. A portion of two United States Geological Survey (USGS) topographic maps showing the subject site location is provided as *Figure 1*.

The US Environmental Protection Agency (EPA) awarded Brownfield Assessment and Cleanup Grants to the Town in 2003 and 2006, respectively. Since that time, the Town's Economic Development Commission created the Brownfields Redevelopment Agency to help "inventory, prioritize, assess, and, when possible, remediate environmental contamination in order to facilitate adaptive reuse and redevelopment in the Village Center."

As part of the Village Center Brownfields Initiative, an initial inventory and assessment of brownfield properties existing within the Village Center was conducted between 2005 and 2006, as discussed further in *Section 3*. The purpose of the 2015 Brownfield Inventory Update was to provide information regarding any changes to the previously identified brownfield parcels between 2005 and 2015; to identify any new or previously un-identified brownfield parcels within the Village Center; and to re-evaluate the properties brownfield status based on the current utilization of the parcels.

It is noted that any change in the brownfield status of a property within this inventory update is not an indication of environmental compliance with the applicable regulatory programs.

1.1 Brownfields Definition

According to the United States Environmental Protection Agency (EPA), a brownfield site, outlined in Public Law 107-118 (H.R.2869) – "Small Business Liability Relief and Brownfields Revitalization Act", is defined as:

"real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant."

The revitalization of brownfield properties has become an important issue for federal, state and local governments, as well as for potential developers; as the redevelopment of brownfield sites have both social and economic benefits as well as benefits to human health and the environment.

1.2 Scope of Services

Fuss & O'Neill's scope of services was developed based on a review of previously prepared environmental documents (dated between 2005 and 2006) in which 23 properties within the Village





Center were identified as potential brownfield sites. In general, the scope of services included a review of available information from select sources pertaining to each of the previously identified brownfields properties and a windshield survey of the Village Center to visually observe the properties and take current photographs where possible.

Specifically, this included a review of readily available documents from the following sources:

- Environmental Database Resources Inc. (EDR) "On Demand" databases report (provided by the Town) for the parcels within Village Center
- Town Departments (including the assessor's office, town clerk, building department, fire marshal's office and health department)

The information available from these sources (including building permits, renovation plans, building additions, and assessor's cards) were reviewed to identify any information that would indicate significant redevelopment, renovations, or changes in use at the previously identified Brownfields sites since they were originally identified in the inventory performed in 2005. The available information was also reviewed to identify any new (previously unidentified) potential brownfield sites within the Village Center. Additionally, town provided maps that documented the locations of available utilities and infrastructure available to the Village Center were also reviewed.

Please note that site-specific visits/reconnaissance beyond what is visible from publically available access points, and any determination of specific areas of concern and current quality of the subsurface materials (ie, soil, sediment and groundwater) were not conducted. A regulatory file review, other than information available through the EDR search, was also not performed.

2 Overview

2.1 History

East Hampton's Village Center was originally established in the mid 1700's and grew rapidly in the 1800s as an industrial hub known nationally for the manufacturing of bells. The first bell factory was constructed in 1808 and up to thirty manufacturers were known to have built and run bell factories in the town during that time period. To honor and preserve the town's industrial mill past, the Belltown Historic District (which is identified on the National Register of Historic Places) was established in 1985.

Specifically, the Belltown Historic District encompasses approximately 145-acres in the center of the Town of East Hampton, including the historic Village Center. Portions of the Village Center included within the Historic District are located along Main Street, Barton Hill Road, Skinner Street and Watrous Street, among others. While industrial activity within this area was concentrated along Summit Street, Bevin Boulevard and Bevin Court (located off Summit Street) and Watrous Street, more recently, several of the historic industrial and mill buildings were identified as underutilized and in disrepair.





2.2 Setting

The regional topography of the area generally slopes moderately to steeply from approximately 450 feet above sea level to approximately 360 feet above sea level (USGS, 1987) towards the Village Center (Figure 1).

Village Center is generally located in a topographical valley, sloping downwards toward the Pocotopaug Creek, which runs from Pocotopaug Lake through the middle of Village Center, eventually discharging to Pine Brook (a tributary of the Salmon River). Throughout the area's industrial past, this creek provided a source to generate electricity and industrial cooling waters among other uses. Over time, the natural location of this creek was altered by several iterations of damming and fill activities.


A portion of the former Air Line Railroad (which ran from New York City to Boston) bisects the Village Center in an east-west direction. The section of the railroad within East Hampton has been rehabilitated as a portion of the state's multi-purpose greenway trail identified as the "Air Line Trail". This trail provides public recreational opportunities in the heart of the Village Center and is another link to the Town's history.


Existing Infrastructure & Utilities 2.3

The existing infrastructure and utilities available to the properties within the Village Center are discussed briefly below. Upgrades to these utilities are currently either being conducted or evaluated to ensure that adequate infrastructure is available to allow for the successful redevelopment and revitalization of the Village Center.

2.3.1 Natural Gas

Connecticut Natural Gas (CNG) maintains the gas utility within Village Center. Currently, the natural gas utility is available in Village Center along Main Street, Skinner Street, Summit Street (from Main to Watrous Street) and along approximately half of Watrous Street. The expansion of the natural gas utility throughout additional portions of East Hampton is currently an on-going project as depicted in the image below (not to scale).



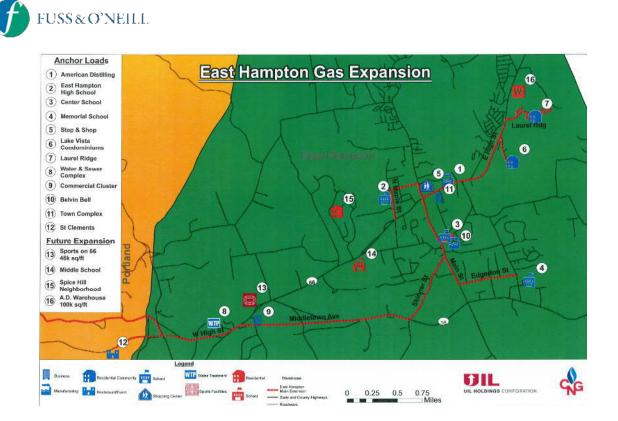

2.3.2 Sanitary Sewer

The East Hampton Water Pollution Control Authority (WPCA) maintains the municipal sanitary sewer utility within the Village Center. The sanitary sewer mains, which run along Main Street, Skinner Street, Summit Street, Barton Hill Road, Walnut Avenue and Watrous Street throughout the Village Center, have been available in the area since approximately the late 1970s. Specifically, the sewer mains include a 30" reinforced concrete pipe (RCP) to a 30" diameter along Skinner Street; 24" diameter RCP main along Main Street to Summit Street, where it becomes an 18" RCP. A 12" diameter sewer main runs along Summit Street from Main Street to Watrous Street.

Based on the extended availability of this utility throughout the Village Center, the properties within this area are presumably all connected to the municipal sanitary sewer. This information could not be confirmed; however, within the scope of services identified herein.

2.3.3 Community Water System

Properties within the Village Center are primarily served by the Village Center Community Water System (CWS), which is owned and operated by the East Hampton WPCA. The CWS became operational in approximately August 1992 and is served from two potable wells located on the Center School parcel at 7 Summit Street. Based on the extensive history of industrial manufacturing operations within the Village Center, a water treatment and filtration system was installed in 1990, when the second well was installed, to ensure quality potable water is provided to the properties within the Village Center.

A Sensitive Receptor Survey Update was conducted in April 2009 for the properties located within a 500-foot radius of the property located at 13 Watrous Street and identified properties within the Village





Center that were connected to the CWS. The figure and table from this document summarizing the properties connected to the Community Water System are attached as *Appendix A*.

3 Village Center Brownfields Inventory Update

As part of the Village Center Brownfields Initiative in 2005 and 2006, Tighe & Bond, Inc. and TPA Design Group collaborated to prepare an *Environmental Site Overview* and *Village Center Revitalization Assessment*, respectively. The purpose of these documents was to provide a general overview of potential brownfield sites in the Village Center and include environmental data to be used in the site prioritization. While the Town Brownfields Steering Committee developed the initial list of potential brownfield sites within the Village Center, it was subsequently revised within these documents primarily based on a review of Town and State files. The final revised list included a total of 23 potential brownfield parcels within the Village Center; the majority of which had once operated as bell manufacturers, cotton and silk manufacturers, automotive repair facilities, toy manufacturers, dry cleaners and/or gas stations.

During the 2015 Brownfields Inventory Update, Fuss & O'Neill assessed the current conditions of these parcels and other properties within the Village Center to provide updated information regarding their status. The results of the file review did not identify new parcels that would qualify as additional Brownfield sites, other than those that were already previously identified. Refer to *Table 1* for a summary of the Brownfield parcels previously identified within Village Center and to *Figure 2* for their locations.

It is noted that this review was not conducted as an effort to determine the parcels' compliance with applicable regulatory programs; although several parcels were identified to be subject to State cleanup programs as summarized in *Table 2*.

3.1 Significant Changes/Assessments Since 2005

Since the initial Brownfield Inventory was conducted, several environmental assessments (performed using both private funding sources and the federal EPA grant) have been conducted within the Village Center and several parcels within Village Center changed significantly through building demolition, redevelopment, renovations or reuse.

The general results of the environmental assessments that were reviewed as part of the brownfield inventory update are summarized per property on *Table 1*. Additionally, as part of the EPA grant expenditure, a 2015 Groundwater Quality Assessment was conducted to provide a preliminary screening level assessment of the existing groundwater conditions of the unconsolidated deposits aquifer within the Village Center. As part of this assessment, monitoring wells were installed (on town-owned parcels and right-of-ways) and groundwater samples were collected from the new monitoring wells and select existing wells on town-owned parcels. A general objective of this assessment was also to help identify if potential continuing sources of contamination to the unconsolidated deposits aquifer exists within the Village Center. Information obtained from this assessment have been incorporated into the general summaries of the pertinent properties from which samples were collected.





Parcels previously identified as abandoned or underutilized properties in the 2005/2006 assessments which have since had relatively significant changes or modifications are discussed below, while less significant changes to other parcels that have occurred since 2005 are described in *Table 1*. Note that determination of the compliance status with regard to environmental cleanup objectives for the parcels was beyond the scope of work for this document.

Bevin Brothers Manufacturing - 10 Bevin Road/2 Bevin Boulevard



In May 2012, a fire destroyed the majority of the site buildings on the property. Documents reviewed in the Town's building department indicated that asbestos abatement and the demolition of all remaining structures was conducted in 2013. Post-demolition inspection notes, dated October 2013, indicated that a portion of one building was left based on the owner's plan to rebuild. In the meantime, the Bevin Brothers Manufacturing company is operating at a temporary address, 17 Watrous Street.

The parcel at 10 Bevin Road (also identified as 2 Bevin Boulevard) historically operated as the Bevin Brothers Bell Manufacturing facility since the 1880s, with the majority of its structures built in 1880, 1904-1910. Previous file reviews identified this parcel on the toxic release inventory system and as a large quantity generator of hazardous wastes. The historic use of trichloroethylene and perchloroethylene, as well as the presence of a 10,000-gallon underground storage tank was also noted on this property.



Former Metal Allied Finishing - 10 Summit Street



The parcel at 10 Summit Street was formerly occupied by Allied Metal Finishing from 1983-the early 1990's; prior to which, it had various other Site occupants including manufacturing, a cable company and fishing equipment company dating back to approximately 1925. This property was vacant and underutilized since the early 1990's. Based on the industrial uses of this property in the past and the presence of underground petroleum storage tanks, this parcel was initially identified as having a "medium" environmental risk.





Since that time, this parcel was sold in 2012 and the land use zone was changed from industrial to commercial. The building was also significantly remodeled in 2012 using private funds and is currently operating as office space for a law firm and a yoga studio.



Former Bell Town Cleaners & Laundry – 97 Main Street



The property card indicates the parcel was sold in 2014, the building gutted and remodeled, and has been operating as "Po's Rice & Spice", a popular Thai/Chinese restaurant, since that time.

The property at 97 Main Street historically operated as a bakery and a barber shop in the early 1900s. Subsequently, it operated as a residence and commercial businesses, including the Bell Town Cleaners & Laundry, a dry cleaning facility. This parcel remained vacant and in disrepair for several years.



Former Gong Bell Manufacturing – 103 Main Street



Historically, this parcel was occupied by the former Gong Bell Manufacturing Company. The property also operated as a former paint shop and sheet metal manufacturing facility. The majority of the building was destroyed in controlled fire exercises in the late 1990's with the exception of a small brick structure. Using EPA brownfields funding, a May 2005 Phase I Environmental Site Assessment (ESA) identified four potential areas of concern on the property which were investigated as part of a September 2005

Phase II ESA. The results of the Phase II ESA indicated that releases of petroleum and/or other hazardous substances had occurred at the property; therefore, a remedial investigation, soil remediation activities and a remedial action report were conducted between 2010 and 2011.



Site remediation activities conducted in 2011 included the demolition of the remaining structure, grading and relocation of contaminated soil on-site and the placement of an impermeable barrier below a layer of clean backfill material. The parcel was subsequently paved and redeveloped for use as a public parking lot. Post-remediation groundwater monitoring and an environmental land use restriction, which will prohibit the disturbance of subsurface materials, are currently pending. A groundwater sample was collected from this parcel, however, in April 2015



during Fuss & O'Neill's Groundwater Quality Assessment. This sample was analyzed for petroleum hydrocarbons and volatile organic compounds; none of which were detected above laboratory reporting limits.

Former Water Tower Property – 3 Walnut Avenue



This parcel was historically the location of the East Hampton Bell Company (ca 1851) and was later occupied by a plastic manufacturer in the 1960s-1970s. In the 1980s, only a small pump house, water tower and two adjoining structures remained and the intent for the parcel was to provide fire suppression water to the adjacent Village Center industries. The buildings were used for commercial storage, however they were found to be in disrepair during environmental investigations conducted in 2006.

A Phase I ESA was conducted in 2006 followed by a Phase II ESA to investigate the areas of concern identified on the property. These investigations indicated that releases to the environment had occurred which resulted in the presence of elevated concentrations of petroleum hydrocarbons, VOCs and metals in soil and/or groundwater. The building structures and water tower have since been demolished using grant funding awarded by the Department of Economic and Community Development (DECD) and the property is currently a grassy lot bounded by the Pocotapaug Creek.



Recently, during Fuss & O'Neill's 2015 Groundwater Quality Assessment, a monitoring well was installed on this parcel near the Walnut Avenue boundary. Analytical results from an April 2015 groundwater sample identified trace concentrations of polycyclic aromatic hydrocarbons.

Additionally, it is noted that the long standing water tower formerly located on the property at 1 Watrous Street was recently removed in early 2015. Although no specific changes to the site building or general use of the property were identified, the removal of a blighted and structurally unsound water tower adds to the Town's efforts to revitalize the historic properties in the Village Center.



3.2 Properties Removed from Brownfield Inventory

Since the initial brownfield assessment was conducted, the inventory of underused, abandoned or vacant properties has been significantly reduced. During the 2015 Brownfield inventory update, in addition to the parcels discussed above, several properties that were initially identified as potential brownfield parcels were re-evaluated and removed from the brownfield inventory. These parcels and the rational for their removal from the brownfield inventory include the following:

Address	Site Name	Rationale for Removal from Brownfield Inventory				
5 Barton Hill Road	Train Station Motors	The property is fully utilized with a successful business operation.				
85/85R Main Street	EMS Mailing	The property is fully utilized with a successful business operation.				
90 Main Street	Former Restaurant	There is a new owner as of 2015; on-going site development is occurring.				
100/102 Main Street	G&S Services	The property is fully utilized with a successful business operation.				
115 Main Street	Former SNET	The property is owned and fully utilized by Frontier Communications.				
21, 25 & 29 Skinner Street	Brookside Industrial Complex	Recent renovations and non-profit performing arts center; long standing landscaping business operation & overall appears generally utilized				
26 Skinner Street	Lyon & Billard Company	The property is fully utilized with a successful construction business operation.				
65 Skinner Street	Former Skinner Grist and Saw Mill	The property is fully utilized with a successful commercial business operation.				
12-14 Summit Street	Nesci Enterprises	The property is fully utilized with several successful commercial business operations.				
17 Watrous Street	Former J.C. Products	The property is currently occupied and utilized as the Bevin Bell Manufacturing facility.				

The property located at 8 Summit Street was also removed from the original list of identified brownfiled properties based on a review of available current and historical information, which did not identify significant environmental risks associated with the past residential uses of the property.

Additional information pertaining to the history of these parcels and a brief overview of the identified potential environmental concerns is provided in *Table 1*.

3.3 Remaining Brownfields Properties

Based on a review of the available information from the sources detailed in *Section 1.3*, the Village Center Brownfield inventory has been updated to include only the following 8 properties. Each of these parcels





were previously identified as brownfield properties during the 2005/2006 assessments, and specific information regarding the overall use or status of these properties is briefly discussed below.

 Former Bevin Bell Manufacturing - 10 Bevin Boulevard A May 2012 fire completely destroyed the site buildings on the property. Town records indicated that asbestos abatement and the demolition of all remaining structures was conducted in 2013. Although a portion of one building was left based on the owner's plan to rebuild, this property remains on the brownfield inventory, as it is current an underutilized, vacant parcel within the Village Center.

• GMA3 LLC – 101 Main Street

This parcel historically operated as the Gong Bell manufacturing facility, but currently appears vacant or underutilized as warehouse storage. Town files indicated the property was in violation of East Hampton's blight ordinance in 2015, which refers to outdoor vehicle storage, rusting equipment and deteriorating structures.

• Former J.C. Barton Machine Shop – 11 Skinner Street

This parcel was identified in the CT Hazardous Waste manifest in 2002 and 2007 as having generated 3,500 gallons of "environmental hazardous substance liquid" and 85 gallons of flammable liquids, respectively. This property was also previously identified in the State's UST database as having 3, 10,000-gallon gasoline USTs that were removed from the property. The site was also identified in the CT LUST database documenting a 2001 incident related to the removal of an underground storage tank.

Additionally, correspondences dated 2007 were on file at the Town's building department documenting that the parcel was connected to the Towns water supply; however was illegally supplying potable water to adjacent parcels (25-29 Skinner). Based on the correspondences reviewed, this matter appeared to result in legal action.

This property remains on the brownfield inventory based on the fact that it currently appears underutilized as a small machine shop operation.

- <u>Former Summit Thread 13 Summit Street</u>
 Although select portions of the building on this property is available rental commercial space, this property remains on the brownfield inventory due to the fact it appears primarily vacant and underutilized.
- Former East Hampton Bell Company 3 Walnut Avenue This property was partially investigated in 2006 using EPA grant funding and the vacant, decrepit buildings were demolished. This parcel remains on the brownfield inventory, however, as it is currently an under-utilized vacant parcel.
- <u>Carpenter-Hayes Paper Box 8 Walnut Avenue</u> There are documented releases of petroleum on this property; however the current status of these releases is unclear. Additionally, the building is underutilized and in disrepair; therefore the parcel remains on the brownfield inventory.



- Former Clark & Watrous Company 1 Watrous Street Although the former water tower structure was removed in early 2015, which shows progress on this parcel, this parcel has primarily been vacant, underutilized and in disrepair for several years.
- <u>Former Ghezzi Motors 13 Watrous Street</u> Select environmental investigations and soil remediation activities have occurred on this property between 2005 and 2010. In 2014, the DECD awarded the Town a grant for the demolition of the building. Currently, the parcel is vacant and the exterior of the property remains fenced. Groundwater samples were collected from existing monitoring wells during the April 2015 Groundwater Quality Assessment. Analytical results indicated trace concentrations of polycyclic aromatic hydrocarbons in each well, and a concentration of trichloroethylene above state cleanup standards in one monitoring well.

Refer to *Figure 2* for the locations of these properties. Additional information for each property is also included on *Table 1* and within the property's individual Site fact sheet attached as *Appendix B*. The EDR "On-Demand" results for the Village Center, which have been incorporated into pertinent sections of this report, are attached as *Appendix C*.

4 Summary

The Town of East Hampton began its Brownfield Initiative in approximately 2003 to prioritize the assessment, redevelopment and revitalization of abandoned or underutilized properties within the Village Center. Through those efforts, a total of 23 Brownfield parcels were initially identified. Between 2003 and 2006, using federal assessment grants awarded by the EPA, the Town has begun evaluating and investigating those parcels.

Since that time, significant modifications, including reuse, demolition and new construction has occurred at five of the originally identified properties. These include:

- 10 Bevin Road/2 Bevin Boulevard
- 10 Summit Street
- 97 Main Street
- 103 Main Street
- 3 Walnut Avenue

Additionally, during the 2015 Brownfield inventory update, the current status of several properties originally identified as a potential brownfield were re-evaluated and ultimately removed from the brownfield inventory. These parcels, listed below, were primarily removed from the brownfield inventory list based on the fact that they were fully utilized with successful commercial business operations.



- 5 Barton Hill Road
- 85/85R Main Street
- 100/102 Main Street
- 115 Main Street
- 21, 25 & 29 Skinner Street

- 26 Skinner Street
- 65 Skinner Street
- 12-14 Summit Street
- 17 Watrous Street

In addition to those noted above, the property at 90 Main Street was also removed from the brownfield inventory list due to the fact that there is a new owner (as of 2015) and site development activities have recently been occurring.

Overall, it appears significant changes and progress has occurred to the previously underutilized, vacant or abandoned properties within the East Hampton Village Center since the initial Brownfields Initiative began; and only eight of the original 23 properties remain on the current Brownfield Inventory. The East Hampton Brownfield Redevelopment Agency continues to be available to all current and prospective property owners in the Village Center and is willing to assist in the regulatory, assessment and remediation of the properties through direct assistance or assistance in obtaining additional grant monies.





5 References

Connecticut Department of Energy and Environmental Protection, 2014 Connecticut Environmental Conditions Online; prepared in cooperation with the University of Connecticut. Retrieved online from http://ctecoapp1.uconn.edu/advancedviewer/. Accessed on September 24, 2015.

United States Geological Survey, 1987. Middle Haddam Quadrangle, Connecticut, 7.5-Minute Series Topographic Map; United States Department of the Interior, U.S. Geological Survey, 1987

United States Geological Survey, 1987. Moodus Quadrangle, Connecticut, 7.5-Minute Series Topographic Map; United States Department of the Interior, U.S. Geological Survey, 1987

Image Data: Google, 2015; Image captures: October 2008, September 2013

Summary Report – Village Center Revitalization Assessment, East Hampton, Connecticut; TPA Design Group & AMS Consulting, LLC. December 2006

Environmental Site Overview, Village Center, East Hampton, Connecticut; Tighe & Bond, 2005





Tables





TABLE 1 Summary of Brownfield Inventory

Village Center East Hampton, Connecticut

Site Address	Map/Block/Lo	t Site Name	Bldg Year	Historic Site Use		tal Assessment: Phase II ESA		ASTs/USTs	Current Owner	Current Status
	_			PROPERTIES			LED INVENTORY (PREVIOUSLY IDENTIFIED AS BROWNFIELDS)			
5 Barton Hill Road	02A/48/30A	Train Station Motors	1902	Train Station Depot; Auto & Lawn Mower Engine Repair	*2004		Historic use as auto body service and repair shop & use of	(1) 275 Gal heating oil AST & (1) 275	Binge, Blair J. (03/1994)	Automobile repairs
5 Barton min Koad	02A/40/30A		1702	main station bepot, Auto & Lawin wower Engine Repair	2004		petroleum products Listed within the CT Property Transfer Program, indicated	gal waste oil AST	Dirige, Diali 3. (03/1774)	Automobile repairs
85/85R Main Street	06A/61/7A	EMS Mailing	1919	Starr Brothers Bell Company; L&W Industries Inc.; Supermarket			hazardous waste may have been generated on the property (Form III was filed in 1987)	a None Registered	Gspeed Realty LLC (03/2005)	Commercial; storage
90 Main Street	02A/48A/2	Former Restaurant	1920	Restaurant	*11/2014		Unknown	None Registered	IH90Main LLC (02/2015)	Vacant - New site development activities beginning
97 Main Street	06A/57/1A	Former Bell Town Cleaners & Laundry	1890	Dry Cleaner			Historic use of PCE in dry cleaning operations	None Registered	Fong Poyee (09/2014)	Site was sold and the building completely remodeled in 2014 and is now operating as a restaurant
100 Main Street	02A/49/2	G & S Service Inc.	1959	Former N.N. Hill Toy Manufacturing; Former Gas Station			Historic manufacturing, gas station & auto repair operations; spills - 100 gal diesel (1998) & unkn amount diesel (1999)	2 (3) gasoline USTs (removed in 2004)	Sgoff Enterprises LLC (05/2004)	Automobile repairs
103 Main Street	06A/57/2B	Former Gong Manufacturing Paint Shop	1800s	Former Paint Shop for Gong Bell Manufacturing Company: Sheet Metal Manufacturing	08/2003	09/2005 (*RI 2010 & RAR 06/2011)	Historic use as paint shop (VOCs) & metal manufacturing (metals, potential VOC degreasers)	None Registered - potential oil UST	Town of East Hampton (10/2003)	Town public parking Iot - Remedial investigation conducted in 2010 and Sit remediation conducted in 2011. Remediation activities included the demolition of remaining structures, grading & relocation of impacted soil and the placement of an impermeable barrier and final paving for use as a parking Iot. A 2015 groundwater sample indicated perforeant yofrocarbor and volatile organic compounds were not detected. Land use restriction is pending.
115 Main Street	06A/57/5A	SNET	1952	SNET Office since 1952 (prior use unknown)			Listed within CT Property Transfer Program indicating hazardous waste may have been generated on the property / potential petroleum impacts resulting from LUST	Registered USTs- 1,000 gallon diesel UST and 550 gallon heating oil UST (both removed 8/2009); 1,000 gallon heating oil tank (removed 8/1993)	Frontier Communications of CT (11/2014)	Currently operating as the Frontier Communications Source Center - 2 undergound storage tanks were removed in 2009.
	02A/49/1-2 (21)				*05/2006		Historic use of TCA, Former coal/iron storage areas; Former		Scott Energy Inc. (11/2005)	B&S Landscaping
21, 25- Skinner Street	02A/49/1-3 (25)	Brookside Industrial Complex	1900s	N.N. Hill Brass Company (1900-1940s) - Bell & toy manufacturing;	*05/2007		RCRA Large/Small Quantity generator, metal wastes from stamping cylinders, DEP audit documenting Pressure Pak user	None Registered - 2 former 10,000- d gallon fuel oil USTs and at least one	Epoch Arts Inc. (01/2008)	EPOCH Arts - a non-profit youth art, film & theater organization
29	02A/50/1-5 (29)			Pressure Pak - pressurized cylinders manufacturing	*05/2006		111-trichloroethane, and disposed of oils and paints to the ground surface	275-gallon fuel oil AST	Old School Masonry LLC (09/2011)	35% of building rented as Industrial Space / remaining portions of building appear vacant
26 Skinner Road	02A/48A/9	The Lyon & Billard Company	1930	Construction/Lumberyard			Potential petroleum use	Unknown - Property card indicates heating fuel is oil	Lumber 3 LLC (06/2011)	Lyon & Billard Lumber Company - lumberyard and construction
65 Skinner Street	20/50/23-1	Former Skinner Grist and Sawmill	1880	Skinner Grist and Saw Mill (circa 1800 - approx. 1974)			Historic mill operations	None Registered	CCMZ Properties LLC (03/2006)	Sold in 2006: currently operating as CZ Equipment LLC, an outdoor power equipment, retail, service & repair company
10 Summit Street	06A/61/2	Former Metal Allied Finishing	1914	Veazy & White Bell Company; Metal finishing	12/2003		Historic use of petroleum products, metals & potential degreasers (VOCs)	None registered - fill pipes formerly visible on property	10 Summit St LLC (12/2012)	Remodeled - Commercial Office Space
12-14 Summit Street	06A/61/1	Nesci Enterprises	1900	Star Brothers Bell Company; Veazy & White Bell Company; Cleaning Operations; Small engine repair; welding; cabinet making			CT DEEP Suspected hazardous waste site; Former RCRA Large/Small Quantity Generator (waste solvents, VOCs)	Oil UST noted on Sanborn Map	RSN Inc (06/2005)	Sal's Small Engine Repair, Nesci's Factory Store (steel, welding, bending & saw cutting) & Harvey's Appliances
17 Watrous Street	06A/59/8	Former J.C. Products	1910	Star Brothers Bell Company; Summit Thread; Plastic Manufacturing			Historic use of petroleum products & metals in former Bell manufacturing operations	None Registered - former 1,000- gallon AST inside building	IHEH LLC (10/2013)	Currently operating as the temporary Bevin Bell Manufacturing facility
				manuracturing	PREV	IOUSLY IDENTI	FIED REMAINING BROWNFIELD PARCELS	galion AST inside building		
10 Bevin Road	05A/62A/14H	Former Bevin Bros. Manufacturing	1880	Bevin Brothers Bell factory since 1880			Historic use of PCE & TCE in site operations, former RCRA	10,000-gallon oil UST noted on	Stanley R. Bevin (12/1974)	Vacant - building burned 05/2012, remaining portions of structures
				,			Large Quantity Generator Potential historic use of petroleum products & VOCs in site	Sanborn Map		demolished in 2013
101 Main Street	06A/57/2	GMA3 LLC	1900	Gong Bell Manufacturing; Bell Manufacturing			operations	None Registered	GMA3 LLC (10/2003)	Unknown; Appears vacant
11 Skinner Street	02A/49/1-1	Former J.C. Barton Machine Shop	1967	N.N. Hill Brass Company; Bell and Toy Manufacturing	*06/2001		Historic use of petroleum products & metals in former bell/to manufacturing operations & recent machine shop operations / 2007 hazardous waste manifest documenting waste flammable liquids generated			currently operating as a machine shop
13 Summit Street	06A/62/2A	Former Summit Thread	1900	Cotton & Silk Thread manufacturer / Metal finishing			CT DEEP Suspected hazardous waste site; Former tenant (Fox Cleaners) was RCRA Large Quanitity Generator (waste solvents, VOCs)	None Registered	Mercedes Zee Corporation LLC (12/2011)	Rental commercial studios & Vacant industrial/commercial space
3 Walnut Avenue	06A/60/2	Former East Hampton Bell Company	1851	Bell Manufacturing	03/2006	05/2006	Historic use of petroleum products & metals in former Bell manufacturing operations	None registered - fill pipes and concrete UST containment vault formerly visible on property	Town of East Hampton (09/2008)	Derelict blighted structures were razed in approximately 2008 and the site now a vacant grassy lot. A 2015 groundwater sample indicated trace concentrations of polycyclic aromatic hydrocarbons in groundwater.
8 Walnut Avenue	06A/57/2A	Carpenter-Hayes Paper Box	1875	Gong Bell Manufacturing; Paper Box & Rubber Stamp Making			LNAPL identified during installation of a dug well in 2001; 500 gal heating oil spill	None Registered - 50 gal gasoline tank noted on Sanborn Map, heating oil spill suggests heating oil tank	Russo, Susan (60%) & Mellen, Jason (40%) (06/2015)	Cardboard box, packaging pouches, egg trays & packaging trays manufacturing
1 Watrous Street	06A/59/12A	Former Clark & Watrous Company	1927	Merrick & Conanat Silk Factory; Auto repair; Wood cabinet construction			100 Gal Fuel Oil release (2001); Former RCRA Large/Small Quantity Generator (cyanide & VOC wastes)	None Registered - Property card indicates heating fuel is oil	Yenwod Realty LLC (06/2007)	Appears to be Vacant Industrial Space (Property in foreclosure circa 2014)
13 Watrous Street	06A/59/12	Former Ghezzi Motors	1900	Auto repair: Autobody paint shop: Manufacturing Powerhouse for Summit Thread Company	05/2005	08/2005 (RAP 05/2010	Former coal storage; PCB impacted soil (some remedial activities conducted): Soil & GW impacts (VOCs, Metals, etc.) Sig. Env. Hazard Notification	None Registered - gasoline UST noted on Sanborn map; 3 300-gallon motor oil ASTs	Town of East Hampton (12/2002)	Vacant Industrial Space - Limited soil remediation conducted in 2010. Building demolition is currently pending. Groundwater samples collected during the 2015 Groundwater Quality Assessment Indicated trace concentrations of PAHs in groundwater, and a concentration of TCE above state cleanup standards in one monitoring well.

<u>Notes:</u> Information provided in the table above was obtained from a variety of sources incl: Environmental Site Overview, Tighe & Bond; 2005 Village Center Revitalization Assessment, TPA Design Group; 2006

VOCs - Volatile Organic Compounds LNAPL - Light Non-Aqueous Phase Liquid TCE - Trichloroethene

PCE - Tetrachloroethane TCA - 1,1,1-trichloroethane PAHs - polycyclic aromatic hydrocarbons

Village Center Kevitalization Assessment, IPA Design Group: 2006 Available Town assessor's cards and records EDR On-Demand Database search report for the Village Center CT DEEP. Connecticut Department of Energy & Environmental Protection UST - Ludwing Underground Storage Tank RCRA - Resource Conservation Recovery Act

F:\P2011\0037\A11\Brownfields Inventory Update\Tables\Table 1 - Brownfields Summary Table REV

٠ Information indicating environmental assessments were conducted was identified; however the specific reports were not immediately available for review

Environmental assessment reports were not identified

TABLE 2 Summary of Village Center Parcel in CT Regulatory Programs

Village Center East Hampton, Connecticut

REM ID	Date Entered	SITE NAME	ADDRESS	PROGRAM	Transferor (Seller)	Transferee (Buyer)	Certifying Party	CP City/State	Relationship to Transfer	Form	Date Recv	Revised	ECAF Rec'd	Determination Date	Lead
1611		L & W Industries, Inc.	85 Main Street (Rear)	Property Transfer Program	Walter J. Smith	David Yeager				III	7/29/1987				
4035		SNET	115 Main Street	Property Transfer Program	SNET	SBC Communications Inc.	SNET/Donald Shassian		transferor	I	11/4/1998				
4225		Consolidated Plastech, Inc / (dba ConTech)	3 Watrous Street	Property Transfer Program	Consolidated Plastech, Inc.	Continental Container Corp., LLC	Consolidated Plastech, Inc.	Dallas, TX	transferor	I	6/21/1999				
8581	6/15/2007	Ghezzi Motors	13 Watrous Street	Vol_Rem_X	n/a	n/a	Town of East Hampton	East Hampton, CT	parcel owner	Х	6/7/2007	7/6/2007		12/12/2007	LEP
8867	2/14/2008	N. N. Hill Brass Company	25 Skinner Street (Lot 2)	Property Transfer Program	Brookside Industrial Park, LLC	Epoch Arts, Inc.	Epoch Arts Inc.	East Hampton, CT	transferee		2/5/2008	7/7/2008			LEP
9120	8/21/2008	Gong Bell Site	103 Main Street	Vol_Rem_X	n/a	n/a	Town of East Hampton	East Hampton, CT	parcel owner	Х	8/12/2008			9/10/2008	LEP
10899	1/10/2012	Artistic Mill (Former)	13 Summit Street	Property Transfer Program	Artistic Mill, LLC	Mercedes Zee Corporation, LLC	13 Summit St LLC	East Hampton, CT	transferee	III	12/30/2011			1/27/2012	LEP

<u>Notes:</u> Information provided in the table above was obtained from a CT Department of Energy & Environmental Protection database

of Property Transfer filings dated 04/2012 (reviewed 09/2015) REM ID - CT DEEP Remediation ID Number

CP - Certifying Party ECAF - Environmental Conditions Assessment Form


LEP - Licensed Environmental Professional

n/a - not applicable



Figures



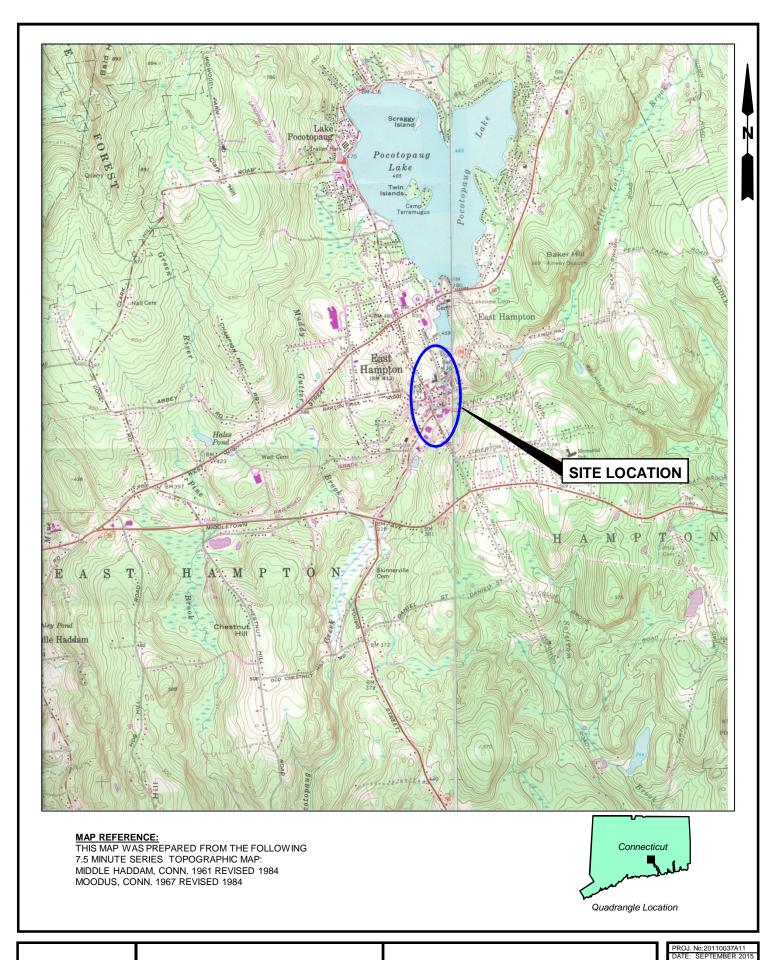


0 1000 2000 GRAPHIC SCALE SCALE: 1"=2000'



SITE LOCATION MAP VILLAGE CENTER FIGURE 1

EAST HAMPTON

CONNECTICUT

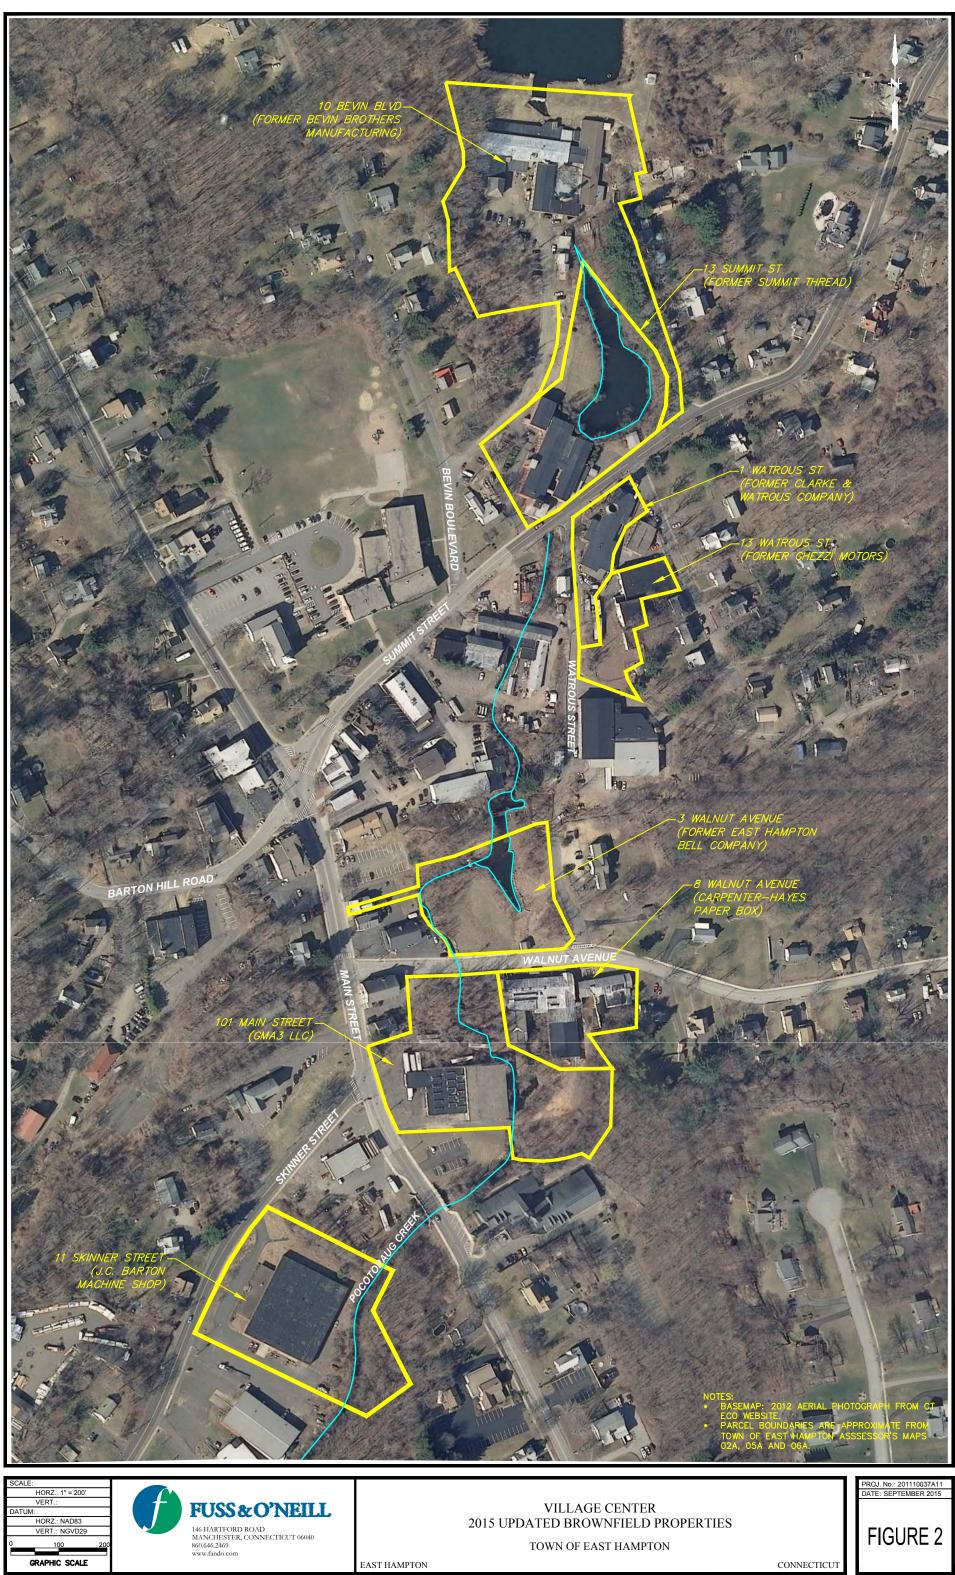

Path: J.IDWG/P2011/0037/411/Environmental/Plan/20110037/411_STP06.dwg Layout: 11X17-P Plotted: Wed, September 30, 2015 - 3:14 PM User: srochelt VIEW: [LAYER STATE:] Plotter: DWG TO PDF.PC3 CTB File: FO.STB

File



Appendix A

Sensitive Receptor Survey Update – Table 1 & Figure 1 AECOM Environment, April 2009




Table 1 DRAFT Properties Located Within a 500-ft Radius of 13 Watrous Street East Hampton, CT

			Parcel ID					
First Name	Last Name	Мар	Block	Lot	Property Address	Mailing Address (if different)	Served by Public Supply	Well Abandonment Reports
Dorino	Bastiani	6A	58	1	29 Watrous Street	21 East Street, Hebron	N	NA
Allen & Rita	Dunham	6A	58	2	Watrous Street	15 Walnut Avenue	N	NA
Allen & Rita	Dunham	6A	58	3	9 Walnut Avenue	15 Walnut Avenue	N	NA
Allen & Rita	Dunham	6A	58	2A	15 Walnut Avenue		N	NA
John & Linda	Grenman	6A	58	2B	17 Walnut Avenue		N	NA
Carol	Caplan	6A	59	2	11 Railroad Avenue		N	NA
Robert & Lorraine	Valli	6A	59	3	9 Railroad Avenue		N	NA
Tina	Velasquez	6A	59	4	7 Railroad Avenue		N	NA
Ernest	Anderson	6A	59	5	5 Railroad Avenue		N	NA
Mark & Melody	Philhower	6A	59	6	10 Starr Place	212 White Birch Road	N	NA
Mark & Melody	Philhower	6A	59	7	Railroad Avenue	212 White Birch Road	N	NA
Pheonix Redevelopment		6A	59	8	17 Watrous Street	PO Box 278, Higganum	N	NA
Merry & Leo	Williams	6A	59	9	8 Starr Place		N	NA
Donna	Daigle	6A	59	10	6 Starr Place	11 Valli Drive	N	NA
Robert	Holmes	6A	59	11	4 Starr Place	77 Peterson Street, Vernon	N	NA
Town of East Hampton	11011100	6A	59	12	13 Watrous Street	20 East High Street	N	NA
Victor	Biondi	6A	59	13	2 Starr Place	Starr Auto Body	N	NA
Wendy & Donald	Flis	6A	59	14	11 Starr Place		N	NA
Edward	Roy	6A	59	15	7 Starr Place		N	NA
William & Michelle	Drotar	6A	59	16	5 Starr Place		N	NA
Eleanor	Lancey	6A	59	17	1 Starr Place		N	NA
Phyllis	Westcott	6A	59	18	16 Summit Street	PO Box 106	N	NA
Michael & Victoria	Havey	6A	59	19	18 Summit Street		N	NA
Ronald & Gail	Petanovitch	6A	59	21	20 Summit Street		N	NA
Yenwood Realty LLC	Feldilovilon	6A	59	12A	1 Watrous Street	164 Knollwood Drive, Glastonbury	N*	N*
· · · · · · · · · · · · · · · · · · ·	Krajewski	6A 6A	59		9 Starr Place	164 Kholiwood Drive, Glasionbury	N	NA
Michael Jason	Krajewski Baltrucki	6A 6A	59	15A 17A	3 Starr Place		N	NA
		6A 6A		1A-1			N	NA
Stuart & Kimberley	Fontaine	-	59		4 Railroad Avenue	Zo Davis Dala di Marilla ang sari		
Hancin Construction LLC		6A	59	1A-2	10 Railroad Avenue	79 Park Road, Marlborough	N	NA
Brookside Industrial Park Company		6A	60	2	Walnut Avenue	11 Skinner Street	N Y	NA Y
RSN Inc		6A	61	1	12 Summit Street		Y Y	Y Y
Carl E. Vale Properties LLC	Defe	6A	61	2	10 Summit Street	58 Barton Hill	Y Y	Ý Y
Larry & Mary	Bair	6A	61	3	6 Summit Street	40 Main Office of	Y Y	
William	Devine	6A	61	4	4 Summit Street	43 Main Street	Y V	Y Y
Myrialis	Lambis	6A	61	7	87 Main Street	31 Donna Drive, Burlington	Y Y	Y Y
Michael	Cummings	6A	61	8	22 Watrous Street	91 St. Nicholas Avenue, NY, NY		
John	Witherly	6A	61	1A	4 Watrous Street	PO Box 7, Middle Haddam	Y	NA - No Well
Lionel	Valluzzo	6A	61	2A	8 Summit Street	8-B Summit Street	Y	NA - No Well
Gspeed Realty LLC		6A	61	7A	85 Main Street		Y	Ŷ
Town of East Hampton		5A	62	31	7 Summit Street	20 East High Street	Y	No- Always part of water system supply
Polly	Poulin	5A	62A	20	17 Summit Street	25 Summit St.	N	NA
Thomas & Julie	Dagle	5A	62A	21	15 Summit Street aka 1 Bevin Ct		N	NA
Chatham Historical Society		5A	62A	56	6 Bevin Boulevard	60 Colchester	N	NA
Bevin Bros MFG Co.		5A	62A	57	10 Bevin Road	PO Box 60	N	NA
Bevin Bros MFG Co.		5A	62A	58	10 Bevin Road	PO Box 60	N	NA
Bevin Bros MFG Co.		5A	62A	14H	Bevin Road	PO Box 60	N	NA
Helene	Dipace	5A	62A	1A	2 Bevin Boulevard	· · · · ·	Y	Ŷ
Artistic Mill LLC		5A	62A	2A	13 Summit Street	30 Lafayette Square, Vernon	N	NA

Notes:


Bold italicized cells indicate properties that are serviced by public water.

Well abandonment reports were verified to be on file at the East Hampton WPCA where indicated.

The highlighted row indicates this is the subject property.

*According to the East Hampton WPCA, the original well may still be in use as no abandonment permit was obtained. Additionally, the public water supply service was terminated at this location.


X:\60096355 (East Hampton Watrous)\500 Project Submittals\SRS\500 ft Radius East Hampton rev2.xls\Sheet1

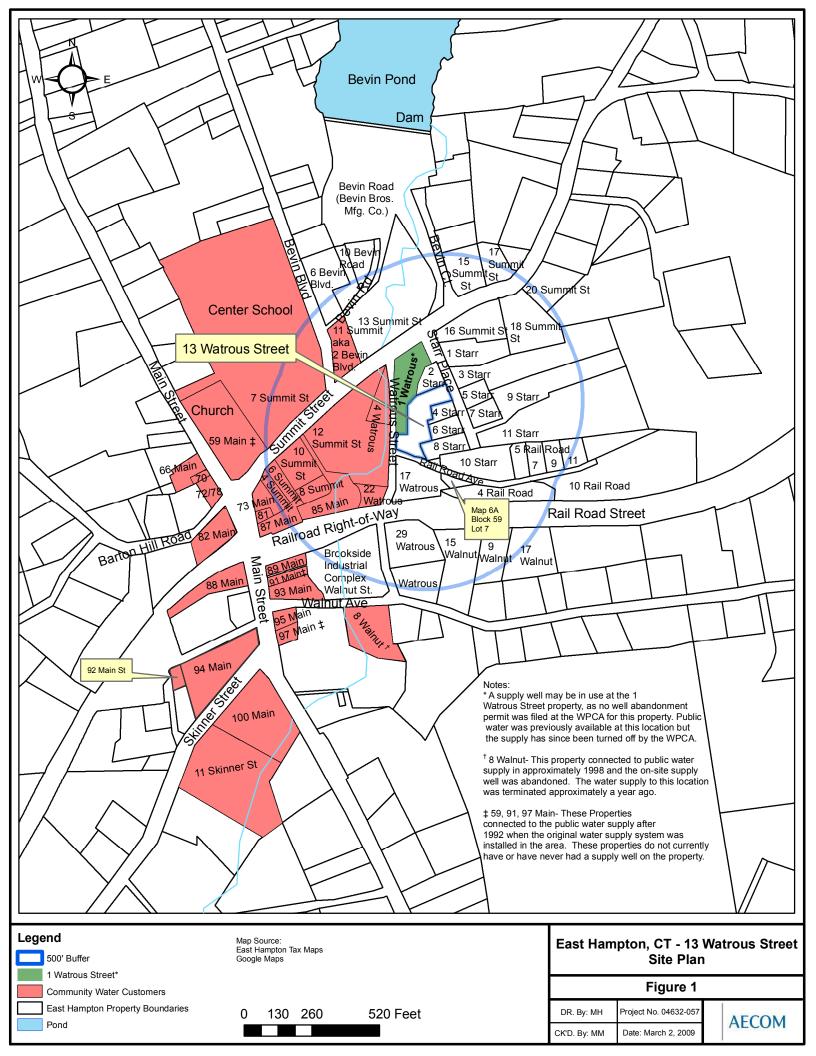



Appendix B

Site Fact Sheets



Bevin Bros. Manufacturing (10 Bevin Road)



Site Photograph (circa 2005)

Aerial Photograph (circa 2014)

General Property Information

Tax Assessors Code: 05A/62A/14F Acres: 4.81

Number of Structures: 5 - Fire destroyed structures in 05/2012 (1 partial structure remains) Year Structure Built: 1880 (burned in 2012) Owners Name: Stanley R. Bevin Owners Address: P. O. Box 60, 10 Bevin Road East Hampton, CT

Current Use: Vacant

Historic Use: Bevin Brothers Bell factory (~1880-2012)

Total Square Feet: 54,203 ft² **Total Basement Area:** 0 ft²

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
12/31/1974	Bevin, G.	Bevin, Stanley R.	122/392
09/30/1949	Bevin Bros. Mfg Co.	Bevin, Stanley A.	67/537-538
02/01/1904	Bevin, Avery A. & Chancey G.	Bevin Bros.	40/281

Environmental Setting/Information

Establishment Status: Likely – Former RCRA generator, TRI facility

Prior Environmental Site Assessment: None Found - Town records searched 09/2015

Bevin Bros. Manufacturing (10 Bevin Road)

Topographic Quad Name: Middle Haddam and Moodus

Groundwater Class: GAA - Well Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Bevin Pond

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: None listed as of 09/2015

ASTs/USTs: None registered with the state as of 09/2015; however, a 10,000-gallon buried oil tank is depicted on historical Sanborn maps

File Search:

2005

Bevin Brothers is listed on the Toxic Release Inventory System (TRI) for the reporting of copper. It was also formerly listed as a large quantity generator under the Resource Conservation and Recovery Information System (RCRA); however its status was changed to a conditionally exempt small quantity generator in 1996. CT DEEP file review noted the historic use of trichloroethylene and perchlorethylene on site.

<u>2015</u>

A May 2012 fire destroyed the majority of the Site's buildings. Town building department files indicate that a demolition permit was obtained in July 2013 and the demolition of remaining portions of the structures occurred. Asbestos abatement also occurred at this time. A portion of one of the structures was left due to the owners plan to rebuild.

No additional information was provided in the EDR database report aside from OSHA inspection/violation listings between 2007 and 2012. P.S.I. Plus Inc., a manufacturer of high pressure gas cylinders was also identified as a former tenant at 10 Bevin Road, prior to the 2012 fire.

Site Visit Comments:

2005

A narrow and unpaved access road, known as Bevin Road, extends off of Bevin Boulevard and leads to the site. The road runs behind the property at 13 Summit Street. Bevin Road runs parallel to Summit Street in a northeastern direction.

<u>2015</u>

A Site visit was not conducted; however a 2015 windshield survey confirmed that the Site buildings have been demolished with the exception of a small portion of one structure.

Former Clark and Watrous Company (1 Watrous Street)



Site Photograph (Circa 2005)

Site Photograph (September 2015)

General Property Information

Tax Assessors Code: 06A/59/12A Acres: 0.51

Number of Structures: 5 Year Structure Built: 1927

Total Square Feet: 10,627 ft² **Total Basement Area:** 0 ft² Owners Name: Yenwod Realty LLC Owners Address: 164 Knollwood Drive Glastonbury, CT

Current Use: Appears to be Vacant Industrial Space (Property in foreclosure circa 2014)

Historic Use: Merrick & Conanat Silk Factory, Summit Thread, electric manufacturing, auto repair, wood cabinet construction/repair, furniture repair/refinishing

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
06/04/2007	Erbe, Keith	Yenwod Realty LLC	462/48
12/11/2001	Erbest LLC	Erbe, Keith	341/509
02/12/1998	Axelrod, Jack	Erbest LLC	295/774
05/26/1976	Smetaniuk, N & M	Barton, J C Jr.	264/289
11/30/1943	Planeta, R	Planeta Realty	63/297-299
01/24/1941	Sawyer Displays Inc.	Planeta, R	58A/399-402
01/24/1941	Sawyer, D	Sawyer Displays Inc.	58A/399-402

Environmental Setting/Information

Establishment Status: Likely - potential furniture stripping

Prior Environmental Site Assessment: None Found - Town records searched 09/2015

Former Clark and Watrous Company (1 Watrous Street)

Topographic Quad Name: Middle Haddam and Moodus

Groundwater Class: GA - Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: A release of 100-gallons of No. 2 fuel oil occurred (1998-2001, exact date could not be confirmed)

ASTs/USTs: None registered with the state as of 09/2015

File Search:

2005

The former location of Starr Brothers Manufacturing. A documented spill of No. 2 fuel oil occurred on site. Former RCRA large/small quantity generator.

2015

Building department files between 2005 and 2015 refer to violation with regards to vehicle storage and "illegal junkyards". In 2013 the owner failed to notify the town about blighted conditions on the Site, including dilapidated buildings, fire and safety hazards, and interference with abutting premises. In 2015, the on Site water tower was characterized as an "unsafe" and "dangerous" structure and was subsequently removed.

Site Visit Comments:

<u>2005</u>

The property presents significant accessibility issues. The driveway leading on the property is unpaved and very limited parking is available. Watrous Street and Summit Street are the only roads that access the property. A large water tower that connects to the building is located at the base of Watrous Street and Summit Street.

<u>2015</u>

A site visit was not conducted. The 2015 windshield survey confirmed that the water tower structure has been removed. No other significant changes were observed.

GMA3 LLC (101 Main Street)



Site Photograph (circa 2005)

Site Photograph (September 2015)

General Property Information

Tax Assessors Code: 06A/57/2 Acres: 2.52

Number of Structures: 2 Year Structure Built: 1900 Owners Name: GMA3 LLC Owners Address: P.O. Box 718 Colchester, CT

Current Use: Vacant, warehouse

Total Square Feet: 17,665 ft² **Total Basement Area:** 0 ft²

Historic Use: Gong Bell manufacturing, bell manufacturing

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
10/23/2003	Einhorn, Sumner & Sheila	GMA3 LLC	390/997
04/04/1985	Unknown	Einhorn, Sumner & Sheila	182/64
01/20/1983	Barba	Villa	162/257
10/04/1979	Borruso	Barba	146/554
09/19/1972	Ramondetta	Barba	111/304
02/09/1971	Newconn Corp	Barba, Borruso, & S&J Ramondetta	103/56

Environmental Setting/Information

Establishment Status: Likely

Prior Environmental Site Assessment: None Found - Town records searched 09/2015

GMA3 LLC (101 Main Street)

Topographic Quad Name: Middle Haddam Groundwater Class: GA- Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: None listed as of 09/2015

ASTs/USTs: None registered with the state as of 09/2015; however a 50-gallon gasoline tank was indicated on historic Sanborn maps

File Search:

<u>200</u>5

No additional information found.

2015

Building department files indicate that the Site was in violation of East Hampton's Blight Ordinance in 2015. This specifically refers to outdoor vehicle storage, rusting equipment and deteriorating structures.

Site Visit Comments:

2005

Main Street is the primary access point to the property, though the site can also be accessed by way of Skinner Street (CT-Rte. 196). The site is located adjacent to a watercourse known as Pocotopaug Creek, running parallel to CT-RTE. 196. The building on the premises is a large, one-floor complex.

2015

A site visit was not conducted. No significant changes were observed during a 2015 windshield survey.

Carpenter-Hayes Paper Box (8 Walnut Avenue)





Site Photograph (circa 2005)

Site Photograph (September 2015)

General Property Information

Tax Assessors Code: 06A/57/2A

Acres: 1.09

Number of Structures: 5 Year Structure Built: 1875

Total Square Feet: 26,570 ft² **Total Basement Area:** 0 ft² Owners Name: Russo, Susan (60%) and Mellen, Jason (40%) Owners Address: 245 Blood Street Lyme, CT

Current Use: Cardboard box, packaging pouches, egg trays & packaging trays manufacturing

Historic Use: Gong Bell Manufacturing, paper box & rubber stamp making, box painting

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
06/18/2015	Chassuru LLC	Russo, Susan (60%)/Mellen, Jason (40%)	556/690
04/09/2013	Walnut Creek Prop. LLC	Chassuru LLC	536/793
08/15/2005	8 Walnut LLC	Walnut Creek Prop. LLC	429/122
10/12/2004	Stoddard, Bonita Fins	8 Walnut LLC	411/829
10/07/1993	Irving Fins	Stoddard, Bonita Fins	262/701
9/22/1920	Gong Bell Manufacturing	Carpenter, M	62/620

Environmental Setting/Information

Establishment Status: Likely – Former Large Quantity generator, potential auto body repair Prior Environmental Site Assessment: None Found - Town records searched 09/2015

Carpenter-Hayes Paper Box (8 Walnut Avenue)

Topographic Quad Name: Middle Haddam and Moodus

Groundwater Class: GA - Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: A release of approximately 500-gallons of heating oil occurred in 1988 and an oil substance was subsequently found in a 9 foot dug well (2001)

ASTs/USTs: None registered with the state as of 09/2015; however a 50-gallon gasoline tank was indicated on historic Sanborn Maps

File Search:

2005

Documented solvent use at the Carpenter-Hayes facility. A spill of heating oil (~500 gallons) was documented on site.

<u>2015</u>

Building department files indicate that the building was vacant in 2001. In 2008, the Town of East Hampton instructed the Site to stop automotive repair work on the Site. Between 2011 and 2012 the owner was instructed to take corrective action after the roof collapsed in two sections of the building. The structural integrity of the building was questioned after the incident. OSHA performed multiple inspections and reported violations during the late 1990s and early 2000s.

Site Visit Comments:

<u>2005</u>

No additional comments.

<u>2015</u>

A site visit was not conducted. No significant changes were observed during a 2015 windshield survey.

Former East Hampton Bell Company (3 Walnut Avenue)



Site Photograph (circa 2005)

Site Photograph (September 2015)

General Property Information

Tax Assessors Code: 06A/60/2 Acres: 1.53

Number of Structures: 0

Year Structure Built: 1851 (former manufacturing buildings demolished in 1980s; subsequent remaining 2 structures demolished between 2008 and 2012)

Owners Name: Town of East Hampton Owners Address: 20 East High Street East Hampton, CT

Current Use: Vacant, grassy lot

Historic Use: Bell Manufacturing

Total Square Feet: 0 ft² **Total Basement Area:** 0 ft²

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
09/23/2008	Brookside Industrial Co.	Town of East Hampton	481/202
11/08/2001	Barton, J C Co.	Brookside Industrial	339/518
08/23/1972	Unknown	Barton, J C Co.	110/517

Environmental Setting/Information

Establishment Status: Not Likely

Prior Environmental Site Assessment: Phase I ESA, Tighe & Bond, March 2006 Phase II ESA, Tighe & Bond, May 2006

Former East Hampton Bell Company (3 Walnut Avenue)

Topographic Quad Name: Middle Haddam and Moodus

Groundwater Class: GA - Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: None reported as of 09/2015

ASTs/USTs: None registered with the state as of 09/2015; however, fill pipes and a concrete UST containment vault were formerly visible on the property

File Search:

2005

No additional information found.

<u>2015</u>

According to town file information, the water tower formerly located on this parcel was removed in October 2008. Subsequent to that time, the site buildings were demolished. During the 2015 Groundwater Quality Assessment, Fuss & O'Neill installed a monitoring well on this parcel near the property boundary along Walnut Avenue. Analytical results from an April 2015 groundwater sample identified trace concentrations of polycyclic aromatic hydrocarbons.

Site Visit Comments:

2005

No additional comments.

<u>2015</u>

A site visit was not conducted. The 2015 windshield survey confirmed that this parcel is currently a vacant, grassy lot.

J.C. Barton Machine Shop (11 Skinner Street)



Site Photograph (circa 2005)

Site Photograph (September 2013)

General Property Information

Tax Assessors Code: 02A/49/1-1 Acres: 2.24

Number of Structures: 2 Year Structure Built: 1967

Owners Name: 11 Skinner Street LLC Owners Address: 6900 Wisconsin Avenue Suite 700 Chevy Chase, MD

Current Use: Machine Shop

Total Square Feet: 30,660 ft² **Total Basement Area:** 0 ft² **Historic Use:** Brookside Industrial complex, office space, N.N. Hill Brass company, bell and toy manufacturing

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
03/01/2007	JCB Real Estate LLC	11 Skinner Street LLC	458/211
11/08/2001	Brookside Industrial Park	JCB Real Estate LLC	339/519
11/08/2001	J.C. Barton Co.	Brookside Industrial Park	339/518
11/16/1973	Belltown Indus. Corp.	J.C. Barton Co.	117/271
06/30/1967	Belltown Indus. Corp.	J.C. Barton Co.	91/427
10/14/60	N.N. Hill Brass Co.	Belltown Indus. Corp.	91/157

Environmental Setting/Information

Establishment Status: Not Likely

Prior Environmental Site Assessment: Phase I ESA, EnviroScience Consultants, Inc., June 2001

J.C. Barton Machine Shop (11 Skinner Street)

Topographic Quad Name: Middle Haddam Groundwater Class: GA- Impaired Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss. Surficial Geologic Material : Thin Till Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: None listed as of 09/2015

ASTs/USTs: Three registered USTs are associated with the Site: two 10,000-gallon gasoline tanks (removed in January 1990; and one 10,000-gallon gasoline tank (last used in 2009). Documentation of the removal of this tank were not reviewed. Additional documentation indicates the removal of a potential fourth 10,000-gallon UST in 2001. The Site was entered in CT LUST database in 2010.

File Search:

2005

Sanborn maps indicate the N.N. Hill Brass Company existed in the area of the Site during the early 1900's. The 2001 Phase I Environmental Site Assessment identified four recognized environmental conditions including: a pad mounted transformer, a 10,000-gallon UST (presumably the one last used in 2009), septic tank/floor drains (abandoned), and wastes generated and stored on Site.

2015

Building department files indicate that the Site was considering subdividing the property in 2000. Dwight Barton of J.C. Barton building indicated that the underground storage tanks on Site had been removed. The Site violated the State Health Code and Town regulations concerning their potable water, which they were allegedly supplying to 25-27 Skinner Street. Correspondence between the Town of East Hampton and D'Aquila & Brooks. LLC attempts to settle the water system interconnection and subdivision issue in 2007.

Site Visit Comments:

2005

Ample driveways and parking lots exist on the site. The site is accessible only through Skinner Street (CT-Rte.196).

<u>2015</u>

A site visit was not conducted. No significant changes were observed during a 2015 windshield survey.

Former Summit Thread (13 Summit Street)





Site Photograph (Circa 2005)

Site Photograph (September 2015)

General Property Information

Tax Assessors Code: 06/62/2A Acres: 2.10

Number of Structures: 4 Year Structure Built: 1900

Total Square Feet: 19,160 ft² **Total Basement Area:** 4,794 ft² Owners Name: Mercedes Zee Corporation LLC Owners Address: P.O. Box 242 East Haddam, CT

Current Use: Rental commercial studios & Vacant industrial/commercial space

Historic Use: Summit Thread, cotton and silk thread, manufacturer / metal finishing

Ownership/Sale History:

	Date	Grantor	Grantee	Volume/Page
	12/06/2011	Artistic Mill LLC	Mercedes Zee Corp. LLC	519/728
	01/14/2002	13 Summit Street Assoc.	Artistic Mill LLC	343/399
ĺ	09/23/1987	Unknown	13 Summit Street Assoc.	210/757

Environmental Setting/Information

Establishment Status: Likely – Fox Cleaner's (a dry cleaner) was former tenant

Prior Environmental Site Assessment: None Found - Town records searched 09/2015

Former Summit Thread (13 Summit Street)

Topographic Quad Name: Middle Haddam and Moodus

Groundwater Class: GA - Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >100 feet

Spills/ Releases: None listed as of 09/2015

ASTs/USTs: None registered with the state as of 09/2015

File Search:

2005

A documented spill occurred at the corner of Summit and Watrous outside the property. The Sanborn Maps document the location of Summit Thread Manufacturing dating back to the early 1900's.

<u>2015</u>

Building department files dated 2006 indicate that the Town of East Hampton had requested actions to remove junk cars stored on the property. In 2012 permits were obtained to perform demolition (presumably interior) and lead abatement was performed. Asbestos abatement information was not available. In 2014, the property was eligible for the "village housing overlay zone" to allow residential use on the upper floors.

State files indicate that the Site entered the Property Transfer Program on 01/10/2012. A Form III (discharge, spillage, uncontrolled loss, seepage, filtration of hazardous waste has occurred and has not been fully remediate or environmental conditions are unknown) was submitted for the transfer to Mercedes Zee Corporation, LLC. No other information was reviewed.

Site Visit Comments:

<u>2005</u>

The primary access road to the property is through Summit Street, although the site could not be accessed through Watrous Street.

<u>2015</u>

A site visit was not conducted. No significant changes were observed during a 2015 windshield survey.

Former Ghezzi Motors (13 Watrous Street)



Site Photograph (Circa 2005)

Site Photograph (circa 2012)

General Property Information

Tax Assessors Code: 06A/59/12 Acres: 1.36	Owners Name: Town of East Hampton Owners Address: 20 East High Street East Hampton, CT
Number of Structures: 3 Year Structure Built: 1910 (addition approx. 1936)	Current Use: Vacant industrial space
Total Square Feet: 11,518 ft Total Basement Area: 0 ft ²	Historic Use: Auto repair, auto-body paint shop, used auto dealership, gas station, manufacturing powerhouse for Summit Thread Company, Artistic Wire Products Company

Ownership/Sale History:

Date	Grantor	Grantee	Volume/Page
12/27/2002	Ghezzi/Cartelli	Town of East Hampton	364/134
06/08/1981	Planeta, R Jr.	Axelrod J	155/107
06/23/1969	Planeta Realty	Planeta R Sr.	98/183-187
11/30/1943	Planeta R.	Planeta Realty Corp	63/297

Environmental Setting/Information

Establishment Status: Likely - Auto-body repair

Prior Environmental Site Assessment: Phase I ESA, Tighe & Bond, May 2005 Phase II ESA, Tighe & Bond, August 2005 Interim Remedial Action Plan, AECOM, May 2010

Former Ghezzi Motors (13 Watrous Street)

Topographic Quad Name: Middle Haddam and Moodus

Groundwater Class: GA - Impaired

Bedrock Material: Brimfield Schists - gray, rusty weathering, medium to coarse grained, interlayered schists & gneiss.

Surficial Geologic Material : Thin Till

Nearest Surface Water: Pocotopaug Creek

Distance to Nearest Surface Water: >500 feet

Spills/ Releases: None listed as of 09/2015

ASTs/USTs: None registered with the state as of 09/2015; however, a gasoline tank was noted on historic Sanborn maps, as well as 3, 300-gallon motor oil ASTs; a 250-gallon and 50-gallon tanks were also noted on the site.

File Search:

2005

No additional information found.

2015

Building department files indicate that the Site was historically used as a motor vehicle repair and used auto dealership. Documents dated 2006 indicate the Site required to have an environmental audit conducted by a certified hazardous materials manager. Additional 2006 correspondences indicate that the site owner was informed that "junkyards" were not allowed in the Village Center, and included photographs showing old vehicles stored on the property.

Documentation was also reviewed indicating an oil tank was removed in 2006, but correspondence between property owners suggest that the tank actually located at the adjacent parcel (1 Watrous Street). In 2007, Phoenix Redevelopment, LLC (the property owner of 17 Watrous St) was instructed to leave the Site; no additional information was reviewed.

Files reviewed indicated that the site was entered in the voluntary remediation program in 2007 and Tighe & Bond performed testing of oil drain, pans, buckets, drums & tanks, but no additional information was available. Limited soil remediation was conducted in 2010 and a grant from the DECD was awarded in 2014 for the demolition of the building. Groundwater samples collected in 2015 indicated trace concentrations of polycyclic aromatic hydrocarbons in three monitoring wells and a concentration of trichloroethylene above state cleanup standards in one monitoring well.

Site Visit Comments:

2005

The driveway leading to the property is unpaved and very limited parking is available. In addition to its entrance at Watrous Street, a narrow and unpaved access road leads to the property by Railroad Avenue.

<u>2015</u>

A site visit was not conducted. The 2015 windshield survey confirmed that the site is currently vacant and the exterior of the property is fenced.



Appendix C

EDR "On-Demand" Results



EDR OnDemand

Report Name: Report Cover Text

Project: Folder - Village Center Contact:



SUMMARY

1	L & W INDS INC	Page 7
	87R MAIN ST, EAST HAMPTON, CT 06424	
2	RCRA-NLR: RCRA - Non Generators / No Longer Regulated NESCI ENTERPRISES INC	Page 10
	12 SUMMIT ST, EAST HAMPTON, CT 06424 RCRA-NLR: RCRA - Non Generators / No Longer Regulated FINDS: Facility Index System/Facility Registry System	l uge lo
3	BEVIN BROTHERS MFG CO	Page 13
	BEVIN RD, EAST HAMPTON, CT 06424 RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)	
4	BAYLIS T H CONN CO INC	Page 18
	1 WATROUS ST, EAST HAMPTON, CT 06424 RCRA-NLR: RCRA - Non Generators / No Longer Regulated FINDS: Facility Index System/Facility Registry System	
5	PRESSURE PAK CONTAINER CO INC	Page 21
	25 SKINNER ST, EAST HAMPTON, CT 06424 RCRA-NLR: RCRA - Non Generators / No Longer Regulated FINDS: Facility Index System/Facility Registry System MANIFEST: Facility and Manifest Data MANIFEST: Manifest information	
6	BEVIN BROTHERS MANUFACTURING COMPANY	Page 26
	BEVIN ROAD, EAST HAMPTON, CT 06424 PRP: Potentially Responsible Parties	
7	FOXS CLEANERS	Page 27
	13 SUMMIT ST, EAST HAMPTON, CT 06424 RCRA-NLR: RCRA - Non Generators / No Longer Regulated FINDS: Facility Index System/Facility Registry System	
8	A B E	Page 29
_	SKINNER ST RT 196, EAST HAMPTON, CT 06424 FINDS: Facility Index System/Facility Registry System	
9	CENTER SCHOOL (E HAMPTON BOE)	Page 30
_	7 SUMMIT ST, EAST HAMPTON, CT 06424 AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)	
10	EAST HAMPTON C.O. #7631	Page 32
	115 MAIN ST, EAST HAMPTON, CT 06424-1105 FINDS: Facility Index System/Facility Registry System	
11	CENTER PACKAGE STORE	Page 33
	93 MAIN ST, EAST HAMPTON, CT 06424	

NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES. PLEASE REVIEW THE DISCLAIMER, COPYRIGHT AND TRADEMARK NOTICE AT THE END OF THIS REPORT.

September 3, 2015

	FINDS: Facility Index System/Facility Registry System
12	J. C. BARTON CO. Page 34
	11 SKINNER ST, EAST HAMPTON, CT 06424-1747 FINDS: Facility Index System/Facility Registry System
13	UNITED STATES POSTAL SERVICE: E. HAMPTON MAIN POST OFFICE Page 35
	57 MAIN ST, EAST HAMPTON, CT 06424-9998
	FINDS: Facility Index System/Facility Registry System
14	G & S SERVICE INC. Page 36
	100 MAIN ST, EAST HAMPTON, CT 06424
15	FINDS: Facility Index System/Facility Registry System
15	BEVIN BROS. MANUFACTURING COMPANY Page 37
	BEVIN ROAD, EAST HAMPTON, CT 06424 FINDS: Facility Index System/Facility Registry System
16	Page 38
	82 MAIN ST, EAST HAMPTON, CT 06424
	EDR DRY CLEANERS: EDR Exclusive Historic Dry Cleaners
17	Page 39
	1 BARTON HILL RD, EAST HAMPTON, CT 06424
	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations
18	Page 41
	100 MAIN ST, EAST HAMPTON, CT 06424
19	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations
19	2 STARR PL, EAST HAMPTON, CT 06424
	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations
20	Page 46
	5 BARTON HILL RD, EAST HAMPTON, CT 06424
	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations
21	Page 47
	WATROUS, EAST HAMPTON, CT 06424
22	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations
22	Page 48
	SMITH STREET, EAST HAMPTON, CT 06424 FINDS: Facility Index System/Facility Registry System
23	PHOTOGRAPHIC LAB SERVICE Page 49
	25 MAIN ST, EAST HAMPTON, CT 06424-1116
	FINDS: Facility Index System/Facility Registry System
24	EAST HAMPTON CENTER VILLAGE WATER SYSTEM
	7 SUMMIT ST, EAST HAMPTON, CT 06424-1219
	FINDS: Facility Index System/Facility Registry System
25	CENTER SCHOOL- EAST HAMKPTON SCHOOL DISTRICT Page 51
	7 SUMMIT STREET, EAST HAMPTON, CT 06424-1219
26	FINDS: Facility Index System/Facility Registry System
26	BEVIN BROTHERS MANUFACTURING Page 52
	10 BEVIN ROAD, EAST HAMPTON, CT 06424-1203 FINDS: Facility Index System/Facility Registry System
27	TRAIN STATION MOTORS Page 53
	3 BARTON HILL RD, EAST HAMPTON, CT 06424
	S BARTON HILE RD, LAOT HAIII TON, OT 00424

	RCRA-NLR: RCRA - Non Generators / No Longer Regulated FINDS: Facility Index System/Facility Registry System	
28	L & W INDS INC	Page 55
	87R MAIN ST, EAST HAMPTON, CT 06424 FINDS: Facility Index System/Facility Registry System	
29	FORMER GONG BELL SITE	Page 56
	103 MAIN STREET, EAST HAMPTON, CT 06424 BROWNFIELDS: A Listing of Brownfields Sites FINDS: Facility Index System/Facility Registry System	
30	13 WATROUS STREET	Page 66
	13 WATROUS STREET, EAST HAMPTON, CT 06424 BROWNFIELDS: A Listing of Brownfields Sites FINDS: Facility Index System/Facility Registry System	
31	25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2	Page 79
	25-27 SKINNER STREET, EAST HAMPTON, CT 06424 BROWNFIELDS: A Listing of Brownfields Sites FINDS: Facility Index System/Facility Registry System	
32		Page 90
	17 SUMMIT ST, E. HAMPTON, CT 06424	
33	ERNS: Emergency Response Notification System	Dogo 04
55	57 MAIN ST, EAST HAMPTON, CT 06424	Page 94
	ERNS: Emergency Response Notification System	
34	BEVIN BROTHERS MANUFACTURING C	Page 98
	BEVIN BOULEVARD, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	U
35	BEVIN BROTHERS MANUFACTURING C	Page 101
	BEVIN BOULEVARD, EAST HAMPTON, CT 06424	
	OSHA: Occupational Safety and Health Administration	
36	P.S.I. PLUS, INC.	Page 103
	10 BEVINS ROAD, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
37	BEVIN BROTHERS MANUFACTURING C	Page 116
	10 BEVIN ROAD, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
38	PROVOST EXCAVATION LLC	Page 124
	INTERSECTION OF, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
39	CARPENTER HAYES INC.	Page 127
	8 WALNUT AVE., EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
40	CARPENTER HAYES INC.	Page 141
	8 WALNUT AVE. 1, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
41	CARPENTER HAYES INC.	Page 146
	8 WALNUT AVE., EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
42	U.S. POSTAL SERVICE	Page 152

	54 MAIN STREET 1, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
43	ALTERNATIVE SOLUTIONS INT	53
	27 SKINNER STREET, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
44	BEVIN BROTHERS MANUFACTURING C Page 1	54
	10 BEVIN ROAD, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
45	TOWN OF EAST HAMPTON, PUBLIC W Page 1	68
	WALNUT AVENUE (ON THE STREET) 1, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
46	STARR AUTO INC. Page 1	69
	2 STAR PLACE, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
47	BEVIN BROTHERS MANUFACTURING CPage 1	81
	10 BEVIN ROAD, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
48	P.S.I. PLUS, INC. Page 2	00
	10 BEVINS ROAD, EAST HAMPTON, CT 06424 OSHA: Occupational Safety and Health Administration	
49	L & W INDUSTRIES, INC. Page 2	19
	85 MAIN STREET, REAR, EAST HAMPTON, CT 06424 CPCS: Contaminated or Potentially Contaminated Sites SDADB: Site Discovery and Assessment Database PROPERTY: Property Transfer Filings	
50	RICHARD VESCE Page 2	24
	56 MAIN STREET, EAST HAMPTON, CT 06424 CPCS: Contaminated or Potentially Contaminated Sites LUST: Leaking Underground Storage Tank List SPILLS: Oil & Chemical Spill Database	
51	AT&T EAST HAMPTON CENTRAL OFFICE (#7631) Page 2	29
	115 MAIN STREET, EAST HAMPTON, CT 064241105 SDADB: Site Discovery and Assessment Database LUST: Leaking Underground Storage Tank List PROPERTY: Property Transfer Filings	
52	G & S SERVICE INC. Page 2	37
	100 MAIN ST, EAST HAMPTON, CT 06424 CPCS: Contaminated or Potentially Contaminated Sites ENF: Enforcement Case Listing NPDES: Wastewater Permit Listing	
53	ROENIGK Page 2	40
	26 BARTON HILL ROAD, EAST HAMPTON, CT 06424 CPCS: Contaminated or Potentially Contaminated Sites LUST: Leaking Underground Storage Tank List SPILLS: Oil & Chemical Spill Database	
54	EAST HAMPTON CONGREGATIONAL CHURCH Page 2	45
	59 MAIN STREET, EAST HAMPTON, CT 06424 CPCS: Contaminated or Potentially Contaminated Sites LUST: Leaking Underground Storage Tank List	

55	G & S SERVICE STATION	Page 249
	100 MAIN STREET, EAST HAMPTON, CT 06424 LUST: Leaking Underground Storage Tank List SPILLS: Oil & Chemical Spill Database	
56	EAST HAMPTON CENTER VILLAGE WATER SYSTEM	Page 255
	7 SUMMIT ST, EAST HAMPTON, CT 06424 NPDES: Wastewater Permit Listing	
57	L & W INDUSTRIES INC	Page 256
	87 (REAR) MAIN ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
58	PRESSURE PAK CONTAINER CO INC	Page 259
	25 SKINNER ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
59	BEVIN BROTHERS MFG CO	Page 265
_	BEVIN RD, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
60	EAST HAMPTON TOWN OF BD OF E	Page 272
	940 EAST MAIN ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
61	SNET CO	Page 274
	115 SO MAIN ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
62	BARTON J C CO	Page 276
_	11 SKINNER ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
63		Page 278
	MAIN ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
64	J C BARTON CO	Page 280
	11 SKINNER ST, EAST HAMPTON, CT 06424- LUST: Leaking Underground Storage Tank List MANIFEST: Hazardous Waste Manifest Data	
65	EAST HAMPTON TOWN OF	Page 285
_	3 WALNUT ST, EAST HAMPTON, CT 06424- MANIFEST: Hazardous Waste Manifest Data	
66	TOWN OF EAST HAMPTON - LAND PARCEL	Page 288
_	13 WATROUS ST, EAST HAMPTON, CT 06424 MANIFEST: Facility and Manifest Data	
67	FOOD BAG	Page 298
_	318 MAIN ST, EAST HAMPTON, CT 06424 MANIFEST: Hazardous Waste Manifest Data	
68		Page 300
69	94 MAIN ST, EAST HAMPTON, CT 06424- MANIFEST: Hazardous Waste Manifest Data	Page 302
	2 BEVIN BLVD, EAST HAMPTON, CT 06424 LEAD: Lead Inspection Database	
70	EAST HAMPTON C.O. #7631	Page 305

	115 MAIN ST, EAST HAMPTON, CT 064241105 UST: Underground Storage Tank Data	
71	UNITED STATES POSTAL SERVICE: E. HAMPTON MAIN POST OFFICE	Page 308
	57 MAIN ST, EAST HAMPTON, CT 064249998 UST: Underground Storage Tank Data	
72	CENTER SCHOOL- EAST HAMKPTON SCHOOL DISTRICT	Page 310
	7 SUMMIT ST, EAST HAMPTON, CT 064241219 UST: Underground Storage Tank Data	
73	CENTER PACKAGE STORE	Page 312
	93 MAIN ST, EAST HAMPTON, CT 064241118 UST: Underground Storage Tank Data	
74	G & S SERVICE INC.	Page 314
	100 MAIN ST, EAST HAMPTON, CT 064241125 UST: Underground Storage Tank Data	
75	J. C. BARTON CO.	Page 317
	11 SKINNER ST, EAST HAMPTON, CT 064241747 UST: Underground Storage Tank Data	

L & W INDS INC 87R MAIN ST EAST HAMPTON, CT 06424 EDR ID: 1000135805

▼ RCRA-NLR: RCRA - Non Generators / No Longer Regulated

FINDINGS

RCRA-NLR: RCRA - Non Generators / No Longer Regulated ______ Page 7 RCRAInfo is EPA's comprehensive information system, providing access to data support...Full Description>>

DETAILS

RCRA NonGen / NLR:	
Date form received by agency:	08/18/1980
Facility name:	L & W INDS INC
Facility address:	87R MAIN ST
	EAST HAMPTON, CT 06424
EPA ID:	CTD004533543
Mailing address:	PENFIELD HILL RD
	PORTLAND, CT 06480
Contact:	WALTER-J SMITH
Contact address:	PENFIELD HILL RD
	PORTLAND, CT 06480
Contact country:	US
Contact telephone:	(203) 267-9858
Contact email:	Not Reported
EPA Region:	01
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste
Owner/Operator Summary:	
Owner/operator name:	Not Reported
Owner/operator address:	OWNERSTREET
	OWNERCITY, CT 99999
Owner/operator country:	Not Reported
Owner/operator telephone:	(203) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not Reported
Owner/Op end date:	Not Reported
Handler Activities Summary:	
U.S. importer of hazardous waste:	No

Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	D000
. Waste name:	Not Defined
. Waste code:	D001
. Waste name:	IGNITABLE WASTE
. Waste code:	D002
. Waste name:	CORROSIVE WASTE
. Waste code:	D007
. Waste name:	CHROMIUM
. Waste code:	F001
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1- TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TO OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
. Waste code:	F002
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2- TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPEN SOLVENTS AND SPENT SOLVENT MIXTURES.
. Waste code:	F006
. Waste name:	WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS, EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH T ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING

L & W INDS INC, 87R MAIN ST EAST HAMPTON, CT 06424 (Continued)

. Waste code: . Waste name:	F007 SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.
. Waste code:	F008
. Waste name:	PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
. Waste code:	F009
. Waste name:	SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
Violation Status:	No violations found

NESCI ENTERPRISES INC 12 SUMMIT ST EAST HAMPTON, CT 06424 EDR ID: 1000171261

FINDINGS

RCRA-NLR: RCRA - Non Generators / No Longer Regulated	Page 10
RCRAInfo is EPA's comprehensive information system, providing access to data supportFull Description>>	-
FINDS: Facility Index System/Facility Registry System	Page 11
Facility Index System. FINDS contains both facility information and 'pointers' to oFull Description>>	

DETAILS

▼ RCRA-NLR: RCRA - Non Generators / No Longer Regulated

RCRA NonGen / NLR:

Date form received by agency:	08/01/1980
Facility name:	NESCI ENTERPRISES INC
Facility address:	12 SUMMIT ST
	EAST HAMPTON, CT 06424
EPA ID:	CTD005930136
Mailing address:	SUMMIT ST PO BOX 119
	EAST HAMPTON, CT 06424
Contact:	RALPH NESCI
Contact address:	12 SUMMIT ST PO BOX 119
	EAST HAMPTON, CT 06424
Contact country:	US
Contact telephone:	(203) 267-4175
Contact email:	Not Reported
EPA Region:	01
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste
Owner/Operator Summary:	
Owner/operator name:	NESCI ENTERPRISES INC
Owner/operator address:	OWNERSTREET
	OWNERCITY, CT 99999
Owner/operator country:	Not Reported
Owner/operator telephone:	(203) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not Reported
Owner/Op end date:	Not Reported
Handler Activities Summary:	
U.S. importer of hazardous waste:	No
	No

2

NESCI ENTERPRISES INC, 12 SUMMIT ST EAST HAMPTON, CT 06424 (Continued)

Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	Νο
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	D000
. Waste name:	Not Defined
. Waste code:	D001
. Waste name:	IGNITABLE WASTE
. Waste code:	F003
. Waste name:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
. Waste code:	F005
. Waste name:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2- NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
. Waste code:	U002
. Waste name:	2-PROPANONE (I) (OR) ACETONE (I)
. Waste code:	U220
. Waste name:	BENZENE, METHYL- (OR) TOLUENE
. Waste code:	U238
. Waste name:	CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CARBAMATE (URETHANE)
Violation Status:	No violations found
INDS: Facility Index System/F FINDS:	acility Registry System
Registry ID:	110003010848

NESCI ENTERPRISES INC, 12 SUMMIT ST EAST HAMPTON, CT 06424 (Continued)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

BEVIN BROTHERS MFG CO BEVIN RD EAST HAMPTON, CT 06424 EDR ID: 1000255100

FINDINGS

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators	Page 13
RCRAInfo is EPA's comprehensive information system, providing access to data supportFull Description>>	
AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)	Page 15

DETAILS

▼	RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators
	RCRA-CESQG:

08/17/1989 Date form received by agency: Facility name: **BEVIN BROTHERS MFG CO** Facility address: **BEVIN RD** EAST HAMPTON, CT 06424 EPA ID: CTD982777757 Contact: STANLEY BEVIN Contact address: **BEVIN RD** EAST HAMPTON, CT 06424 Contact country: US Contact telephone: (203) 267-4431 Contact email: Not Reported EPA Region: 01 Facility is not located on Indian land. Additional information is not known. Land type: Classification: Conditionally Exempt Small Quantity Generator Handler: generates 100 kg or less of hazardous waste per calendar month, and accumulates 1000 kg or less of hazardous waste at any time; or generates 1 kg or less of acutely hazardous waste per calendar month, and accumulates at any time: 1 kg or less of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill into or on any land or water, of acutely hazardous waste; or 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill into or on any land or water, of acutely hazardous waste. Description: spill, into or on any land or water, of acutely hazardous waste Owner/Operator Summary: Owner/operator name: BEVIN BROS MFG CO Owner/operator address: OWNERSTREET OWNERCITY, CT 99999 Owner/operator country: Not Reported Owner/operator telephone: (203) 555-1212 Legal status: Private Owner/Operator Type: Owner Owner/Op start date: Not Reported Owner/Op end date: Not Reported

3

BEVIN BROTHERS MFG CO, BEVIN RD EAST HAMPTON, CT 06424 (Continued)

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	F001

. Waste name:

THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Facility Has Received Notices of Violations:

Regulation violated:	Not Reported
0	
Area of violation:	Generators - General
Date violation determined:	05/15/1989
Date achieved compliance:	07/11/1989
Violation lead agency:	State
Enforcement action:	REFERRAL TO ATTORNEY GENERAL
Enforcement action date:	07/20/1989
Enf. disposition status:	Not Reported
Enf. disp. status date:	Not Reported
Enforcement lead agency:	State
Proposed penalty amount:	Not Reported
Final penalty amount:	Not Reported
Paid penalty amount:	Not Reported
Regulation violated:	Not Reported
Area of violation:	Generators - General
Date violation determined:	05/15/1989
Date achieved compliance:	07/11/1989
Violation lead agency:	State
Enforcement action:	FINAL CIVIL JUDICIAL ACTION FOR IMMINENT AND SUBSTANTIAL ENDANGERMENT

BEVIN BROTHERS MFG CO, BEVIN RD EAST HAMPTON, CT 06424 (Continued)

Enforcement action date:	08/29/1990
Enf. disposition status:	Not Reported
Enf. disp. status date:	Not Reported
Enforcement lead agency:	State
Proposed penalty amount:	Not Reported
Final penalty amount:	32000
Paid penalty amount:	Not Reported
Regulation violated:	Not Reported
Area of violation:	Generators - General
Date violation determined:	05/15/1989
Date achieved compliance:	07/11/1989
Violation lead agency:	State
Enforcement action:	INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date:	08/02/1989
Enf. disposition status:	Not Reported
Enf. disp. status date:	Not Reported
Enforcement lead agency:	State
Proposed penalty amount:	Not Reported
Final penalty amount:	Not Reported
Paid penalty amount:	Not Reported
Evaluation Action Summary:	
Evaluation date:	05/15/1989
Evaluation:	FOCUSED COMPLIANCE INSPECTION
Area of violation:	Generators - General
Date achieved compliance:	07/11/1989
Evaluation lead agency:	State
AIRS (AFS): Aerometric Informati	on Retrieval System Facility Subsystem (AFS)
US AIRS MINOR:	
Envid:	1000255100
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
D and B Number:	Not Reported
Primary SIC Code:	3931
NAICS Code:	339992
Default Air Classification Code:	MIN
Facility Type of Ownership Code:	POF
Air CMS Category Code:	Not Reported
HPV Status:	Not Reported
US AIRS MINOR:	
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN

▼

BEVIN BROTHERS MFG CO, BEVIN RD EAST HAMPTON, CT 06424 (Continued)

Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1993-09-16 00:00:00
Activity Status Date:	Not Reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not Reported
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1998-04-03 00:00:00
Activity Status Date:	Not Reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not Reported
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1994-03-13 00:00:00
Activity Status Date:	1994-03-13 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1994-04-14 00:00:00
Activity Status Date:	1994-04-14 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards

BEVIN BROTHERS MFG CO, BEVIN RD EAST HAMPTON, CT 06424 (Continued)

Activity Date:	1998-05-05 00:00:00
Activity Status Date:	1998-05-05 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	1998-05-12 00:00:00
Activity Status Date:	1998-05-12 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2005-06-06 00:00:00
Activity Status Date:	2005-06-06 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved
Region Code:	01
Programmatic ID:	AIR CT000000900700455
Facility Registry ID:	110005969513
Air Operating Status Code:	OPR
Default Air Classification Code:	MIN
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2008-06-12 00:00:00
Activity Status Date:	2008-06-12 00:00:00
Activity Group:	Enforcement Action
Activity Type:	Administrative - Informal
Activity Status:	Achieved

BAYLIS T H CONN CO INC 1 WATROUS ST EAST HAMPTON, CT 06424 EDR ID: 1000286454

FINDINGS

RCRA-NLR: RCRA - Non Generators / No Longer Regulated	Page 18
RCRAInfo is EPA's comprehensive information system, providing access to data supportFull Description>>	
FINDS: Facility Index System/Facility Registry System	Page 20
Facility Index System. FINDS contains both facility information and 'pointers' to oFull Description>>	

DETAILS

▼ RCRA-NLR: RCRA - Non Generators / No Longer Regulated

RCRA NonGen / NLR:

Date form received by agency:	01/08/1981
Facility name:	BAYLIS T H CONN CO INC
Facility address:	1 WATROUS ST
	EAST HAMPTON, CT 06424
EPA ID:	CTD991302431
Mailing address:	WATROUS ST
	EAST HAMPTON, CT 06424
Contact:	GEORGE GILBERT
Contact address:	1 WATROUS ST
	EAST HAMPTON, CT 06424
Contact country:	US
Contact telephone:	(203) 267-4457
Contact email:	Not Reported
EPA Region:	01
Land type:	Private
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste
Owner/Operator Summary:	
Owner/operator name:	Not Reported
Owner/operator address:	OWNERSTREET
	OWNERCITY, CT 99999
Owner/operator country:	Not Reported
Owner/operator telephone:	(203) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not Reported
Owner/Op end date:	Not Reported
Handler Activities Summary:	
U.S. importer of hazardous waste:	No

BAYLIS T H CONN CO INC, 1 WATROUS ST EAST HAMPTON, CT 06424 (Continued)

Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	P030
. Waste name:	CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED
. Waste code:	P071
. Waste name:	METHYL PARATHION (OR) PHOSPHOROTHIOIC ACID, O,O,-DIMETHYL O-(4-NITROPHENYL) ESTER
. Waste code:	U002
. Waste name:	2-PROPANONE (I) (OR) ACETONE (I)
. Waste code:	U134
. Waste name:	HYDROFLUORIC ACID (C,T) (OR) HYDROGEN FLUORIDE (C,T)
. Waste code:	U154
. Waste name:	METHANOL (I) (OR) METHYL ALCOHOL (I)
. Waste code:	U159
. Waste name:	2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)
. Waste code:	U208
. Waste name:	1,1,1,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,1,2-TETRACHLORO-
. Waste code:	U226
. Waste name:	ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM
. Waste code:	U239
. Waste name:	BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)
Violation Status:	No violations found
Evaluation Action Summary:	
Evaluation date:	11/30/1998
Evaluation:	FOCUSED COMPLIANCE INSPECTION
Area of violation:	Not Reported
Date achieved compliance:	Not Reported

BAYLIS T H CONN CO INC, 1 WATROUS ST EAST HAMPTON, CT 06424 (Continued)

Evaluation lead agency: State

▼ FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110002494211

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

NAME

PRESSURE PAK CONTAINER CO INC 25 SKINNER ST EAST HAMPTON, CT 06424 EDR ID: 1000386939

FINDINGS RCRA-NLR: RCRA - Non Generators / No Longer Regulated Page 21 RCRAInfo is EPA's comprehensive information system, providing access to data support...Full Description>> \equiv FINDS: Facility Index System/Facility Registry System Page 22 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>> \equiv MANIFEST: Facility and Manifest Data Page 22 Manifest is a document that lists and tracks hazardous waste from the generator thro...Full Description>> \equiv MANIFEST: Manifest information Page 24 Hazardous waste manifest information ... Full Description>> \equiv

DETAILS

▼ RCRA-NLR: RCRA - Non Generators / No Longer Regulated

RCRA NonGen / NLR:

Date form received by agency:	07/29/1980
Facility name:	PRESSURE PAK CONTAINER CO INC
Facility address:	25 SKINNER ST
	EAST HAMPTON, CT 06424
EPA ID:	CTD055509772
Mailing address:	SKINNER ST
	EAST HAMPTON, CT 06424
Contact:	LAWRENCE DALEY
Contact address:	25 SKINNER ST
	EAST HAMPTON, CT 06424
Contact country:	US
Contact telephone:	(203) 267-8468
Contact email:	Not Reported
EPA Region:	01
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste
Owner/Operator Summary:	
Owner/operator name:	Not Reported
Owner/operator address:	OWNERSTREET
	OWNERCITY, CT 99999
Owner/operator country:	Not Reported
Owner/operator telephone:	(203) 555-1212
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not Reported
Owner/Op end date:	Not Reported

5

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	D000
. Waste name:	Not Defined
. Waste code:	F017
. Waste name:	Not Defined

Violation Status: No violations found FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110003016076

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

▼ MANIFEST: Facility and Manifest Data

NY MANIFEST:

EPA ID:	CTD055509772
Country:	USA
Location Address 1:	25 SKINNER STREET
Location Address 2:	Not Reported
Location City:	EAST HAMPTON
Location State:	CT
Location Zip Code:	06424
Location Zip Code 4:	Not Reported

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Mailing Info:

Name: Contact: Address: City/State/Zip: Country: Phone: Manifest:	PRESSURE POAK PRESSURE POAK 25 SKINNER STREET EAST HAMPTON, CT 06424 USA 203-267-2562
Document ID: Manifest Status: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID: Waste Code: Quantity: Units: Number of Containers: Container Type:	NYA5670693 Completed copy CT-88852 Not Reported 11/02/1987 11/02/1987 / / 11/04/1987 11/09/1987 11/10/1987 CTD055509772 CTD00636498 Not Reported NYD049836679 D007 - CHROMIUM 5.0 MG/L TCLP 12500 P - Pounds 025 DM - Metal drums, barrels
Handling Method: Specific Gravity: Year:	L Landfill. 100 1987
Document ID: Manifest Status: Trans1 State ID: Trans2 State ID: Generator Ship Date: Trans1 Recv Date: Trans2 Recv Date: TSD Site Recv Date: Part A Recv Date: Part B Recv Date: Generator EPA ID: Trans1 EPA ID: Trans2 EPA ID: TSDF ID: Waste Code:	NYA3444175 Completed copy CT-88852 Not Reported 04/08/1986 04/08/1986 / / 04/09/1986 04/11/1986 04/11/1986 CTD055509772 CTD00636498 Not Reported NYD049836679 D008 - LEAD 5.0 MG/L TCLP
Quantity:	02700

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Units:	P - Pounds
Number of Containers:	009
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	1986
Document ID:	NYA1025046
Manifest Status:	Completed copy
Trans1 State ID:	CT019/888
Trans2 State ID:	Not Reported
Generator Ship Date:	01/14/1985
Trans1 Recv Date:	01/14/1985
Trans2 Recv Date:	/ /
TSD Site Recv Date:	01/15/1985
Part A Recv Date:	01/24/1985
Part B Recv Date:	01/24/1985
Generator EPA ID:	CTD055509772
Trans1 EPA ID:	CTD000636498
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	D008 - LEAD 5.0 MG/L TCLP
Quantity:	24150
Units:	P - Pounds
Number of Containers:	069
Container Type:	DM - Metal drums, barrels
Handling Method:	L Landfill.
Specific Gravity:	100
Year:	1985
MANIFEST: Manifest information	

▼ MANIFEST: Manifest information

RI MANIFEST:

EPA Id:	CTD055509772
Manifest Document Number:	CTB0067022
GEN Cert Date:	11/23/1987
TSDF Id:	RID991302047
TSDF Name:	IDI
TSDF Date:	Not Reported
Transporter 2 Id:	Not Reported
Transporter 2 Name:	Not Reported
Transporter Receipt Date:	Not Reported
Number Of Containers:	0
Container Type:	Not Reported
Container Type: Waste Code1:	Not Reported CR02
	•
Waste Code1:	CR02
Waste Code1: Waste Code2:	CR02 Not Reported
Waste Code1: Waste Code2: Waste Code3:	CR02 Not Reported Not Reported

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

EPA ID:	CTD055509772
Manifest Docket Number:	CTB0067022
Waste Description:	OIL SPILL SOL
Quantity:	385
WT/Vol Units:	G
Item Number:	1
Transporter Name:	TRI-S
Transporter EPA ID:	CTD000636408
GEN Cert Date:	11/23/1987
Transporter Receipt Date:	Not Reported
Transporter 2 Receipt Date:	Not Reported
TSDF Receipt Date:	Not Reported
Transporter 2 ID:	Not Reported

NAME

BEVIN BROTHERS MANUFACTURING COMPANY BEVIN ROAD EAST HAMPTON, CT 06424

EDR ID: 100043022701691

FINDINGS

PRP: Potentially Responsible Parties _____ Page 26 A listing of verified Potentially Responsible Parties...Full Description>> _____

DETAILS

▼ PRP: Potentially Responsible Parties

PRP:

PRP name: PRP address:	BEVIN BROTHERS MANUFACTURING COMPANY BEVIN ROAD P.O. BOX 60
Site ID:	EAST HAMPTON, CT 06424 0100124
Facility name:	SOLVENTS RECOVERY SERVICE OF NEW ENGLAND
Facility address:	LAZY LANE
	SOUTHINGTON, CT 06489
EPA ID:	CTD009717604
NPL status:	Currently on the Final NPL
NPL status short name:	Not Reported
Action:	GENERAL NOTICE: 06/12/1992
Action completion date:	1992-06-12 00:00:00
Settlement code:	NJ002
Settlement:	Notice Letters Issued

 \equiv

6

FOXS CLEANERS 13 SUMMIT ST EAST HAMPTON, CT 06424

EDR ID: 1001075907

FINDINGS

RCRA-NLR: RCRA - Non Generators / No Longer Regulated	 Page 27
RCRAInfo is EPA's comprehensive information system, providing access to data supportFull Description>>	-
FINDS: Facility Index System/Facility Registry System	Page 28
Facility Index System. FINDS contains both facility information and 'pointers' to oFull Description>>	

DETAILS

▼ RCRA-NLR: RCRA - Non Generators / No Longer Regulated

RCRA NonGen / NLR:

Date form received by agency:	01/03/2002
Facility name:	FOXS CLEANERS
Facility address:	13 SUMMIT ST
	EAST HAMPTON, CT 06424
EPA ID:	CTR000002501
Mailing address:	SUMMIT ST
	EAST HAMPTON, CT 06424
Contact:	CRAIG FOX
Contact address:	13 SUMMIT ST
	EAST HAMPTON, CT 06424
Contact country:	US
Contact telephone:	(203) 267-4675
Contact email:	Not Reported
EPA Region:	01
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste
Owner/Operator Summary:	
Owner/operator name:	CRAIG FOX
Owner/operator address:	13 SUMMIT ST
	EAST HAMPTON, CT 06424
Owner/operator country:	Not Reported
Owner/operator telephone:	(203) 267-4675
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	Not Reported
Owner/Op end date:	Not Reported
Handler Activities Summary:	
U.S. importer of hazardous waste:	Νο
U.S. importer of hazardous	No

Environmental Data Resources, Inc. • 440 Wheelers Farms Road, Milford, CT 06461 • 1-800-352-0050

7

FOXS CLEANERS, 13 SUMMIT ST EAST HAMPTON, CT 06424 (Continued)

Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
. Waste code:	D007
. Waste name:	CHROMIUM
. Waste code:	D039
. Waste name:	TETRACHLOROETHYLENE
. Waste code:	D040
. Waste name:	TRICHLORETHYLENE
. Waste code:	F002
. Waste name:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLEN CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2- TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVEN LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPI SOLVENTS AND SPENT SOLVENT MIXTURES.
Historical Generators:	
Date form received by agency:	07/10/1995
Site name:	FOXS CLEANERS
Classification:	Small Quantity Generator
Violation Status:	No violations found
NDS: Facility Index System/F FINDS:	acility Registry System
Registry ID:	110002494266

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

A B E SKINNER ST RT 196 EAST HAMPTON, CT 06424

EDR ID: 1007469139

FINDINGS

FINDS: Facility Index System/Facility Registry System Page 29 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110017437184

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

US EPA RACT/BACT/LAER Clearinghouse (RBLC) database contains case-specific information on the "Best Available" air pollution technologies that have been required to reduce the emission of air pollutants from stationary sources (e.g., power plants, steel mills, chemical plants, etc.). RACT, or Reasonably Available Control Technology, is required on existing sources in areas that are not meeting national ambient air quality standards. BACT, or Best Available Control Technology, is required on major new or modified sources in clean areas. LAER, or Lowest Achievable Emission Rate, is required on major new or modified sources in non-attainment areas.

8

CENTER SCHOOL (E HAMPTON BOE) 7 SUMMIT ST EAST HAMPTON, CT 06424 EDR ID: 1008398575

FINDINGS

AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS) Page 30 General plant level, plant air program, air program pollutant and plant action data....Full Description>>

DETAILS

▼	 AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS) US AIRS MINOR: 			
	Envid:	1008398575		
	Region Code:	01		
	Programmatic ID:	AIR CT000000900709131		
	Facility Registry ID:	110022665481		
	D and B Number:	Not Reported		
	Primary SIC Code:	8211		
	NAICS Code:	611110		
	Default Air Classification Code:	MIN		
	Facility Type of Ownership Code:	POF		
	Air CMS Category Code:	Not Reported		
	HPV Status:	Not Reported		
	US AIRS MINOR:			
	Region Code:	01		
	Programmatic ID:	AIR CT000000900709131		
	Facility Registry ID:	110022665481		
	Air Operating Status Code:	OPR		
	Default Air Classification Code:	MIN		
	Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards		
	Activity Date:	1999-06-15 00:00:00		
	Activity Status Date:	Not Reported		
	Activity Group:	Compliance Monitoring		
	Activity Type:	Inspection/Evaluation		
	Activity Status:	Not Reported		
	Region Code:	01		
	Programmatic ID:	AIR CT000000900709131		
	Facility Registry ID:	110022665481		
	Air Operating Status Code:	OPR		
	Default Air Classification Code:	MIN		
	Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards		
	Activity Date:	2000-02-23 00:00:00		
	Activity Status Date:	2000-02-23 00:00:00		
	Activity Group:	Enforcement Action		

CENTER SCHOOL (E HAMPTON BOE), 7 SUMMIT ST EAST HAMPTON, CT 06424 (Continued)

Activity Type: Activity Status: Administrative - Informal Achieved

EAST HAMPTON C.O. #7631 115 MAIN ST EAST HAMPTON, CT 06424-1105 EDR ID: 1010066649

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 32 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110030378650

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

CENTER PACKAGE STORE 93 MAIN ST EAST HAMPTON, CT 06424 EDR ID: 1010072070

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 33 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110030394990

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

J. C. BARTON CO. 11 SKINNER ST EAST HAMPTON, CT 06424-1747

EDR ID: 1010075906

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 34 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110030345151

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

UNITED STATES POSTAL SERVICE: E. HAMPTON MAIN POST OFFICE 57 MAIN ST EAST HAMPTON, CT 06424-9998

EDR ID: 1010075918

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 35 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110030380674

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

G & S SERVICE INC. 100 MAIN ST EAST HAMPTON, CT 06424 EDR ID: 1010168444

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 36 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110030354989

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

BEVIN BROS. MANUFACTURING COMPANY BEVIN ROAD EAST HAMPTON, CT 06424 EDR ID: 1014872575

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 37 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110044122115

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

82 MAIN ST EAST HAMPTON, CT 06424

EDR ID: 1015098928

FINDINGS

EDR DRY CLEANERS: EDR Exclusive Historic Dry Cleaners Page 38 EDR has searched selected national collections of business directories and has colle...Full Description>>

DETAILS

▼	EDR DRY CLEANERS: EDR Exclusive Historic Dry Cleaners
	EDR Historical Cleaners:

Name:	VILLAGE LAUNDROMAT
Year:	1999
Address:	82 MAIN ST
Name:	VILLAGE LAUNDROMAT
Year:	2000
Address:	82 MAIN ST
Name:	CHATHAM LAUNDROMAT
Year:	2006
Address:	82 MAIN ST
EDR Historical Cleaners:	
Name:	VILLAGE LAUNDROMAT
Year:	1999
Address:	82 MAIN ST
Name:	VILLAGE LAUNDROMAT
Year:	2000
Address:	82 MAIN ST
Name:	CHATHAM LAUNDROMAT

Name:CHATHAM LAUNDROMATYear:2006Address:82 MAIN ST

1 BARTON HILL RD EAST HAMPTON, CT 06424

EDR ID: 1015115055

FINDINGS

EDR GAS STATIONS: EDR Exclusive Historic Gas Stations Page 39 EDR has searched selected national collections of business directories and has colle...Full Description>>

DETAILS

•	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations EDR Historical Auto Stations:		
	Name: Year: Address:	TRAIN STATION MOTORS 2003 1 BARTON HILL RD	
	Name: Year: Address:	TRAIN STATION MOTORS 2004 1 BARTON HILL RD	
	Name: Year: Address:	TRAIN STATION MOTORS 2007 1 BARTON HILL RD	
	Name: Year: Address:	TRAIN STATION MOTORS 2008 1 BARTON HILL RD	
	Name: Year: Address:	TRAIN STATION MOTORS 2009 1 BARTON HILL RD	
	EDR Historical Auto Stations:		
	Name: Year: Address:	TRAIN STATION MOTORS 2003 1 BARTON HILL RD	
	Name: Year:	TRAIN STATION MOTORS 2004	

, 1 BARTON HILL RD EAST HAMPTON, CT 06424 (Continued)

Year: 2009 Address: 1 BARTON HILL RD

100 MAIN ST EAST HAMPTON, CT 06424

EDR ID: 1015118217

FINDINGS

EDR GAS STATIONS: EDR Exclusive Historic Gas Stations Page 41 EDR has searched selected national collections of business directories and has colle...Full Description>>

DETAILS

EDR Historical Auto Stations:	
Name: Year: Address:	G & S AUTO CENTER INC 2005 100 MAIN ST
Name: Year: Address:	G & S AUTO CENTER INC 2006 100 MAIN ST
Name: Year: Address:	G & S AUTO CENTER INC 2007 100 MAIN ST
Name: Year: Address:	G & S AUTO CENTER INC 2008 100 MAIN ST
Name: Year: Address:	G & S SVC INC 2010 100 MAIN ST
EDR Historical Auto Stations:	
Name: Year: Address:	G & S AUTO CENTER INC 2005 100 MAIN ST
Name: Year: Address:	G & S AUTO CENTER INC 2006 100 MAIN ST
Name: Year: Address:	G & S AUTO CENTER INC 2007 100 MAIN ST
Name: Year: Address:	G & S AUTO CENTER INC 2008 100 MAIN ST
Name:	G & S SVC INC

▼ EDR GAS STATIONS: EDR Exclusive Historic Gas Stations

, 100 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Year: 2010 Address: 100 MAIN ST

2 STARR PL EAST HAMPTON, CT 06424

EDR ID: 1015299661

FINDINGS

EDR GAS STATIONS: EDR Exclusive Historic Gas Stations Page 43 EDR has searched selected national collections of business directories and has colle...Full Description>>

DETAILS

EDR Historical Auto Stations: Name: STARR AUTO INCORPORATED Year: 1999 Address: 2 STARR PL STARR AUTO INCORPORATED Name: Year: 2000 Address: 2 STARR PL Name: STARR AUTO INC Year: 2001 Address: 2 STARR PL Name: STARR AUTO Year: 2002 Address: 2 STARR PL Name: STARR AUTO INC Year: 2003 2 STARR PL Address: Name: STARR AUTO INC Year: 2004 2 STARR PL Address: Name: STARR AUTO INC 2005 Year: Address: 2 STARR PL STARR AUTO INC Name: 2006 Year: Address: 2 STARR PL Name: STARR AUTO INC Year: 2007 Address: 2 STARR PL Name: STARR AUTO BODY REPAIR 2010 Year: Address: 2 STARR PL

▼ EDR GAS STATIONS: EDR Exclusive Historic Gas Stations

, 2 STARR PL EAST HAMPTON, CT 06424 (Continued)

Name:	STARR AUTO INC
Year:	2011
Address:	2 STARR PL
Name:	STARR AUTO BODY REPAIR
Year:	2012
Address:	2 STARR PL

EDR Historical Auto Stations:

Name:	STARR AUTO INCORPORATED
Year:	1999
Address:	2 STARR PL
Name:	STARR AUTO INCORPORATED
Year:	2000
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2001
Address:	2 STARR PL
Name:	STARR AUTO
Year:	2002
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2003
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2004
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2005
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2006
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2007
Address:	2 STARR PL
Name:	STARR AUTO BODY REPAIR
Year:	2010
Address:	2 STARR PL
Name:	STARR AUTO INC
Year:	2011
Address:	2 STARR PL

, 2 STARR PL EAST HAMPTON, CT 06424 (Continued)

Name:	STARR AUTO BODY REPAIR
Year:	2012
Address:	2 STARR PL

5 BARTON HILL RD EAST HAMPTON, CT 06424

EDR ID: 1015520506

FINDINGS

EDR GAS STATIONS: EDR Exclusive Historic Gas Stations Page 46 EDR has searched selected national collections of business directories and has colle...Full Description>>

DETAILS

▼	EDR GAS STATIONS: EDR Exclusive Historic Gas Stations
	EDR Historical Auto Stations:

Name:	TRAIN STATION MOTORS
Year:	2010
Address:	5 BARTON HILL RD

EDR Historical Auto Stations:

Name:	TRAIN STATION MOTORS
Year:	2010
Address:	5 BARTON HILL RD

WATROUS

EAST HAMPTON, CT 06424

EDR ID: 1015725795

FINDINGS

EDR GAS STATIONS: EDR Exclusive Historic Gas Stations Page 47 EDR has searched selected national collections of business directories and has colle...Full Description>>

DETAILS

EDR GAS STATIONS: EDR Exclusive Historic Gas Stations EDR Historical Auto Stations:

Name:	GHEZZI MOTORS
Year:	1999
Address:	WATROUS
Name:	GHEZZI MOTORS
Year:	2000
Address:	WATROUS

EDR Historical Auto Stations:

Name:	GHEZZI MOTORS
Year:	1999
Address:	WATROUS
Name:	GHEZZI MOTORS
Year:	2000
Address:	WATROUS

PHOTOGRAPHIC LAB SERVICE 25 MAIN ST EAST HAMPTON, CT 06424-1116 EDR ID: 1015920241

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 49 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110044335065

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

EAST HAMPTON CENTER VILLAGE WATER SYSTEM 7 SUMMIT ST EAST HAMPTON, CT 06424-1219 EDR ID: 1015944313

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 50 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

▼ FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110044351180

Environmental Interest/Information System:

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

CENTER SCHOOL- EAST HAMKPTON SCHOOL DISTRICT 7 SUMMIT STREET EAST HAMPTON, CT 06424-1219 EDR ID: 1016069473

FINDINGS

FINDS: Facility Index System/Facility Registry System Page 51 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>> =

DETAILS

▼ FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID:

6fce47c8-d564-4dcd-ac20-df0c927870c7

110022665481

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

AIR MINOR

Connecticut Site Information Management System (SIMS) is part of a suite of web-based applications designed to allow the Connecticut Department of Environmental Protection (DEP) staff to harmonize environmental interest information from disparate systems in a single agency-wide data repository (known as CFI). SIMS provides tools for identifying and resolving duplicate data, querying data (using both tabular and geospatial methods), and viewing/maintaining documents associated to the data.

BEVIN BROTHERS MANUFACTURING 10 BEVIN ROAD EAST HAMPTON, CT 06424-1203 EDR ID: 1016108800

FINDINGS

FINDS: Facility Index System/Facility Registry System Page 52 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

▼ FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID:

110005969513

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

AIR MINOR

TRAIN STATION MOTORS 3 BARTON HILL RD EAST HAMPTON, CT 06424 EDR ID: 1016140605

FINDINGS

RCRA-NLR: RCRA - Non Generators / No Longer Regulated	Page 53
RCRAInfo is EPA's comprehensive information system, providing access to data supportFull Description>>	-
FINDS: Facility Index System/Facility Registry System	Page 54
Facility Index System. FINDS contains both facility information and 'pointers' to oFull Description>>	

DETAILS

▼ RCRA-NLR: RCRA - Non Generators / No Longer Regulated

RCRA NonGen / NLR:

Date form received by agency:	07/21/2004
Facility name:	TRAIN STATION MOTORS
Facility address:	3 BARTON HILL RD
	EAST HAMPTON, CT 06424
EPA ID:	CTR000504704
Mailing address:	BARTON HILL RD
	EAST HAMPTON, CT 06424
Contact:	BLAIR BENGE
Contact address:	BARTON HILL RD
	EAST HAMPTON, CT 06424
Contact country:	US
Contact telephone:	(860) 267-8733
Contact email:	Not Reported
EPA Region:	01
Land type:	Facility is not located on Indian land. Additional information is not known.
Classification:	Non-Generator
Description:	Handler: Non-Generators do not presently generate hazardous waste
Handler Activities Summary:	
U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	Νο
	10
Used oil fuel burner:	No

TRAIN STATION MOTORS, 3 BARTON HILL RD EAST HAMPTON, CT 06424 (Continued)

	ARTON THEE RD EAST THAN TON, OT
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No
Facility Has Received Notices of	Violations:
Regulation violated:	SR - 22a-449(c)-119(a)&(b)
Area of violation:	State Statute or Regulation
Date violation determined:	10/22/2004
Date achieved compliance:	10/22/2004
Violation lead agency:	State
Enforcement action:	WRITTEN INFORMAL
Enforcement action date:	08/27/2004
Enf. disposition status:	Not Reported
Enf. disp. status date:	Not Reported
Enforcement lead agency:	State
Proposed penalty amount:	Not Reported
Final penalty amount:	Not Reported
Paid penalty amount:	Not Reported
Evaluation Action Summary:	
Evaluation date:	10/22/2004
Evaluation:	COMPLIANCE SCHEDULE EVALUATION
Area of violation:	Not Reported
Date achieved compliance:	Not Reported
Evaluation lead agency:	State
Evaluation date:	07/21/2004

Evaluation:COMPLIANCE EVALUATION INSPECTION ON-SITEArea of violation:State Statute or RegulationDate achieved compliance:10/22/2004Evaluation lead agency:State

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID:

110055435998

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

L & W INDS INC 87R MAIN ST EAST HAMPTON, CT 06424 EDR ID: 1016189414

FINDINGS

FINDS: Facility Index System/Facility Registry System ______ Page 55 Facility Index System. FINDS contains both facility information and 'pointers' to o...Full Description>>

DETAILS

 FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110003010704

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FORMER GONG BELL SITE 103 MAIN STREET EAST HAMPTON, CT 06424 EDR ID: 1016345656

FINDINGS

BROWNFIELDS: A Listing of Brownfields Sites	_ Page 56
Included in the listing are brownfields properties addresses by Cooperative AgreemenFull Description>>	-
FINDS: Facility Index System/Facility Registry System	Page 65
Facility Index System. FINDS contains both facility information and 'pointers' to oFull Description>>	

DETAILS

▼ BROWNFIELDS: A Listing of Brownfields Sites

US BROWNFIELDS:

East Hampton, Town of
Assessment
FORMER GONG BELL SITE
Not Reported
.45
The site was occupied by the Gong Bell Manufacturing Company between approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exercise of a casell sheat the site is purport.
with the exception of a small shed, the site is currently vacant. 41.57392
-72.50194
Interpolation-Map
1:24,000
Entrance Point of a Facility or Station
World Geodetic System of 1984
15216
Not Reported
48000
US EPA - Brownfields Assessment Cooperative Agreement
Not Reported
Not Reported
Not Reported
Not Reported

Assessment funding entity:	Not Reported
Cleanup funding entity:	Not Reported
Grant type:	H
Accomplishment type:	Phase I Environmental Assessment
Accomplishment count:	0
Cooperative agreement #:	98195001
Ownership entity:	Government
Current owner:	Town of East Hampton
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	No
State/tribal program date:	08/12/2008 00:00:00
State/tribal program ID:	Not Reported
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Y
Groundwater cleaned:	Not Reported
Lead contaminant found:	Y
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported
Other contams found description:	Not Reported
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Not Reported
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported

Sediments found:	Not Poportod
Sediments cleaned:	Not Reported Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev.	Not Reported
jobs:	
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	.45
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner	Ν
flag:	
nag: Arsenic cleaned up:	Not Reported
•	Not Reported Not Reported
Arsenic cleaned up:	
Arsenic cleaned up: Cadmium cleaned up:	Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up:	Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up:	Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up:	Not Reported Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up:	Not Reported Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up: No clean up:	Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up: SVOCs cleaned up:	Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up:	Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up: SVOCs cleaned up:	Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up: SVOCs cleaned up: Unknown clean up:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: mercury cleaned up: nickel cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: mercury cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Chromium contaminant found: Copper contaminant found:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: nickel cleaned up: No clean up: Pesticides cleaned up: Selenium cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Chromium contaminant found: Copper contaminant found: Iron contaminant found:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: mercury cleaned up: No clean up: Pesticides cleaned up: SVOCs cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Chromium contaminant found: Copper contaminant found: Iron contaminant found: Mercury contaminant found:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: mercury cleaned up: No clean up: Pesticides cleaned up: SVOCs cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Chromium contaminant found: Copper contaminant found: Iron contaminant found: Iron contaminant found: Mercury contaminant found:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: mercury cleaned up: No clean up: Pesticides cleaned up: SVOCs cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Chromium contaminant found: Copper contaminant found: Iron contaminant found: Mercury contaminant found: Nickel contaminant found: No contaminant found:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: mercury cleaned up: No clean up: Pesticides cleaned up: SVOCs cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Chromium contaminant found: Copper contaminant found: Iron contaminant found: Iron contaminant found: Mercury contaminant found:	Not Reported Not Reported
Arsenic cleaned up: Cadmium cleaned up: Chromium cleaned up: Copper cleaned up: Iron cleaned up: Iron cleaned up: mercury cleaned up: No clean up: Pesticides cleaned up: SVOCs cleaned up: SVOCs cleaned up: Unknown clean up: Arsenic contaminant found: Cadmium contaminant found: Copper contaminant found: Iron contaminant found: Iron contaminant found: Mercury contaminant found: Nickel contaminant found: Nickel contaminant found: Nickel contaminant found: No contaminant found: Pesticides contaminant	Not Reported Not Reported

Unknown contaminant found: Not Reported Future Use: Multistory Not Reported Media affected Bluiding Material: Not Reported Media affected indoor air: Not Reported Building material media cleaned up: Not Reported Indoor air media cleaned up: Not Reported Unknown media cleaned up: Not Reported Past Use: Multistory Not Reported Past Use: Multistory Not Reported Property name: FORMER GONG BELL SITE Property Description: The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occured at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building thad been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant. Latitude: -72.50194 HOM label: Interpolation-M		
found: Future Use: Multistory Not Reported Media affected Bluiding Not Reported Media affected indoor air: Not Reported Building material media Not Reported Building material media Not Reported Unknown media cleaned Not Reported up: Unknown media cleaned up: Ont Reported Not Reported Past Use: Multistory Not Reported Past Use: Multistory Not Reported Property Part Cleanup Property name: FORMER GONG BELL SITE Property #: Not Reported Parcel size: .45 Property Description: The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company BSR Sheel I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fuer test Trappartiting and merchandise storage may also have occurred at the site. Latitude: .4157322 Longitude: .72.50194 HGM abel: Interpolation-Map Map scale: .01/2008 0:00:00 <td>SVOCs contaminant found:</td> <td>Not Reported</td>	SVOCs contaminant found:	Not Reported
Media affected Bluiding Material:Not ReportedMedia affected indoor air:Not ReportedBuilding material media cleaned up:Not ReportedIndoor air media cleaned up:Not ReportedPast Use: MultistoryNot ReportedPast Use: MultistoryNot ReportedPast Use: MultistoryNot ReportedProperty iname:East Hampton, Town ofGrant type:CleanupProperty if:Not ReportedParcel size:.45Property if:Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwe aproximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant. Latitude:Latitude:41.57392Longitude:.72.50194HCM label:Interpolation-MapMap scale:.0701/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAcres cleaned up:Not ReportedCleanup funding source:Not Reported<		Not Reported
Material: Media affected indoor air: Not Reported Building material media Not Reported cleaned up: Not Reported Unknown media cleaned up: Not Reported Past Use: Multistory Not Reported Recipient name: East Hampton, Town of Grant type: Cleanup FORMER GONG BELL SITE Property name: FORMER GONG BELL SITE Property st: Not Reported Parcel size: .45 Property Description: The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-ion and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1989, and with the exception of a small shed, the site is currently vacant. Latitude: 41.57392 Longitude: -72.50194 HCM label: Interpolation-Map Map scale: 1.24,000 Point of reference:	•	•
Building material media cleaned up:Not ReportedIndoor air media cleaned up:Not ReportedPast Use: MultistoryNot ReportedRecipient name:East Hampton, Town ofGrant type:CleanupProperty name:FORMER GONG BELL SITEProperty <i>it</i> :Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwee approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet 1 manufacturing company BSR Sheet 1 Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning excricises during the 1990s. The former building was demolished in approximately 1980, and with the exception of a small shed, the site is currently vacant.Latitude:124,000Point of reference:Entrance Point of a Facility or Station Datum:World Geodetic System of 1984ACRES property ID:15216Stat date:07/01/2008 00:00:00Completed date:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedReservedNot ReportedReservedNot ReportedRedevelopment tanding:Not ReportedRedevelopment start date:Not ReportedRedevelopment start date:Not ReportedRedevelopment start date:Not ReportedRedevelop		Not Reported
cleaned up: Not Reported Indoor air media cleaned up: Not Reported Past Use: Multistory Not Reported Recipient name: East Hampton, Town of Grant type: Cleanup Property name: FORMER GONG BELL SITE Property name: FORMER GONG BELL SITE Property are: 45 Property Description: The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building also occupied the site during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant. Latitude: 41.57392 Longitude: -72.50194 HCM label: Interpolation-Map Map scale: 124.000 Point of reference: Entrance Point of a Facility or Station Datum: World Geodetic System of 1984 ACRES property ID: 15216 Start date: 07/01/2008 00:00:00 Completed date: Not Re	Media affected indoor air:	Not Reported
up: Not Reported Past Use: Multistory Not Reported Recipient name: East Hampton, Town of Grant type: Cleanup Property name: FORMER GONG BELL SITE Property name: FORMER GONG BELL SITE Property mame: FORMER GONG BELL SITE Property arme: A5 Property Description: The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant. Latitude: 41.57392 Longitude: -72.50194 HCM label: Interpolation-Map Map scale: 1:24,000 Point of reference: Entrance Point of a Facility or Station Datum: World Geodetic System of 1984 ACRES property ID: 15216 Start date: 07/01/2008 00:00:00 Completed date:	Building material media cleaned up:	Not Reported
Past Use: MultistoryNot ReportedRecipient name:East Hampton, Town ofGrant type:CleanupProperty name:FORMER GONG BELL SITEProperty #:Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betweeapproximately the late 1800s through the 1960s. The Gong BellManufacturing Company manufactured cast-iron and wooden toys.Painting and merchandise storage may also have occurred at the site.A sheet I manufacturing company BSR Sheet I Manufacturing alsooccupied the site during the 1970s. The former building had beenvacant since approximately 1980, and was used by the East HamptonFire Department for controlled fire burning exercises during the1990s. The former building was demolished in approximately 1998, andwith the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment tunding:Not ReportedRedevelopment funding:Not ReportedRedevelopment start date:Not Reported<		Not Reported
Recipient name:East Hampton, Town of CleanupProperty name:FORMER GONG BELL SITEProperty #:Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. 	Unknown media cleaned up:	Not Reported
Grant type:CleanupProperty name:FORMER GONG BELL SITEProperty #:Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwee approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant.Latitude:.125,0194HCM label:Interpolation-MapMap scale:1.24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding source:Not ReportedRed	Past Use: Multistory	Not Reported
Property name:FORMER GONG BELL SITEProperty #:Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment start date:Not ReportedRedevelopment start date:Not Reported	Recipient name:	East Hampton, Town of
Property #:Not ReportedParcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwee approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment start date:Not ReportedRedevelopment start date:Not Reported	Grant type:	Cleanup
Parcel size:.45Property Description:The site was occupied by the Gong Bell Manufacturing Company betwe approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1988, and with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:000Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding source:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment start date:Not Repor		FORMER GONG BELL SITE
Property Description:The site was occupied by the Gong Bell Manufacturing Company betwee approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1988, and with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:Not ReportedAssessment funding source:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding source:Not ReportedRedevelopment fun	Property #:	
approximately the late 1800s through the 1960s. The Gong Bell Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site. A sheet I manufacturing company BSR Sheet I Manufacturing also occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding source:Not ReportedRedevelopm	Parcel size:	.45
occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton Fire Department for controlled fire burning exercises during the 1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding source:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment start date:Not ReportedRedevelopment start date:Not Reported	Property Description:	Manufacturing Company manufactured cast-iron and wooden toys. Painting and merchandise storage may also have occurred at the site.
with the exception of a small shed, the site is currently vacant.Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding:Not ReportedRedevelopment funding source:Not ReportedRedevelopment funding source:Not ReportedRedevelopment funding source:Not ReportedRedevelopment funding source:Not ReportedRedevelopment start date:Not ReportedRedevelopment start da		occupied the site during the 1970s. The former building had been vacant since approximately 1980, and was used by the East Hampton
Latitude:41.57392Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedev. funding entity name:Not ReportedRedev. funding entity name:<		1990s. The former building was demolished in approximately 1998, and
Longitude:-72.50194HCM label:Interpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not Reported <td></td> <td>with the exception of a small shed, the site is currently vacant.</td>		with the exception of a small shed, the site is currently vacant.
HCMInterpolation-MapMap scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not Reported<	Latitude:	41.57392
Map scale:1:24,000Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding number:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Longitude:	-72.50194
Point of reference:Entrance Point of a Facility or StationDatum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding:Not ReportedAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedev. funding enti	HCM label:	Interpolation-Map
Datum:World Geodetic System of 1984ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding netity name:Not ReportedRedevelopment start date:Not Reported	Map scale:	1:24,000
ACRES property ID:15216Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding source: </td <td>Point of reference:</td> <td>Entrance Point of a Facility or Station</td>	Point of reference:	Entrance Point of a Facility or Station
Start date:07/01/2008 00:00:00Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding source:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Datum:	World Geodetic System of 1984
Completed date:Not ReportedAcres cleaned up:Not ReportedCleanup funding:60594Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding source:Not ReportedRedev. funding netity name:Not ReportedRedevelopment start date:Not Reported	ACRES property ID:	15216
Acres cleaned up:Not ReportedCleanup funding:60594Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding source:Not ReportedRedev. funding source:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Start date:	07/01/2008 00:00:00
Cleanup funding:60594Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Completed date:	Not Reported
Cleanup funding source:US EPA - Brownfields Cleanup Cooperative AgreementAssessment funding:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Acres cleaned up:	Not Reported
Assessment funding:Not ReportedAssessment funding source:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Cleanup funding:	60594
Assessment funding source:Not ReportedRedevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Cleanup funding source:	US EPA - Brownfields Cleanup Cooperative Agreement
Redevelopment funding:Not ReportedRedev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Assessment funding:	Not Reported
Redev. funding source:Not ReportedRedev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Assessment funding source:	Not Reported
Redev. funding entity name:Not ReportedRedevelopment start date:Not Reported	Redevelopment funding:	Not Reported
Redevelopment start date: Not Reported	Redev. funding source:	Not Reported
	Redev. funding entity name:	Not Reported
Assessment funding entity: Not Reported	Redevelopment start date:	Not Reported
	Assessment funding entity:	Not Reported
Cleanup funding entity: EPA	Cleanup funding entity:	EPA
Grant type: H	Grant type:	Н
Accomplishment type: Not Reported	Accomplishment type:	Not Reported
Accomplishment count: 0	Accomplishment count:	0

	07100001
Cooperative agreement #:	97183001 Courses and
Ownership entity: Current owner:	Government
	Town of East Hampton
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	No
State/tribal program date:	08/12/2008 00:00:00
State/tribal program ID:	Not Reported
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance	Not Reported
cleaned:	
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Y
Groundwater cleaned:	Not Reported
Lead contaminant found:	Y
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported
Other contams found description:	Not Reported
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Not Reported
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported

,	-
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	0
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	.45
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Not Reported
Cadmium contaminant found:	Not Reported
Chromium contaminant found:	Not Reported
Copper contaminant found:	Not Reported
Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	Not Reported
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported

Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
Recipient name:	East Hampton, Town of
Grant type:	Assessment
Property name:	FORMER GONG BELL SITE
Property #:	Not Reported
Parcel size:	.45
Property Description:	The site was occupied by the Gong Bell Manufacturing Company between
	approximately the late 1800s through the 1960s. The Gong Bell
	Manufacturing Company manufactured cast-iron and wooden toys.
	Painting and merchandise storage may also have occurred at the site.
	A sheet I manufacturing company BSR Sheet I Manufacturing also
	occupied the site during the 1970s. The former building had been
	vacant since approximately 1980, and was used by the East Hampton
	Fire Department for controlled fire burning exercises during the
	1990s. The former building was demolished in approximately 1998, and with the exception of a small shed, the site is currently vacant
Latitude:	with the exception of a small shed, the site is currently vacant. 41.57392
Longitude:	-72.50194
HCM label:	Interpolation-Map
Map scale:	1:24,000
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	15216
Start date:	Not Reported
Completed date:	Not Reported
Acres cleaned up:	Not Reported
Cleanup funding:	Not Reported
Cleanup funding source:	Not Reported
Assessment funding:	30967
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	EPA
Cleanup funding entity:	Not Reported
Grant type:	Н
Accomplishment type:	Supplemental Assessment
Accomplishment count:	1
Cooperative agreement #:	97183201
Ownership entity:	Government
Current owner:	Town of East Hampton
Did owner change:	N
Cleanup required:	Yes

Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	No
State/tribal program date:	08/12/2008 00:00:00
State/tribal program ID:	Not Reported
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Y
Groundwater cleaned:	Not Reported
Lead contaminant found:	Y
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported
Other contams found description:	Not Reported
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Not Reported
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Υ
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	0

,	-
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	.45
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Not Reported
Cadmium contaminant found:	Not Reported
Chromium contaminant found:	Not Reported
Copper contaminant found:	Not Reported
Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	Not Reported
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported

FORMER GONG BELL SITE, 103 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Unknown media cleaned up: Not Reported Past Use: Multistory Not Reported

▼ FINDS: Facility Index System/Facility Registry System

FINDS:

Registry ID: 110038697611

Environmental Interest/Information System:

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

13 WATROUS STREET 13 WATROUS STREET EAST HAMPTON, CT 06424

EDR ID: 1016345657

FINDINGS

BROWNFIELDS: A Listing of Brownfields Sites	Page 66
Included in the listing are brownfields properties addresses by Cooperative AgreemenFull Description>>	-
FINDS: Facility Index System/Facility Registry System	Page 78
Facility Index System. FINDS contains both facility information and 'pointers' to oFull Description>>	

DETAILS

▼ BROWNFIELDS: A Listing of Brownfields Sites

US BROWNFIELDS:

Recipient name:	East Hampton, Town of
Grant type:	Cleanup
Property name:	13 WATROUS STREET
Property #:	Map 06A Block 59 Lot 12
Parcel size:	1.36
Property Description:	The site is located at 13 Watrous Street in East Hampton,
	Connecticut. The site is comprised of approximately 1.36 acres. Site
	contains an industrial complex with concrete floors, a mixture of
	concrete and brick walls, and steel trusses, building area is 14,017
	ft2. The building was originally built in 1910 to serve as a coal
	fired boiler powerhouse for the Summit Thread Company. The northern
	portion of the building was used a coal pocket for coal storage. The
	southern section of the building was added after 1936. In 1943, the
	building changed ownership to the Artistic Wire Products Company. The
	specific manufacturing activities in the northern portion of the site
	is unknown. The southern portion of the building was used as storage.
	The property was then opeated by an auto body and auto repair shop.
	The auto operation went out of business, leaving behind approximately
	50 junk cars and automobile parts strewn throughout the property. The
	town of East Hampton acquired the property through foreclosure by
	sale. The site is fenced with temporary snow fencing.
Latitude:	41.5766382
Longitude:	-72.5003353
HCM label:	Address Matching-House Number
Map scale:	Not Reported
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	15217
Start date:	10/01/2010 00:00:00
Completed date:	Not Reported
Acres cleaned up:	Not Reported
Cleanup funding:	200000
Cleanup funding source:	US EPA - Brownfields Cleanup Cooperative Agreement

	Net Demente d
Assessment funding:	Not Reported
Assessment funding source:	Not Reported
Redevelopment funding:	Not Reported
Redev. funding source: Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
•	Not Reported
Assessment funding entity:	Not Reported EPA
Cleanup funding entity:	H
Grant type:	
Accomplishment type: Accomplishment count:	Not Reported
Cooperative agreement #:	97157601
Ownership entity:	Government
Current owner:	Town of East Hampton
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls	U
required:	0
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Not Reported
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	Not Reported
State/tribal program date:	07/07/2007 00:00:00
State/tribal program ID:	Not Reported
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Y
Groundwater cleaned:	Not Reported
Lead contaminant found:	Y
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported
Other contams found description:	Not Reported

PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Y
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	0
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	1.36
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Not Reported
Cadmium contaminant found:	Not Reported
Chromium contaminant found:	Not Reported
Copper contaminant found:	Not Reported
Iron contaminant found:	Not Reported

Mercury contaminant found:	Not Reported
Nickel contaminant found:	Not Reported
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
Recipient name:	East Hampton, Town of
Grant type:	Assessment
Property name:	13 WATROUS STREET
Property #:	Map 06A Block 59 Lot 12
Parcel size:	1.36
Property Description:	The site is located at 13 Watrous Street in East Hampton, Connecticut. The site is comprised of approximately 1.36 acres. Site
	contains an industrial complex with concrete floors, a mixture of
	concrete and brick walls, and steel trusses, building area is 14,017
	ft2. The building was originally built in 1910 to serve as a coal
	fired boiler powerhouse for the Summit Thread Company. The northern
	portion of the building was used a coal pocket for coal storage. The
	southern section of the building was added after 1936. In 1943, the
	building changed ownership to the Artistic Wire Products Company. The
	specific manufacturing activities in the northern portion of the site
	is unknown. The southern portion of the building was used as storage.
	The property was then opeated by an auto body and auto repair shop.
	The auto operation went out of business, leaving behind approximately 50 junk cars and automobile parts strewn throughout the property. The
	town of East Hampton acquired the property through foreclosure by
	sale. The site is fenced with temporary snow fencing.
Latitude:	41.5766382
Longitude:	-72.5003353
HCM label:	Address Matching-House Number
Map scale:	Not Reported
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	15217
Start date:	Not Reported
Completed date:	Not Reported
Acres cleaned up:	Not Reported
Cleanup funding:	Not Reported

Cleanup funding source:	Not Reported
Assessment funding:	42000
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	Not Reported
Cleanup funding entity:	Not Reported
Grant type:	Н
Accomplishment type:	Phase I Environmental Assessment
Accomplishment count:	0
Cooperative agreement #:	98195001
Ownership entity:	Government
Current owner:	Town of East Hampton
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Not Reported
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	Not Reported
State/tribal program date:	07/07/2007 00:00:00
State/tribal program ID:	Not Reported
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Υ
Groundwater cleaned:	Not Reported
Lead contaminant found:	Y
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported

Other contams found description:	Not Reported
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Y
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	Not Reported
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	1.36
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Not Reported
Cadmium contaminant found:	Not Reported
Chromium contaminant found:	Not Reported
Copper contaminant found:	Not Reported

Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	Not Reported
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
Recipient name:	East Hampton, Town of
Grant type:	Assessment
Property name:	13 WATROUS STREET
Property #:	Map 06A Block 59 Lot 12
Parcel size:	1.36
Property Description:	The site is located at 13 Watrous Street in East Hampton, Connecticut. The site is comprised of approximately 1.36 acres. Site contains an industrial complex with concrete floors, a mixture of concrete and brick walls, and steel trusses, building area is 14,017 ft2. The building was originally built in 1910 to serve as a coal fired boiler powerhouse for the Summit Thread Company. The northern portion of the building was used a coal pocket for coal storage. The southern section of the building was added after 1936. In 1943, the building changed ownership to the Artistic Wire Products Company. The specific manufacturing activities in the northern portion of the site is unknown. The southern portion of the building was used as storage. The property was then opeated by an auto body and auto repair shop. The auto operation went out of business, leaving behind approximately 50 junk cars and automobile parts strewn throughout the property. The town of East Hampton acquired the property through foreclosure by sale. The site is fenced with temporary snow fencing.
Latitude:	41.5766382
Longitude:	-72.5003353
HCM label:	Address Matching-House Number
Map scale:	Not Reported
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	15217
Start date:	Not Reported
Completed date:	Not Reported
Acres cleaned up:	Not Reported

Cleanup funding:	Not Reported
Cleanup funding source:	Not Reported
Assessment funding:	47778
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	EPA
Cleanup funding entity:	Not Reported
Grant type:	Н
Accomplishment type:	Supplemental Assessment
Accomplishment count:	0
Cooperative agreement #:	97183201
Ownership entity:	Government
Current owner:	Town of East Hampton
Did owner change:	Ν
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls	U
required:	
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Not Reported
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	Not Reported
State/tribal program date:	07/07/2007 00:00:00
State/tribal program ID:	Not Reported
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Υ
Groundwater cleaned:	Not Reported
Lead contaminant found:	Υ
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported

Other contams found description:	Not Reported
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Y
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	0
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	1.36
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Not Reported
Cadmium contaminant found:	Not Reported
Chromium contaminant found:	Not Reported
Copper contaminant found:	Not Reported

Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	Not Reported
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
Recipient name:	East Hampton, Town of
Grant type:	Cleanup
Property name:	13 WATROUS STREET
Property #:	Map 06A Block 59 Lot 12
Parcel size:	1.36
Property Description:	The site is located at 13 Watrous Street in East Hampton, Connecticut. The site is comprised of approximately 1.36 acres. Site contains an industrial complex with concrete floors, a mixture of concrete and brick walls, and steel trusses, building area is 14,017 ft2. The building was originally built in 1910 to serve as a coal fired boiler powerhouse for the Summit Thread Company. The northern portion of the building was used a coal pocket for coal storage. The southern section of the building was added after 1936. In 1943, the building changed ownership to the Artistic Wire Products Company. The specific manufacturing activities in the northern portion of the site is unknown. The southern portion of the building was used as storage. The property was then opeated by an auto body and auto repair shop. The auto operation went out of business, leaving behind approximately 50 junk cars and automobile parts strewn throughout the property. The town of East Hampton acquired the property through foreclosure by sale. The site is fenced with temporary snow fencing.
Latitude:	41.5766382
Longitude:	-72.5003353
HCM label:	Address Matching-House Number
Map scale:	Not Reported
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	15217
Start date:	10/01/2010 00:00:00
Completed date:	Not Reported
Acres cleaned up:	Not Reported

Cloopup funding:	40000
Cleanup funding:	40000
Cleanup funding source:	Local Funding
Assessment funding:	Not Reported
Assessment funding source:	Not Reported
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	Not Reported
Cleanup funding entity:	Town of East Hampton
Grant type:	Н
Accomplishment type:	Not Reported
Accomplishment count:	0
Cooperative agreement #:	97157601
Ownership entity:	Government
Current owner:	Town of East Hampton
Did owner change:	Ν
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	U
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Not Reported
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit	Not Reported
tools:	
	Not Reported
IC in place date:	Not Reported Not Reported
IC in place date: IC in place:	Not Reported Not Reported 07/07/2007 00:00:00
IC in place date: IC in place: State/tribal program date:	Not Reported 07/07/2007 00:00:00
IC in place date: IC in place:	Not Reported 07/07/2007 00:00:00 Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance cleaned:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance cleaned: Drinking water affected:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater affected:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater cleaned: Lead contaminant found:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater affected: Groundwater cleaned:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y Not Reported Y
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater cleaned: Lead contaminant found: Lead cleaned up:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y Not Reported Y Not Reported Not Reported Y
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater cleaned: Groundwater cleaned: Lead contaminant found: Lead cleaned up: No media affected:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y Not Reported Y Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater affected: Groundwater cleaned: Lead contaminant found: Lead cleaned up: No media affected: Unknown media affected: Other cleaned up:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y Not Reported Y Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater affected: Groundwater cleaned: Lead contaminant found: Lead cleaned up: No media affected: Unknown media affected: Other cleaned up: Other metals found:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y Not Reported Not Reported
IC in place date: IC in place: State/tribal program date: State/tribal program ID: State/tribal NFA date: Air contaminated: Air cleaned: Asbestos found: Asbestos cleaned: Controled substance found: Controled substance found: Controled substance cleaned: Drinking water affected: Drinking water cleaned: Groundwater affected: Groundwater cleaned: Lead contaminant found: Lead cleaned up: No media affected: Unknown media affected: Other cleaned up:	Not Reported 07/07/2007 00:00:00 Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Y Not Reported Y Not Reported Y Not Reported Not Reported

Other contams found description:	Not Reported
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Y
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev.	0
jobs:	-
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	1.36
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Not Reported
Cadmium contaminant	Not Reported
found:	
Chromium contaminant found:	Not Reported
Copper contaminant found:	Not Reported

13 WATROUS STREET, 13 WATROUS STREET EAST HAMPTON, CT 06424 (Continued)

Not Reported
Not Reported

FINDS: Facility Index System/Facility Registry System FINDS:

Registry ID: 110038697620

Environmental Interest/Information System:

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

NAME

25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 25-27 SKINNER STREET EAST HAMPTON, CT 06424

EDR ID: 1016353379

FINDINGS

BROWNFIELDS: A Listing of Brownfields Sites	Page 79
Included in the listing are brownfields properties addresses by Cooperative AgreemenFull Description>>	-
	Page 88
Facility Index System/Facility Registry System	

DETAILS

▼ BROWNFIELDS: A Listing of Brownfields Sites

US BROWNFIELDS:

Recipient name: Grant type:	East Hampton, Town of Assessment
Property name:	25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2
Property #:	Map 2A, Block 49, Lot 1-3
Parcel size:	1.85
Property Description:	The site is 1.85 acres in size, is zoned industrial, and includes a
	42,524 square foot site structure. There is no basement and the site
	structure is heated with propane as of 2013 (formerly heating oil).
	The northern approximate one-third of the building is a two story,
	cinder block structure occupied by a non-profit organization involved
	in childrens arts programs Epoch Arts. The remainder of the site
	structure is a three story former industrial building, a portion of
	which is occupied by a cardboard distributor ASI Alternative
	Solutions International. The remainder of the building is unoccupied
	or used for light storage by the current site occupants. No
	manufacturing is currently done by any site occupant. According to
	the site owner, a powder coating company APC American Powder Coating
	previously occupied a portion of the building but ceased operations
	and moved out during 2007. The site was developed in approximately
	1900 and was occupied by the N.N Hill Bell Factory. From the early
	1900s through the 1960s, the site manufactured toys and bells. Past
	site uses identified at the site using historical aerial photographs
	and Sanborn mapping are industrial from 1903 to the present. The
	historic industrial activities included brass manufacturing, storage,
	powder operations, rolling, machining, finishing, and foundry
	operations. Since approximately the 1960s, the site has been occupied
	by various commercial and light industrial operations, including
	Pressure Pak. Pressure Pak manufactured Freon cylinders between
	approximately 1971 to approximately 1984, and metal waste was
	generated from the stamping of the cylinders.
Latitude:	41.571741
Longitude:	-72.503023
HCM label:	Address Matching-House Number

Map scale:	Not Reported
Point of reference:	Entrance Point of a Facility or Station
	World Geodetic System of 1984
ACRES property ID:	90744 Nat Departed
Start date:	Not Reported
Completed date:	Not Reported
Acres cleaned up:	Not Reported
Cleanup funding:	Not Reported
Cleanup funding source:	Not Reported
Assessment funding:	43617.36
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	EPA Not Departed
Cleanup funding entity:	Not Reported
Grant type:	H Dhaan II Fariinn martal According to
Accomplishment type:	Phase II Environmental Assessment
Accomplishment count:	0
Cooperative agreement #:	97183201 Drivete
Ownership entity:	
Current owner:	EPOCH ARTS INC
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls required:	Y
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Υ
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	No
State/tribal program date:	03/31/2008 00:00:00
State/tribal program ID:	8867
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Y
Groundwater cleaned:	Not Reported
Lead contaminant found:	Y

Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Y
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported
Other contams found	Not Reported
description:	
PAHs found:	Y
PAHs cleaned up:	Not Reported
PCBs found:	Y
PCBs cleaned up:	Not Reported
Petro products found:	Y
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Y
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Y
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	Not Reported
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported
Past use commercial acreage:	Not Reported
Past use industrial acreage:	1.85
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported

SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	Y
Cadmium contaminant found:	Ŷ
Chromium contaminant found:	Not Reported
Copper contaminant found:	Y
Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	Y
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
Past Use: Multistory Recipient name:	Not Reported East Hampton, Town of
Recipient name:	East Hampton, Town of
Recipient name: Grant type:	East Hampton, Town of Assessment
Recipient name: Grant type: Property name:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2
Recipient name: Grant type: Property name: Property #:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story,
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupants. No
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupants. No manufacturing is currently done by any site occupant. According to
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupants. No manufacturing is currently done by any site occupant. According to the site owner, a powder coating company APC American Powder Coating
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupants. No manufacturing is currently done by any site occupant. According to the site owner, a powder coating company APC American Powder Coating previously occupied a portion of the building but ceased operations
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupant. According to the site owner, a powder coating company APC American Powder Coating previously occupied a portion of the building but ceased operations and moved out during 2007. The site was developed in approximately
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupant. According to the site owner, a powder coating company APC American Powder Coating previously occupied a portion of the building but ceased operations and moved out during 2007. The site was developed in approximately 1900 and was occupied by the N.N Hill Bell Factory. From the early
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupants. No manufacturing is currently done by any site occupant. According to the site owner, a powder coating company APC American Powder Coating previously occupied a portion of the building but ceased operations and moved out during 2007. The site was developed in approximately 1900 and was occupied by the N.N Hill Bell Factory. From the early 1900s through the 1960s, the site manufactured toys and bells. Past
Recipient name: Grant type: Property name: Property #: Parcel size:	East Hampton, Town of Assessment 25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2 Map 2A, Block 49, Lot 1-3 1.85 The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupant. According to the site owner, a powder coating company APC American Powder Coating previously occupied a portion of the building but ceased operations and moved out during 2007. The site was developed in approximately 1900 and was occupied by the N.N Hill Bell Factory. From the early

	the second standard state in the Marcola state
	historic industrial activities included brass manufacturing, storage,
	powder operations, rolling, machining, finishing, and foundry
	operations. Since approximately the 1960s, the site has been occupied
	by various commercial and light industrial operations, including
	Pressure Pak. Pressure Pak manufactured Freon cylinders between
	approximately 1971 to approximately 1984, and metal waste was
	generated from the stamping of the cylinders.
Latitude:	41.571741
Longitude:	-72.503023
HCM label:	Address Matching-House Number
Map scale:	Not Reported
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	90744
Start date:	Not Reported
Completed date:	Not Reported
Acres cleaned up:	Not Reported
Cleanup funding:	Not Reported
Cleanup funding source:	Not Reported
Assessment funding:	57145
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	EPA
Cleanup funding entity:	Not Reported
Grant type:	Н
Accomplishment type:	Phase II Environmental Assessment
Accomplishment count:	0
Cooperative agreement #:	96131801
Ownership entity:	Private
Current owner:	EPOCH ARTS INC
Did owner change:	Ν
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls	Y
required:	
IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Y
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit	Not Reported
tools:	
IC in place date:	Not Reported
IC in place:	No
State/tribal program date:	03/31/2008 00:00:00
State/tribal program ID:	8867
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported

Air cleaned:	Not Reported	
Asbestos found:	Not Reported	
Asbestos cleaned:	Not Reported	
Controled substance found:	Not Reported	
Controled substance cleaned:	Not Reported	
Drinking water affected:	Not Reported	
rinking water cleaned:	Not Reported	
Groundwater affected:	Υ	
Groundwater cleaned:	Not Reported	
ead contaminant found:	Υ	
ead cleaned up:	Not Reported	
No media affected:	Not Reported	
Jnknown media affected:	Not Reported	
Other cleaned up:	Not Reported	
Other metals found:	Υ	
Other metals cleaned:	Not Reported	
Other contaminants found:	Not Reported	
Other contams found description:	Not Reported	
PAHs found:	Υ	
PAHs cleaned up:	Not Reported	
PCBs found:	Υ	
PCBs cleaned up:	Not Reported	
Petro products found:	Υ	
Petro products cleaned:	Not Reported	
Sediments found:	Not Reported	
Sediments cleaned:	Not Reported	
Soil affected:	Υ	
Soil cleaned up:	Not Reported	
Surface water cleaned:	Not Reported	
VOCs found:	Υ	
VOCs cleaned:	Not Reported	
Cleanup other description:	Not Reported	
Num. of cleanup and re-dev.	Not Reported	
Past use greenspace acreage:	Not Reported	
Past use residential acreage:	Not Reported	
Past use commercial acreage:	Not Reported	
Past use industrial acreage:	1.85	
Future use greenspace acreage:	Not Reported	
Future use residential acreage:	Not Reported	
Future use commercial acreage:	Not Reported	
Future use industrial acreage:	Not Reported	
Greenspace acreage and type:	Not Reported	

•	
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
SVOCs cleaned up:	Not Reported
Unknown clean up:	Not Reported
Arsenic contaminant found:	γ
Cadmium contaminant found:	Y Y
Chromium contaminant found:	Not Reported
Copper contaminant found:	Υ
Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	γ
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
Recipient name:	East Hampton, Town of
Grant type:	Assessment
Property name:	25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2
Property #:	Map 2A, Block 49, Lot 1-3
Parcel size:	1.85
Property Description:	The site is 1.85 acres in size, is zoned industrial, and includes a 42,524 square foot site structure. There is no basement and the site structure is heated with propane as of 2013 (formerly heating oil). The northern approximate one-third of the building is a two story, cinder block structure occupied by a non-profit organization involved in childrens arts programs Epoch Arts. The remainder of the site structure is a three story former industrial building, a portion of

	which is occupied by a cardboard distributor ASI Alternative Solutions International. The remainder of the building is unoccupied or used for light storage by the current site occupants. No manufacturing is currently done by any site occupant. According to the site owner, a powder coating company APC American Powder Coating previously occupied a portion of the building but ceased operations and moved out during 2007. The site was developed in approximately 1900 and was occupied by the N.N Hill Bell Factory. From the early 1900s through the 1960s, the site manufactured toys and bells. Past site uses identified at the site using historical aerial photographs and Sanborn mapping are industrial from 1903 to the present. The historic industrial activities included brass manufacturing, storage, powder operations, rolling, machining, finishing, and foundry operations. Since approximately the 1960s, the site has been occupied by various commercial and light industrial operations, including
	Pressure Pak. Pressure Pak manufactured Freon cylinders between
	approximately 1971 to approximately 1984, and metal waste was
	generated from the stamping of the cylinders.
Latitude:	41.571741
Longitude: HCM label:	-72.503023
Map scale:	Address Matching-House Number Not Reported
Point of reference:	Entrance Point of a Facility or Station
Datum:	World Geodetic System of 1984
ACRES property ID:	90744
Start date:	Not Reported
Completed date:	Not Reported
Acres cleaned up:	Not Reported
Cleanup funding:	Not Reported
Cleanup funding source:	Not Reported
Assessment funding:	50812
Assessment funding source:	US EPA - Brownfields Assessment Cooperative Agreement
Redevelopment funding:	Not Reported
Redev. funding source:	Not Reported
Redev. funding entity name:	Not Reported
Redevelopment start date:	Not Reported
Assessment funding entity:	EPA
Cleanup funding entity:	Not Reported
Grant type:	Н
Accomplishment type:	Supplemental Assessment
Accomplishment count:	0
Cooperative agreement #:	96131801
Ownership entity:	Private
Current owner:	EPOCH ARTS INC
Did owner change:	N
Cleanup required:	Yes
Video available:	No
Photo available:	Yes
Institutional controls	Y
required:	

IC Category proprietary controls:	Not Reported
IC cat. info. devices:	Υ
IC cat. gov. controls:	Not Reported
IC cat. enforcement permit tools:	Not Reported
IC in place date:	Not Reported
IC in place:	No
State/tribal program date:	03/31/2008 00:00:00
State/tribal program ID:	8867
State/tribal NFA date:	Not Reported
Air contaminated:	Not Reported
Air cleaned:	Not Reported
Asbestos found:	Not Reported
Asbestos cleaned:	Not Reported
Controled substance found:	Not Reported
Controled substance cleaned:	Not Reported
Drinking water affected:	Not Reported
Drinking water cleaned:	Not Reported
Groundwater affected:	Υ
Groundwater cleaned:	Not Reported
Lead contaminant found:	Υ
Lead cleaned up:	Not Reported
No media affected:	Not Reported
Unknown media affected:	Not Reported
Other cleaned up:	Not Reported
Other metals found:	Υ
Other metals cleaned:	Not Reported
Other contaminants found:	Not Reported
Other contams found description:	Not Reported
PAHs found:	Υ
PAHs cleaned up:	Not Reported
PCBs found:	Υ
PCBs cleaned up:	Not Reported
Petro products found:	Υ
Petro products cleaned:	Not Reported
Sediments found:	Not Reported
Sediments cleaned:	Not Reported
Soil affected:	Υ
Soil cleaned up:	Not Reported
Surface water cleaned:	Not Reported
VOCs found:	Υ
VOCs cleaned:	Not Reported
Cleanup other description:	Not Reported
Num. of cleanup and re-dev. jobs:	Not Reported
Past use greenspace acreage:	Not Reported
Past use residential acreage:	Not Reported

25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2, 25-27 SKINNER STREET EAST HAMPTON, (Continued)

,	
Past use commercial acreage:	Not Reported
Past use industrial acreage:	1.85
Future use greenspace acreage:	Not Reported
Future use residential acreage:	Not Reported
Future use commercial acreage:	Not Reported
Future use industrial acreage:	Not Reported
Greenspace acreage and type:	Not Reported
Superfund Fed. landowner flag:	Ν
Arsenic cleaned up:	Not Reported
Cadmium cleaned up:	Not Reported
Chromium cleaned up:	Not Reported
Copper cleaned up:	Not Reported
Iron cleaned up:	Not Reported
mercury cleaned up:	Not Reported
nickel cleaned up:	Not Reported
No clean up:	Not Reported
Pesticides cleaned up:	Not Reported
Selenium cleaned up:	Not Reported
Selenium cleaned up: SVOCs cleaned up:	Not Reported
	· · · · ·
Unknown clean up:	Not Reported Y
Arsenic contaminant found:	-
Cadmium contaminant found:	Y
Chromium contaminant found:	Not Reported
Copper contaminant found:	Y
Iron contaminant found:	Not Reported
Mercury contaminant found:	Not Reported
Nickel contaminant found:	Y
No contaminant found:	Not Reported
Pesticides contaminant found:	Not Reported
Selenium contaminant found:	Not Reported
SVOCs contaminant found:	Not Reported
Unknown contaminant found:	Not Reported
Future Use: Multistory	Not Reported
Media affected Bluiding Material:	Not Reported
Media affected indoor air:	Not Reported
Building material media cleaned up:	Not Reported
Indoor air media cleaned up:	Not Reported
Unknown media cleaned up:	Not Reported
Past Use: Multistory	Not Reported
-	-

▼ FINDS: Facility Index System/Facility Registry System

25 SKINNER STREET, BROOKSIDE IND. COMPLEX LOT #2, 25-27 SKINNER STREET EAST HAMPTON, (Continued)

FINDS:

Registry ID: 110040221364

Environmental Interest/Information System:

US EPA Assessment, Cleanup and Redevelopment Exchange System (ACRES) is an federal online database for Brownfields Grantees to electronically submit data directly to EPA.

17 SUMMIT ST E. HAMPTON, CT 06424

EDR ID: 2001561471

FINDINGS

ERNS: Emergency Response Notification System Page 90 Emergency Response Notification System. ERNS records and stores information on repo...Full Description>>

DETAILS

•	ERNS: Emergency Response ERNS:	Notification System
	Site ID:	2001561471
	Incident cause:	UNKNOWN
	Incident type:	STORAGE TANK
	Incident date:	4/2/2001 9:30:00 AM
	Incident TG:	DISCOVERED
	Inc location:	Not Reported
	Incident address:	17 SUMMIT ST
		E. HAMPTON, CT 06424
	Distance from city:	Not Reported
	Distance Unit:	Not Reported
	Lat/Long:	/
	Lat/Long quad:	/
	Incident date:	4/2/2001 9:30:00 AM
	Township/section/range:	//
	Fire involved:	No
	Fire extinguished:	Unknown
	Passengers Transferred:	UNK
	Any evacuees:	No
	Number of evacs:	Not Reported
	Who evacuated:	Not Reported
	Radius of evacuation:	Not Reported
	Any injuries:	No
	Number injured:	Not Reported
	Number hospitalized:	Not Reported
	Any fatalities:	No
	Any damage:	No
	Damage amount:	Not Reported
	Air corridor desc:	Not Reported
	Air corridor closed:	Not Reported
	Water description:	Not Reported
	Water closed:	No
	Water closed time:	Not Reported
	Road closed:	No
	Road closed desc:	Not Reported
	Road closed time:	Not Reported

, 17 SUMMIT ST E. HAMPTON, CT 06424 (Continued)

Closure direction:	Not Reported
Major artery:	No
Track closed:	No
Track closed time:	Not Reported
Tr. close direction:	Not Reported
Track description:	Not Reported
Media interest:	NONE
Medium affected:	OTHER
Additional medium:	DIRT BASEMENT FLOOR
Body of water:	Not Reported
Tributary:	Not Reported
Release secured:	Yes
Est. duration of rel.:	Not Reported
Release rate:	Not Reported
Rel. rate units:	Not Reported
Rel. per units:	Not Reported
Remedial action:	THE STATE DEP IS RESPONDING TO THE INCIDENT
Agency on scene:	Not Reported
Other agency:	Not Reported
State agency notified:	STATE DEP
State report #:	2001-02014
Fed. agency notified:	Not Reported
Weather:	Not Reported
Air temp:	Not Reported
Wind speed:	Not Reported
Wind speed unit:	Not Reported
Wind direction:	Not Reported
Water contaminated:	Unknown
Sheen size:	Not Reported
Sheen size units:	Not Reported
Sheen color:	Not Reported
Sheen odor:	Not Reported
Sheen length:	Not Reported
Sheen len. units:	Not Reported
Sheen width:	Not Reported
Sheen wid. units:	Not Reported
Sheen direction:	Not Reported
Wave condit:	Not Reported
Current speed:	Not Reported
Current speed units:	Not Reported
Current direction:	Not Reported
Water temp:	Not Reported
Employees injured:	Not Reported
Employee fatalities:	Not Reported
Passengers injured:	Not Reported
Passenger fatalities:	Not Reported
Occupant fatalities:	Not Reported
Community impact:	No
Offshore:	No
C	
Addition info:	CALLER PLANS TO NOTIFY THE FD.

, 17 SUMMIT ST E. HAMPTON, CT 06424 (Continued)

Incident description:	THE RESPONSIBLE PARTY'S HEATING OIL TANK IS LEAKING DUE TO UNKNOWN CAUSES.
Aircraft type:	UNKNOWN
Aircraft model:	Not Reported
Aircraft ID:	Not Reported
Aircraft fuel cap:	Not Reported
Capacity units:	Not Reported
Fuel onboard:	Not Reported
Fuel units:	Not Reported
Spot number:	Not Reported
AC hanger:	Not Reported
AC runway:	Not Reported
Mile marker:	Not Reported
Building ID:	Not Reported
Type fixed obj:	UNKNOWN
Power gen facility:	Unknown
Generation capacity:	Not Reported
Fuel type:	Not Reported
NPDES:	Not Reported
NPDES compliance:	Unknown
Pipe type:	Not Reported
DOT regulated:	Unknown
Pipe above:	ABOVE
Exposed underwtr:	No
Pipe covered:	Unknown
Grade crossing:	No
Location subdivision:	Not Reported
Railroad milepost:	Not Reported
Vehicle type:	Not Reported
Crossing device:	Not Reported
Device operational:	Yes
DOT crossing #:	Not Reported
Brakes failed:	No
Tank description:	HEATING OIL TANK
Above ground tank:	ABOVE
Tank regulated:	Unknown
Tank ID:	Not Reported
Tank regulated by:	Not Reported
Tank capacity:	275
Capacity units:	GALLON(S)
Actual amount:	170
Amount units:	GALLON(S)
Transportable container:	No
Platform rig name:	Not Reported
Platform letter:	Not Reported
Local area ID:	Not Reported
Local block ID:	Not Reported
OCSG number:	Not Reported
State lease #:	Not Reported
Pier dock #:	Not Reported
Berth slip #:	Not Reported

, 17 SUMMIT ST E. HAMPTON, CT 06424 (Continued)

Initial continuous rel #:	Not Reported
Cont. rel permit:	Not Reported
Allision:	No
Structure type:	Not Reported
Structure:	Not Reported
Structure operator:	U
Air bag deployed:	Not Reported
Date time normal srvc:	Not Reported
Service disruption time:	Not Reported
Transit bus flag:	Not Reported
Begin date:	Not Reported
End date:	Not Reported
Change date:	Not Reported
Passenger Delay:	XXX
Passenger Handling:	Not Reported
Passenger Route:	XXX
Railroad Hotline:	Not Reported
Call received date:	4/2/2001 10:37:53 AM
Call received date: Complete date:	4/2/2001 10:37:53 AM 4/2/2001 10:43:39 AM
Complete date: Call Type:	
Complete date: Call Type: Responsible company:	4/2/2001 10:43:39 AM
Complete date: Call Type:	4/2/2001 10:43:39 AM INC
Complete date: Call Type: Responsible company:	4/2/2001 10:43:39 AM INC Not Reported
Complete date: Call Type: Responsible company:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE
Complete date: Call Type: Responsible company: RC organization type:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE
Complete date: Call Type: Responsible company: RC organization type: On behalf:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code: Mat. CAS number:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW 000000-00-0
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code: Mat. CAS number: Material UN #:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code: Mat. CAS number: Material UN #: Amount of spilled mat.:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW 000000-00-0 Not Reported 0
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code: Mat. CAS number: Material UN #:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW 000000-00-0 Not Reported 0 UNKNOWN AMOUNT
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code: Mat. CAS number: Material UN #: Amount of spilled mat.: Mat. amount unit: Mat. reached water:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW 000000-00-0 Not Reported 0 UNKNOWN AMOUNT UNKNOWN
Complete date: Call Type: Responsible company: RC organization type: On behalf: Source: Spilled material name: Material CHRIS code: Mat. CAS number: Material UN #: Amount of spilled mat.: Mat. amount unit:	4/2/2001 10:43:39 AM INC Not Reported PRIVATE ENTERPRISE E. HAMPTON, CT 06424 Yes TELEPHONE OIL, FUEL: NO. 2 OTW 000000-00-0 Not Reported 0 UNKNOWN AMOUNT

57 MAIN ST EAST HAMPTON, CT 06424

EDR ID: 2007331102

FINDINGS

ERNS: Emergency Response Notification System Page 94 Emergency Response Notification System. ERNS records and stores information on repo...Full Description>>

DETAILS

ERNS: Emergency Response Notification System ERNS:

Site ID:	2007856377
Incident cause:	UNKNOWN
Incident desc:	CALLER IS REPORTING A RELEASE OF HEATING OIL INTO THE BASEMENT FROM A LEAKING LINE LEADING TO THE BOILER DUE TO UNKNOWN CAUSES.
Incident type:	FIXED
Incident date:	12/03/2007
Incident TG:	DISCOVERED
Inc location:	Not Reported
Incident address:	57 MAIN ST
	EAST HAMPTON, CT 06424
Distance from city:	Not Reported
Distance Unit:	Not Reported
Lat/Long:	1
Lat/Long quad:	1
Incident date:	12/03/2007
Township/section/range:	//
Fire involved:	No
Fire extinguished:	Unknown
Direction:	Not Reported
Passengers Transferred:	NO
Any evacuees:	No
Number of evacs:	Not Reported
Who evacuated:	Not Reported
Radius of evacuation:	Not Reported
Any injuries:	No
Number injured:	Not Reported
Number hospitalized:	Not Reported
Any fatalities:	No
Any damage:	No
Damage amount:	Not Reported
Air corridor desc:	Not Reported
Air corridor closed:	Not Reported
Water description:	Not Reported
Water closed:	No
Water closed time:	Not Reported

, 57 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Road closed:	No
Road closed desc:	Not Reported
Road closed time:	Not Reported
Closure direction:	Not Reported
Major artery:	No
Track closed:	Not Reported
Track closed time:	Not Reported
Tr. close direction:	Ν
Track description:	Not Reported
Media interest:	NONE
Medium affected:	WATER
Additional medium:	STORM DRAIN
Body of water:	STORM DRAIN
Tributary:	CONNECTICUT RIVER
Release secured:	Yes
Est. duration of rel.:	Not Reported
Release rate:	Not Reported
Rel. rate units:	Not Reported
Rel. per units:	Not Reported
Remedial action:	ABSORBENTS APPLIED, CLEAN UP CREW ON-SITE
Agency on scene:	NONE
Other agency:	Not Reported
State agency notified:	DEP
State report #:	2007-07805
Fed. agency notified:	NONE
\A/a ath an	RAINY
Weather:	NAINT
Air temp:	0
Air temp:	0
Air temp: Wind speed:	0 Not Reported
Air temp: Wind speed: Wind speed unit:	0 Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction:	0 Not Reported Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated:	0 Not Reported Not Reported Unknown
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size:	0 Not Reported Not Reported Unknown Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units:	0 Not Reported Not Reported Unknown Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color: Sheen odor:	0 Not Reported Not Reported Unknown Not Reported Not Reported OTHER
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen odor: Sheen length:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color: Sheen color: Sheen length: Sheen len. units:	0 Not Reported Not Reported Unknown Not Reported Not Reported OTHER Not Reported Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color: Sheen color: Sheen length: Sheen len. units: Sheen width:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported Not Reported Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color: Sheen color: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen wid. units:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen wid. units: Wave condit: Current speed:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color: Sheen color: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen wid. units: Wave condit:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen wid. units: Wave condit: Current speed: Current speed units:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen width: Sheen wid. units: Wave condit: Current speed units: Current direction:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen color: Sheen color: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen length: Sheen length: Sheen length: Sheen width: Sheen width: Sheen width: Sheen wid: Units: Wave condit: Current speed: Current speed units: Current direction: Water temp: Employees injured:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen length: Sheen length: Sheen width: Sheen width: Sheen width: Sheen wid. units: Wave condit: Current speed: Current speed units: Current direction: Water temp: Employees injured: Employee fatalities:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen wid. units: Wave condit: Current speed: Current speed units: Current speed units: Current direction: Water temp: Employees injured: Employee fatalities: Passengers injured:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen odor: Sheen odor: Sheen length: Sheen length: Sheen length: Sheen length: Sheen width: Sheen width: Sheen width: Sheen width: Sheen width: Sheen width: Current speed: Current speed units: Current direction: Water temp: Employee fatalities: Passengers injured: Passenger fatalities:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported
Air temp: Wind speed: Wind speed unit: Wind direction: Water contaminated: Sheen size: Sheen size units: Sheen size units: Sheen color: Sheen odor: Sheen length: Sheen length: Sheen length: Sheen len. units: Sheen width: Sheen wid. units: Wave condit: Current speed: Current speed units: Current speed units: Current direction: Water temp: Employees injured: Employee fatalities: Passengers injured:	0 Not Reported Not Reported Unknown Not Reported OTHER Not Reported Not Reported

, 57 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Offshore:	No
Addition info:	CALLER ALSO STATED THAT THE SHEEN COLOR WAS GREEN.
Aircraft type:	Not Reported
Aircraft model:	Not Reported
Aircraft ID:	Not Reported
Aircraft fuel cap:	Not Reported
Capacity units:	Not Reported
Fuel onboard:	Not Reported
Fuel units:	Not Reported
Spot number:	Not Reported
AC hanger:	Not Reported
AC runway:	Not Reported
Mile marker:	Not Reported
Building ID:	Not Reported
Type fixed obj:	OTHER
Power gen facility:	No
Generation capacity:	Not Reported
Fuel type:	Not Reported
NPDES:	Not Reported
NPDES compliance:	Unknown
Pipe type:	Not Reported
DOT regulated:	Unknown
Pipe above:	ABOVE
Exposed underwtr:	No
Pipe covered:	Unknown
Grade crossing:	Unknown
Location subdivision:	Not Reported
Railroad milepost:	Not Reported
Vehicle type:	Not Reported
Crossing device:	Not Reported
Device operational:	Yes
DOT crossing #:	Not Reported
Brakes failed:	Unknown
Tank description:	Not Reported
Above ground tank:	ABOVE
Tank regulated:	Unknown
Tank ID:	Not Reported
Tank regulated by:	Not Reported
Tank capacity:	Not Reported
Capacity units:	Not Reported
Actual amount:	Not Reported
Amount units:	Not Reported
Transportable container:	Unknown
Platform rig name:	Not Reported
Platform letter:	Not Reported
Local area ID:	Not Reported
Local block ID:	Not Reported
OCSG number:	Not Reported
State lease #:	Not Reported
Pier dock #:	Not Reported

, 57 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Berth slip #:	Not Reported
Initial continuous rel #:	Not Reported
Cont. rel permit:	Not Reported
Allision:	Unknown
Structure type:	Not Reported
Structure:	Not Reported
Structure operator:	U
Air bag deployed:	Unknown
Date time normal srvc:	Not Reported
Service disruption time:	Not Reported
Transit bus flag:	Not Reported
Begin date:	Not Reported
End date:	Not Reported
Change date:	Not Reported
Passenger Delay:	XXX
Passenger Handling:	Not Reported
Passenger Route:	XXX
Railroad Hotline:	Not Reported 12/05/2007
Complete date:	12/05/2007
Call Type:	INC
Responsible company: RC organization type:	US POSTAL SERVICE FEDERAL GOVERNMENT EAST HAMPTON, CT 06424
On behalf:	Yes
Source:	TELEPHONE
Spilled material name:	OIL, FUEL: NO. 2-D
Material CHRIS code:	OTD
Mat. CAS number:	000000-00-0
Material UN #:	Not Reported
Amount of spilled mat.:	5
Mat. amount unit:	GALLON(S)
Mat. reached water:	YES
Amount in water:	3
Amount in water units:	GALLON(S)

NAME

BEVIN BROTHERS MANUFACTURING C BEVIN BOULEVARD EAST HAMPTON, CT 06424

▼ OSHA: Occupational Safety and Health Administration

EDR ID: O-018234591

FINDINGS

OSHA: Occupational Safety and Health Administration Page 98 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA INSPECTIONS DETAILS: OSHA Inspection Activity #: 018234591 **BEVIN BROTHERS MANUFACTURING C** Establishment Name: **Esablishment Address: BEVIN BOULEVARD** EAST HAMPTON, CT 06424 Esablishment County: MIDDLESEX Primary SIC: METAL STAMPINGS, NEC Secondary SIC: Not Reported Employees at Site: Not Reported Total Empoyees: Not Reported Inspection Report ID: 0112000 Lost Workday Injury Rate: Not Reported Inspector Title: Safety Officer Case Completed Date: 9/14/94 Total Inspection Time: 32.0 NONUNION Unionized: OSHA Inspection Activity #: 018234591 Establishment Name: Not Reported **Esablishment Address:** Not Reported **Esablishment County:** Not Reported Primary SIC: METAL STAMPINGS, NEC Secondary SIC: Not Reported Employees at Site: Not Reported Total Empoyees: Not Reported Inspection Report ID: 0112000 Lost Workday Injury Rate: Not Reported Inspector Title: Safety Officer Case Completed Date: Not Reported **Total Inspection Time:** 32.0 Unionized: Not Reported OSHA VIOLATIONS DETAILS: 018234591 OSHA Inspection Activity #: Standard Violated: 1903.016 A Event Title: Not Reported Citation Type: Other

BEVIN BROTHERS MANUFACTURING C, BEVIN BOULEVARD EAST HAMPTON, CT 06424 (Continued)

Disposition:	Not Reported	
Citation ID:	03001	
Issue Date:	5/31/90	
Abatement Date:	6/04/90	
Abatement Status:	Completed	
Original \$ Penalty:	400	
Original Failure-to-Abate Penalty:	0	
Actual Penalty Amount:	400	
Actual Failure-to-Abate Penalty:	0	
Penalty Contested:	Not Reported	
Hazardous Substance	Not Reported	
Involved:	·	
OSHA Inspection Activity #:	018234591	
Standard Violated:	1910.217 C01	I
Event Title:	Not Reported	
Citation Type:	Repeat	
Disposition:	Not Reported	
Citation ID:	02001	
Issue Date:	5/31/90	
Abatement Date:	6/03/90	
Abatement Status:	Completed	
Original \$ Penalty:	1120	
Original Failure-to-Abate Penalty:	0	
Actual Penalty Amount:	1120	
Actual Failure-to-Abate Penalty:	0	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	018234591	
Standard Violated:	1910.217 C02	ID
Event Title:	Not Reported	
Citation Type:	Serious	
Disposition:	Not Reported	
Citation ID:	01001	
Issue Date:	5/31/90	
Abatement Date:	7/02/90	
Abatement Status:	Completed	
Original \$ Penalty:	480	
Original Failure-to-Abate Penalty:	0	
Actual Penalty Amount:	480	
Actual Failure-to-Abate Penalty:	0	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:		

BEVIN BROTHERS MANUFACTURING C, BEVIN BOULEVARD EAST HAMPTON, CT 06424 (Continued)

Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate	19101200 F05 I Not Reported Repeat Not Reported 02002 5/31/90 7/02/90 Completed 800 0
Penalty: Actual Penalty Amount:	800
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	018234591
Standard Violated:	19101200 F05 II
Event Title:	Not Reported
Citation Type:	Repeat
Disposition:	Not Reported
Citation ID:	02003
Issue Date:	5/31/90
Abatement Date:	7/02/90
Abatement Status:	Completed
Original \$ Penalty:	960
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	960
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

NAME

BEVIN BROTHERS MANUFACTURING C BEVIN BOULEVARD EAST HAMPTON, CT 06424

▼ OSHA: Occupational Safety and Health Administration

EDR ID: O-100976729

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 101 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>> _____

DETAILS

OSHA INSPECTIONS DETAILS: OSHA Inspection Activity #: 100976729 **BEVIN BROTHERS MANUFACTURING C** Establishment Name: **Esablishment Address: BEVIN BOULEVARD** EAST HAMPTON, CT 06424 Esablishment County: MIDDLESEX Primary SIC: METAL STAMPINGS, NEC Secondary SIC: Not Reported Employees at Site: Not Reported Total Empoyees: Not Reported Inspection Report ID: 0112000 Lost Workday Injury Rate: Not Reported Inspector Title: Safety Officer Case Completed Date: 7/18/91 **Total Inspection Time:** 17.0 Unionized: NONUNION OSHA VIOLATIONS DETAILS: OSHA Inspection Activity #: 100976729 1910.147 C01 Standard Violated: Event Title: Not Reported Citation Type: Serious Disposition: INFORMAL Citation ID: 01001A Issue Date: 5/22/91 Abatement Date: 6/27/91 Abatement Status: Completed Original \$ Penalty: 1500 Original Failure-to-Abate 0 Penalty: Actual Penalty Amount: 700 Actual Failure-to-Abate 0 Penalty: Penalty Contested: Not Reported Hazardous Substance Not Reported Involved: OSHA Inspection Activity #: 100976729

BEVIN BROTHERS MANUFACTURING C, BEVIN BOULEVARD EAST HAMPTON, CT 06424 (Continued)

Standard Violated:	1910.147 C07
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Not Reported
Citation ID:	01001B
Issue Date:	5/22/91
Abatement Date:	6/27/91
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

P.S.I. PLUS, INC. 10 BEVINS ROAD EAST HAMPTON, CT 06424 EDR ID: 0-109174243

▼ OSHA: Occupational Safety and Health Administration

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 103 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	А
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	4
Early date:	0
Abatement date:	08/15/2007
Nr exposed:	1
Initial penalty:	1500
Current penalty:	750
Record:	С
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0

	,
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	1
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100212 A01
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/21/2007
Nr exposed:	1
Initial penalty:	450
Current penalty:	225
Record:	C
Emphasis:	Not Reported
Gravity:	1
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported

FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
•	No
Penalty contested:	0
SIC guide: SIC inspd:	0
Standard 50:	-
Violation contested:	19100212 A02
	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC. 10 BEVINS ROAD
facility address:	
County code:	EAST HAMPTON, CT 06424 7
County code:	A
Owner type: Owner code:	0
	-
SIC: NAICS:	3999 332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	08/15/2007
Nr exposed:	2
Initial penalty:	750
Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No

	Not Descerted
FTA disposition:	Not Reported
Item group:	A
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100217 B06 I
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD EAST HAMPTON, CT 06424
County code:	7
County code: Owner type:	A
Owner type: Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	08/15/2007
Nr exposed:	2
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported

	_
Item group:	В
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100217 E01 I
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	08/15/2007
Nr exposed:	1
Initial penalty:	750
Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported

Itom pr	4
Item nr: NAICS ins:	4
Office code:	0
Region:	1
•	No
Penalty contested:	0
SIC guide:	-
SIC inspd:	0
Standard 50:	19100219 C04 I
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status: Advanced notice:	No No
	UNPROGRAMMED
Inspection type:	B
Inspection scope:	-
Disposition:	Not Reported S
Category: Conference closed date:	S 07/16/2008
Conference closed date.	V7/10/2008 Yes
Case closed date:	05/10/2007
Case closed date.	1
Issuance date:	07/13/2007
	S
Violation type: Initial violation type:	S
Nr instances:	2
	2
Early date: Abatement date:	08/15/2007
Nr exposed:	1
	750
Initial penalty: Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported 0
FTA penalty amount: FTA insp nr:	0
FTA INSPIN: FTA ISA:	-
FTA ISA: FTA amended:	Not Reported No
FTA disposition:	
	Not Reported A
Item group: Item nr:	A 5
	5

P.S.I. PLUS, INC., 10 BEVINS ROAD EAST HAMPTON, C	T 06424 (Continued)
		o o manada j

NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100219 D01
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	А
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	2
Early date:	0
Abatement date:	08/15/2007
Nr exposed:	1
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	В
Item nr:	5
NAICS ins:	0

Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100219 E03 I
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	1
Issuance date:	07/13/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/21/2007
Nr exposed:	1
Initial penalty:	750
Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	6
NAICS ins:	0
Office code:	0

P.S.I. PLUS, INC., 10 BEVINS ROAD EAST HAMPTON	CT 06424	(Continued)

Pagion	1
Region: Repolty contested:	i No
Penalty contested:	
SIC guide:	0
SIC inspd: Standard 50:	0
	19100303 G02 I
Violation contested:	No
OSHA Inspection Activity #:	109174243
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD EAST HAMPTON, CT 06424
County code:	2
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/10/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	07/16/2008
Case closed:	Yes
Case closed date:	05/10/2007
Citation ID:	2
Issuance date:	07/13/2007
Violation type:	0
Initial violation type:	0
Nr instances:	1
Early date:	0
Abatement date:	07/21/2007
Nr exposed:	1
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	1
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0 Not Descented
FTA ISA:	Not Reported
FTA amended:	No Not Departed
FTA disposition:	Not Reported
Item group: Item nr:	Not Reported 1
NAICS ins:	0
Office code:	0
Region:	1
Region.	

Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100305 B01
Violation contested:	No
OSHA INSPECTIONS DETAILS:	
OSHA Inspection Activity #:	109174243
Establishment Name:	P.S.I. PLUS, INC.
Esablishment Address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	MANUFACTURING INDUSTRIES, NEC
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	(OPEN)
Total Inspection Time:	14.0
Unionized:	NONUNION
OSHA VIOLATIONS DETAILS:	
OSHA Inspection Activity #:	109174243
Standard Violated:	1910.212 A01
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001
Issue Date:	7/13/07
Abatement Date:	8/15/07
Abatement Status:	Completed
Original \$ Penalty:	1500
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	750
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174243
Standard Violated:	1910.212 A02
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	7/13/07
Abatement Date:	7/21/07
Abatement Status:	Completed

Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	225
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174243
Standard Violated:	1910.217 B06 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003A
Issue Date:	7/13/07
Abatement Date:	8/15/07
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	375
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174243
Standard Violated:	1910.217 E01 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003B
Issue Date:	7/13/07
Abatement Date:	8/15/07
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174243
Standard Violated:	1910.219 C04 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01004

Issue Date:	7/13/07	
Abatement Date:	8/15/07	
Abatement Status:	Completed	
Original \$ Penalty:	750	
Original Failure-to-Abate Penalty:	0	
Actual Penalty Amount:	375	
Actual Failure-to-Abate Penalty:	0	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	109174243	
Standard Violated:	1910.219 D01	
Event Title:	Not Reported	
Citation Type:	Serious	
Disposition:	INFORMAL	
Citation ID:	01005A	
Issue Date:	7/13/07	
Abatement Date:	8/15/07	
Abatement Status:	Completed	
Original \$ Penalty:	750	
Original Failure-to-Abate Penalty:	0	
Actual Penalty Amount:	375	
Actual Failure-to-Abate Penalty:	0	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	109174243	
Standard Violated:	1910.219 E03 I	
Event Title:	Not Reported	
Citation Type:	Serious	
Disposition:	INFORMAL	
Citation ID:	01005B	
Issue Date:	7/13/07	
Abatement Date:	8/15/07	
Abatement Status:	Completed	
Original \$ Penalty:	0	
Original Failure-to-Abate Penalty:	0	
Actual Penalty Amount:	0	
Actual Failure-to-Abate Penalty:	0	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	109174243	
Standard Violated:	1910.303 G02 I	
Event Title:	Not Reported	

Citation Trace	Cariaua
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01006
Issue Date:	7/13/07
Abatement Date:	7/21/07
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	375
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174243
Standard Violated:	1910.305 B01
Event Title:	Not Reported
Citation Type:	Other
Disposition:	INFORMAL
Citation ID:	02001
Issue Date:	7/13/07
Abatement Date:	7/21/07
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

NAME

BEVIN BROTHERS MANUFACTURING C 10 BEVIN ROAD EAST HAMPTON, CT 06424 EDR ID: 0-109174250

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 116 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

▼ OSHA: Occupational Safety and Health Administration OSHA DETAILS:

OSHA Inspection Activity #:	109174250
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/14/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	11/28/2007
Case closed:	Yes
Case closed date:	05/14/2007
Citation ID:	1
Issuance date:	06/22/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/12/2007
Nr exposed:	3
Initial penalty:	1000
Current penalty:	500
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0

37

FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	A
Item nr:	1
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100036 D01
Violation contested:	No
OSHA Inspection Activity #:	109174250
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/14/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	11/28/2007
Case closed:	Yes
Case closed date:	05/14/2007
Citation ID:	1
Issuance date:	06/22/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/12/2007
Nr exposed:	3
Initial penalty:	0
Current penalty:	0 Not Deported
Record:	Not Reported
Emphasis: Gravity:	Not Reported
Gravity: Hazardous category:	2 Not Reported
FTA penalty amount:	Not Reported 0
FTA penalty amount. FTA insp nr:	0
FTA ISA:	Not Reported
	Not Reported

FTA amended:	No
FTA disposition:	Not Reported
Item group:	В
Item nr:	1
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100037 A03
Violation contested:	No
OSHA Inspection Activity #:	109174250
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/14/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	11/28/2007
Case closed:	Yes
Case closed date:	05/14/2007
Citation ID:	1
Issuance date:	06/22/2007
Violation type:	S
Initial violation type:	S
Nr instances:	2
Early date:	0
Abatement date:	08/09/2007
Nr exposed:	3
Initial penalty:	1250
Current penalty:	625
Record:	С
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No

FTA dispesition.	Not Reported
FTA disposition: Item group:	A
Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100217 C02 IA
Violation contested:	No
OSHA Inspection Activity #:	109174250
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/14/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	11/28/2007
Case closed:	Yes
Case closed date:	05/14/2007
Citation ID:	1
Issuance date:	06/22/2007
Violation type:	S
Initial violation type:	S
Nr instances:	2
Early date:	0
Abatement date:	08/09/2007
Nr exposed:	3
Initial penalty:	0
Current penalty:	0
Record:	С
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported

Item group:	В
Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100217 C02 III
Violation contested:	No
OSHA Inspection Activity #:	109174250
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/14/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	11/28/2007
Case closed:	Yes
Case closed date:	05/14/2007
Citation ID:	1
Issuance date:	06/22/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	08/09/2007
Nr exposed:	3
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0 Net Demoste d
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	C

Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100217 E01 I
Violation contested:	No
OSHA INSPECTIONS DETAILS:	
OSHA Inspection Activity #:	109174250
Establishment Name:	BEVIN BROTHERS MANUFACTURING C
Esablishment Address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	METAL STAMPINGS, NEC
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	11/28/07
Total Inspection Time:	16.5
Unionized:	NONUNION
OSHA VIOLATIONS DETAILS:	
OSHA Inspection Activity #:	109174250
Standard Violated:	1910.036 D01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001A
Issue Date:	6/22/07
Abatement Date:	7/12/07
Abatement Status:	Completed
Original \$ Penalty:	1000
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174250
Standard Violated:	1910.037 A03
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL

Citation ID:	01001B
Issue Date:	6/22/07
Abatement Date:	7/12/07
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174250
Standard Violated:	1910.217 C02 IA
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002A
Issue Date:	6/22/07
Abatement Date:	8/09/07
Abatement Status:	Completed
Original \$ Penalty:	1250
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	625
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174250
Standard Violated:	1910.217 C02 III
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002B
Issue Date:	6/22/07
Abatement Date:	8/09/07
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109174250
Standard Violated:	1910.217 E01 I
	-

Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002C
Issue Date:	6/22/07
Abatement Date:	8/09/07
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

PROVOST EXCAVATION LLC INTERSECTION OF EAST HAMPTON, CT 06424

EDR ID: O-109179358

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 124 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>> _____

DETAILS

OSHA: Occupational Safety and Health Administration OSHA DETAILS: OSHA Inspection Activity #: 109179358 Facility name: PROVOST EXCAVATION LLC facility address: INTERSECTION OF

facility address:	INTERSECTION OF
	EAST HAMPTON, CT 06424
Facility county:	MIDDLESEX
Owner type:	PRIVATE
Report ID:	111500
SIC:	1794
NAICS:	238910
Date opened:	10/20/2008
Union status:	No
Advanced notice:	No
Inspection type:	PLANNED
Inspection scope:	COMPLET
Violation key:	1
Category:	S
Conference closed date:	10/21/2008
Case closed date:	12/18/2008
Citation ID:	Not Reported
Issuance date:	12/02/2008
Violation type:	Not Reported
Nr instances:	1
Final order date:	0
Early date:	0
Standard:	19260652 A01
Abatement date:	12/05/2008
Nr exposed:	1
Initial penalty:	1,500.00
Current penalty:	750
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA contested date:	0
OSHA INSPECTIONS DETAILS:	

PROVOST EXCAVATION LLC, INTERSECTION OF EAST HAMPTON, CT 06424 (Continued)

1

OSHA Inspection Activity #: Establishment Name: Esablishment Address: Esablishment County:	109179358 PROVOST EXCAVATION LLC INTERSECTION OF BEVIN BLVD & S EAST HAMPTON, CT 06424 MIDDLESEX
Primary SIC:	1794
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	12/18/08
Total Inspection Time:	Not Reported
Unionized:	NONUNION
OSHA VIOLATIONS DETAILS:	
OSHA Inspection Activity #:	109179358
Standard Violated:	1926.602 A09 II
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001
Issue Date:	12/02/08
Abatement Date:	12/05/08
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	375
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	109179358
Standard Violated:	1926.651 C02
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	12/02/08
Abatement Date:	12/05/08
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	375
Actual Failure-to-Abate Penalty:	0

PROVOST EXCAVATION LLC, INTERSECTION OF EAST HAMPTON, CT 06424 (Continued)

Penalty Contested: Hazardous Substance Involved:	Not Reported Not Reported
OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty:	109179358 1926.651 K01 Not Reported Serious INFORMAL 01003 12/02/08 12/22/08 Completed 750
Original Failure-to-Abate	0
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	375 0 Not Reported Not Reported
OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date:	109179358 1926.652 A01 Not Reported Serious INFORMAL 01004 12/02/08 12/05/08
Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	Completed 1500 0 750 0
Penalty: Penalty Contested: Hazardous Substance Involved:	Not Reported Not Reported

NAME

CARPENTER HAYES INC. 8 WALNUT AVE. EAST HAMPTON, CT 06424 EDR ID: 0-113214266

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 127 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA Inspection Activity #:	113214266
Establishment Name:	CARPENTER HAYES INC.
Esablishment Address:	8 WALNUT AVE.
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	FOLDING PAPERBOARD BOXES (1987)
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Safety Officer
Case Completed Date:	2/29/96
Total Inspection Time:	82.0
Unionized:	NONUNION

▼ OSHA: Occupational Safety and Health Administration

OSHA Inspection Activity #:	113214266
Standard Violated:	N-20
Event Title:	Not Reported
Citation Type:	Not Reported
Disposition:	Not Reported
Citation ID:	Not Reported
Issue Date:	Not Reported
Abatement Date:	Not Reported
Abatement Status:	Not Reported
Original \$ Penalty:	N-98 X
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported
Actual Failure-to-Abate Penalty:	Not Reported
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266

Standard Violated:	1904.002 A
Event Title:	Not Reported
Citation Type:	Other
Disposition:	INFORMAL
Citation ID:	02001A
Issue Date:	5/06/94
Abatement Date:	5/10/94
Abatement Status:	Completed
Original \$ Penalty:	300
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	150
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1904.005 C
Event Title:	Not Reported
Citation Type:	Other
Disposition:	Not Reported
Citation ID:	02001B
Issue Date:	5/06/94
Abatement Date:	5/10/94
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.022 A01
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001
Issue Date:	5/06/94
Abatement Date:	5/10/94
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate	0
Penalty: Actual Penalty Amount:	216
Actual Failure-to-Abate	-
Penalty:	0
Penalty Contested:	Not Reported

Hazardous Substance	Not Roported
Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.022 B01
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.023 D01 II
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003
Issue Date:	5/06/94
Abatement Date:	5/23/94
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.036 B04
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01004
Issue Date:	5/06/94
Abatement Date:	5/23/94
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360

Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.037 K01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01005
Issue Date:	5/06/94
Abatement Date:	5/19/94
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.037 Q01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01006
Issue Date:	5/06/94
Abatement Date:	5/14/94
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	216
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.106 D05 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01007
Issue Date:	5/06/94
Abatement Date:	5/11/94
Abatement Status:	Completed
Original \$ Penalty:	1050
- <u></u>	

,	
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.106 D07 III
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01008
Issue Date:	5/06/94
Abatement Date:	5/11/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.106 E02 II
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01009
Issue Date:	5/06/94
Abatement Date:	5/10/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.132 A
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01010
Issue Date:	5/06/94

, -	
Abatement Date:	5/10/94
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	216
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.141 G02
Event Title:	Not Reported
Citation Type:	Other
Disposition:	Not Reported
Citation ID:	02002
Issue Date:	5/06/94
Abatement Date:	5/11/94
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.147 C04
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01011
Issue Date:	5/06/94
Abatement Date:	6/08/94
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.147 C05 I
Event Title:	Not Reported
Citation Type:	Serious

Disposition:	INFORMAL
Citation ID:	01012
Issue Date:	5/06/94
Abatement Date:	6/08/94
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate	0
Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate	0
Penalty:	-
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.147 C07
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01013
Issue Date:	5/06/94
Abatement Date:	6/08/94
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate	0
Penalty:	
Actual Penalty Amount:	300
•	300 0
Actual Penalty Amount: Actual Failure-to-Abate	
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	0
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested:	0 Not Reported
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	0 Not Reported Not Reported
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #:	0 Not Reported Not Reported 113214266
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	0 Not Reported Not Reported 113214266 1910.157 C01
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed 0
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed 0 0
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed 0 0
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed 0 0 0
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested:	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed 0 0 0 0 Not Reported
Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	0 Not Reported Not Reported 113214266 1910.157 C01 Not Reported Other Not Reported 02003 5/06/94 5/10/94 Completed 0 0 0 0 Not Reported

· · · · · · · ·	
Standard Violated:	1910.212 A01
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01014
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.212 A02
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01015
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.212 A03 II
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01016
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported

Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.215 A04
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01017
Issue Date:	5/06/94
Abatement Date:	5/23/94
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	216
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.215 B09
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01018
Issue Date:	5/06/94
Abatement Date:	5/10/94
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.219 D01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01019
Issue Date:	5/06/94
Abatement Date:	6/08/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	580

Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.219 E01 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01020
Issue Date:	5/06/94
Abatement Date:	6/08/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.242 B
Event Title:	Not Reported
Citation Type:	Other
Disposition:	Not Reported
Citation ID:	02004
Issue Date:	5/06/94
Abatement Date:	5/11/94
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.303 B02
Event Title:	Not Reported
Citation Type:	Other
Disposition:	Not Reported
Citation ID:	02005
Issue Date:	5/06/94
Abatement Date:	5/14/94
Abatement Status:	Completed
Original \$ Penalty:	0

Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.303 G02 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01021
Issue Date:	5/06/94
Abatement Date:	5/19/94
Abatement Status:	Completed
Original \$ Penalty:	1500
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	762
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.304 F04
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01022
Issue Date:	5/06/94
Abatement Date:	5/14/94
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	500
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.305 A01 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01023
Issue Date:	5/06/94

,	
Abatement Date:	5/14/94
Abatement Status:	Completed
Original \$ Penalty:	1500
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	720
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	1910.305 B01
Event Title:	Not Reported
Citation Type:	Other
Disposition:	Not Reported
Citation ID:	02006
Issue Date:	5/06/94
Abatement Date:	5/14/94
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
,	
Penalty Contested:	Not Reported
•	Not Reported Not Reported
Penalty Contested: Hazardous Substance	•
Penalty Contested: Hazardous Substance Involved:	Not Reported
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #:	Not Reported
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	Not Reported 113214266 1910.305 B02
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title:	Not Reported 113214266 1910.305 B02 Not Reported
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type:	Not Reported 113214266 1910.305 B02 Not Reported Serious
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450 0
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450 0 216
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450 0 216 0
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450 0 216 0 Not Reported
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450 0 216 0 Not Reported Not Reported
Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	Not Reported 113214266 1910.305 B02 Not Reported Serious INFORMAL 01024 5/06/94 5/14/94 Completed 450 0 216 0 Not Reported Not Reported Not Reported 113214266

Disposition:	INFORMAL
Citation ID:	01025
Issue Date:	5/06/94
Abatement Date:	5/16/94
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate	0
Penalty:	
Actual Penalty Amount:	216
Actual Failure-to-Abate	0
Penalty:	Net Demented
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	19101200 E01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01026
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate	0
Penalty:	
Actual Penalty Amount:	216
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	113214266
Standard Violated:	19101200 F05 I
Event Title:	Not Reported
	· · ·
Citation Type:	Serious INFORMAL
Disposition: Citation ID:	01027A
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266

Standard Violated:	19101200 F05 II
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01027B
Issue Date:	5/06/94
Abatement Date:	6/30/94
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	113214266
Standard Violated:	19101200 H
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01028
Issue Date:	5/06/94
Abatement Date:	6/30/94
	Completed
Abatement Status:	Completed
Abatement Status: Original \$ Penalty:	450
	•
Original \$ Penalty: Original Failure-to-Abate	450
Original \$ Penalty: Original Failure-to-Abate Penalty:	450 0
Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	450 0 216
Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	450 0 216 0

NAME

 CARPENTER HAYES INC.

 8 WALNUT AVE.
 1

 EAST HAMPTON, CT 06424

 EDR ID: 0-123154023

▼ OSHA: Occupational Safety and Health Administration

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 141 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA INSPECTIONS DETAILS:	
OSHA Inspection Activity #:	123154023
Establishment Name:	CARPENTER HAYES INC.
Esablishment Address:	8 WALNUT AVE.
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	FOLDING PAPERBOARD BOXES (1987)
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Safety Officer
Case Completed Date:	Not Reported
Total Inspection Time:	12.5
Unionized:	Not Reported
OSHA Inspection Activity #:	123154023
Establishment Name:	CARPENTER HAYES INC.
Esablishment Address:	8 WALNUT AVE. 1
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	FOLDING PAPERBOARD BOXES (1987)
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Safety Officer
Case Completed Date:	(OPEN)
Total Inspection Time:	12.5
Unionized:	NONUNION
OSHA VIOLATIONS DETAILS:	
OSHA Inspection Activity #:	123154023
Standard Violated:	1910.132 D01
Event Title:	Not Reported

CARPENTER HAYES INC., 8 WALNUT AVE.

Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested:	Serious INFORMAL 02001 12/03/04 1/10/05 Completed 1200 0 360 0 Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	123154023 1910.147 C01 Not Reported Repeat INFORMAL 02002A	
Issue Date: Abatement Date:	12/03/04 1/31/05	
Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty:	Completed 2000 0	
Actual Penalty Amount:	1200	
Actual Failure-to-Abate	0	
Penalty:		
	0 Not Reported Not Reported	
Penalty: Penalty Contested: Hazardous Substance	Not Reported	1

CARPENTER HAYES INC., 8 WALNUT AVE.

OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	123154023 1910.178 P01 Not Reported Other INFORMAL 03001 12/03/04 1/05/05 Completed 0 0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	123154023 1910.219 C02 I Not Reported Serious INFORMAL 01003A
Issue Date:	12/03/04
Abatement Date:	1/21/05
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	360
Actual Failure-to-Abate Penalty:	0 Not Reported
Penalty Contested: Hazardous Substance	•
Involved:	Not Reported
OSHA Inspection Activity #:	123154023
Standard Violated:	DEL-1910.022 A01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001
Issue Date:	12/03/04
Abatement Date:	1/05/05
Abatement Status:	Not Reported
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported
Actual Failure-to-Abate Penalty:	Not Reported
Penalty Contested:	Not Reported

CARPENTER HAYES INC., 8 WALNUT AVE.

Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154023
Standard Violated:	DEL-1910.212 A01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	12/03/04
Abatement Date:	1/05/05
Abatement Status:	Not Reported
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported
Actual Failure-to-Abate Penalty:	Not Reported
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154023
Standard Violated:	DEL-1910.212 A03 II
Event Title:	Not Reported
Citation Type:	Repeat
Disposition:	INFORMAL
Citation ID:	02003
Issue Date:	12/03/04
Abatement Date:	1/05/05
Abatement Status:	Not Reported
Original \$ Penalty:	1200
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported
Actual Failure-to-Abate Penalty:	Not Reported
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154023
Standard Violated:	DEL-1910.219 P06 II
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003B
Issue Date:	12/03/04
Abatement Date:	1/05/05
Abatement Status:	Not Reported
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported

CARPENTER HAYES INC., 8 WALNUT AVE.

Actual Failure-to-Abate
Penalty:Not ReportedPenalty Contested:Not ReportedHazardous Substance
Involved:Not Reported

NAME

CARPENTER HAYES INC. 8 WALNUT AVE. EAST HAMPTON, CT 06424 EDR ID: 0-123154726

▼ OSHA: Occupational Safety and Health Administration

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 146 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA INSPECTIONS DETAILS	:
OSHA Inspection Activity #:	123154726
Establishment Name:	CARPENTER HAYES INC.
Esablishment Address:	8 WALNUT AVE.
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	FOLDING PAPERBOARD BOXES (1987)
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Safety Officer
Case Completed Date:	Not Reported
Total Inspection Time:	10.0
Unionized:	Not Reported
OSHA Inspection Activity #:	123154726
Establishment Name:	CARPENTER HAYES INC.
Esablishment Address:	8 WALNUT AVE.
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	FOLDING PAPERBOARD BOXES (1987)
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Safety Officer
Case Completed Date:	2/15/05
Total Inspection Time:	10.0
Unionized:	NONUNION
OSHA VIOLATIONS DETAILS:	
OSHA Inspection Activity #:	123154726
Standard Violated:	1904.002 A
Event Title:	Not Reported

	Other
Citation Type:	Other
Disposition:	
Citation ID:	02001
Issue Date:	4/12/04
Abatement Date:	4/15/04
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.022 A01
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001A
Issue Date:	4/12/04
Abatement Date:	4/15/04
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate	0
Penalty:	-
	525
Penalty:	-
Penalty: Actual Penalty Amount: Actual Failure-to-Abate	525
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	525 0
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested:	525 0 Not Reported
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	525 0 Not Reported
Peñalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	525 0 Not Reported Not Reported
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #:	525 0 Not Reported Not Reported 123154726
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	525 0 Not Reported Not Reported 123154726 1910.022 A02
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious
Peñalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL
Peñalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04 5/27/04
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04 5/27/04 Completed
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04 5/27/04 Completed 0
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04 5/27/04 Completed 0 0
Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04 5/27/04 Completed 0 0
Peñalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	525 0 Not Reported Not Reported 123154726 1910.022 A02 Related to a Complaint Serious INFORMAL 01001B 4/12/04 5/27/04 Completed 0 0 0

OSHA Inspection Activity #:	123154726
Standard Violated:	1910.023 A08
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	4/12/04
Abatement Date:	4/15/04
Abatement Status:	Completed
Original \$ Penalty:	1050
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	525
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.132 D01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003A
Issue Date:	4/12/04
Abatement Date:	5/27/04
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.132 F01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003B
Issue Date:	4/12/04
Abatement Date:	5/27/04
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate	0
Penalty:	-
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported

Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.133 A01
Event Title:	Related to a Complaint
Citation Type:	Other
Disposition:	INFORMAL
Citation ID:	01004
Issue Date:	4/12/04
Abatement Date:	4/15/04
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.147 C01
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01005A
Issue Date:	4/12/04
Abatement Date:	6/27/04
Abatement Status:	Completed
Original \$ Penalty:	1500
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	750
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.147 C04 I
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01005B
Issue Date:	4/12/04
Abatement Date:	6/27/04
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0

,	
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	·
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.147 C07 I
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01005C
Issue Date:	4/12/04
Abatement Date:	6/27/04
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate	0
Penalty:	
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.178 L01 I
Event Title:	Related to a Complaint
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01006
Issue Date:	4/12/04
Abatement Date:	4/15/04
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	225
Actual Failure-to-Abate	0
Penalty:	
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.212 A03 II
Event Title:	Related to a Complaint
Citation Type:	
Disposition:	INFORMAL
Citation ID:	01007
Issue Date: Abatement Date:	4/12/04 6/27/04
Abatement Date: Abatement Status:	6/27/04 Completed
Original \$ Penalty:	1500
Chginai y i chally.	1000

Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	750
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	123154726
Standard Violated:	1910.303 F
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01008
Issue Date:	4/12/04
Abatement Date:	5/27/04
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

U.S. POSTAL SERVICE 54 MAIN STREET 1 EAST HAMPTON, CT 06424 EDR ID: 0-123155087

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 152 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

U	OSHA INSPECTIONS DETAILS:		
	OSHA Inspection Activity #:	123155087	
	Establishment Name:	U.S. POSTAL SERVICE	
	Esablishment Address:	54 MAIN STREET	
		EAST HAMPTON, CT 06424	
	Esablishment County:	MIDDLESEX	
	Primary SIC:	U.S. POSTAL SERVICE	
	Secondary SIC:	Not Reported	
	Employees at Site:	Not Reported	
	Total Empoyees:	Not Reported	
	Inspection Report ID:	0111500	
	Lost Workday Injury Rate:	Not Reported	
	Inspector Title:	Safety Officer	
	Case Completed Date:	12/04/03	
	Total Inspection Time:	14.0	
	Unionized:	UNION	
	OSHA Inspection Activity #:	123155087	
	Establishment Name:	U.S. POSTAL SERVICE	
	Esablishment Address:	54 MAIN STREET 1	
		EAST HAMPTON, CT 06424	
	Esablishment County:	MIDDLESEX	
	Primary SIC:	U.S. POSTAL SERVICE	
	Secondary SIC:	Not Reported	
	Employees at Site:	Not Reported	
	Total Empoyees:	Not Reported	
	Inspection Report ID:	0111500	
	Lost Workday Injury Rate:	Not Reported	
	Inspector Title:	Safety Officer	
	Case Completed Date:	12/04/03	
	Total Inspection Time:	14.0	
	Unionized:	UNION	

▼ OSHA: Occupational Safety and Health Administration

Environmental Data Resources, Inc. • 440 Wheelers Farms Road, Milford, CT 06461 • 1-800-352-0050

ALTERNATIVE SOLUTIONS INT 27 SKINNER STREET EAST HAMPTON, CT 06424

EDR ID: O-123189268

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 153 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA: Occupational Safety and Health Administration OSHA INSPECTIONS DETAILS:

OSHA Inspection Activity #:	123189268
Establishment Name:	ALTERNATIVE SOLUTIONS INT
Esablishment Address:	27 SKINNER STREET
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	CORRUGATED AND SOLID FIBER BOXES
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	1/08/07
Total Inspection Time:	1.0
Unionized:	NONUNION

NAME

BEVIN BROTHERS MANUFACTURING C 10 BEVIN ROAD EAST HAMPTON, CT 06424 EDR ID: 0-123193393

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 154 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA: Occupational Safety and Health Administration OSHA DETAILS:

OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	01
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	S
Nr instances:	00001
Early date:	0000000
Abatement date:	03/26/2012
Nr exposed:	00006
Initial penalty:	0004620
Current penalty:	0003000
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000

44

FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	A
Item nr:	001
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100147 C01
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	01
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	S
Nr instances:	00001
Early date:	0000000
Abatement date:	05/24/2012
Nr exposed:	00001
Initial penalty:	000000
Current penalty:	000000
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10 Not Departed
Hazardous category:	Not Reported
FTA contest date:	0000000

FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	В
Item nr:	001
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100147 C04 I
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	01
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	S
Nr instances:	00001
Early date:	0000000
Abatement date:	05/24/2012
Nr exposed:	00006
Initial penalty:	000000
Current penalty:	000000
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	05
Hazardous category:	Not Reported

FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	C
Item nr:	001
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100147 C07 I
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	01
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	S
Nr instances:	00001
Early date:	0000000
Abatement date:	04/24/2012
Nr exposed:	00004
Initial penalty:	0004620
Current penalty:	0004620
Record:	С
Emphasis:	Not Reported
Gravity:	10

Hozordouo ostorom -	Not Papartad
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No Nat Departure
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr: NAICS ins:	002
Office code:	000000
	00 01
Region:	No
Penalty contested:	0000
SIC guide: SIC inspd:	0000
Standard 50:	19100217 C01 I
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
lacinty address.	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	01
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	S
Nr instances:	00001
Early date:	0000000
Abatement date:	03/26/2012
Nr exposed:	00004
Initial penalty:	0002640
Current penalty:	0002640
Record:	С
Emphasis:	Not Reported

Bazardous category: Not Reported FTA contest date: 0000000 FTA final date: 0000000 FTA inal date: 0000000 FTA inal date: 0000000 FTA inal manuto: 00000000 FTA insp nr: 00000000 FTA insp nr: 00000000 FTA insp nr: 0000000 FTA insp nr: 0000000 FTA insp nr: 000000 FTA insp nr: 000 MAICS ins: 000000 Office code: 00 Region: 01 Penalty contested: No SIC guide: 0000 SIC inspd: 007 Owner code: 007 Owner code: 0000 SI	Gravity:	05
FTA contest data:0000000FTA final date:0000000FTA ispanalty amount:00000000FTA ispanalty amount:00000000FTA ispanalty amount:00000000FTA ispanalty amount:Not ReportedFTA amended:NoFTA amended:NoFTA disposition:Not ReportedItem group:Not ReportedItem group:Not ReportedItem group:000000Office code:00Region:01Penalty contested:NoSIC guide:0000SIC inspd:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoSHA Inspection Activity #:123193393Facility address:10 BEVIN ROATHERS MANUFACTURING Cfacility address:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Unipection scope:BDispection scope:BDispection scope:BDispection scope:SSConterce closed date:03/21/2012Case closed date:03/21/2012SCotase closed date:03/21/2012Violation type:SInitial violation type:SInitial violation type:SInitial violation type:SInitial violation type:SInitial violation type:SInitial violation type:S <tr< td=""><td>•</td><td></td></tr<>	•	
FTA final date: 0000000 FTA penalty amount: 00000000 FTA insp nr: 0000000 FTA insp nr: 0000000 FTA amended: No FTA amended: No FTA amended: No FTA disposition: Not Reported Item group: Not Reported Item nr: 003 NAICS ins: 000000 Office code: 00 Region: 01 Penalty contested: No SIC guide: 0000 SIC inspd: 0000 SIC inspd: 0000 Stadard 50: 19100217 B04 II Violation contested: No OSHA Inspection Activity #: 123193393 Facility name: BEVIN BROTHERS MANUFACTURING C facility address: 10 EVIN ROAD EAST HAMPTON, CT 06424 County code: Ourner type: A Owner code: 115 Date opened: 12/22/2011 Union status: No Inspection scope: B Disposition:	• ·	
FTA penalty amount:00000000FTA insp nr:00000000FTA lisp.Not ReportedFTA amended:NoFTA disposition:Not ReportedItem group:Not ReportedItem nr:003NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000SIC guide:0000SIC inspd:0000SIC inspd:0000Standard 50:1910217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 EEVIN ROADCounty code:007Owner code:32116Area code:115Date opened:12/22/2011Unins status:NoAdvanced notice:NoInspection scope:BDisposition:Not ReportedInspection scope:BDisposition:0/1Issuance date:03/19/2012Case closed date:03/21/2012Violation type:SConference closed date:03/21/2012Violation type:SInitial penalty:000000Adatement date:03/26/2012Nr instances:NoAdatement date:03/26/2012Nr instances:000000Adatement date:03/26/2012Nr instances:0000000		
FTA insp n:00000000FTA ISA:Not ReportedFTA disposition:Not ReportedItem group:Not ReportedItem rn:003NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000SIC inspd:0000Standard 50:1910217 B04 IIViolation contested:NoSIC juide:0000Standard 50:1910217 B04 IIViolation contested:NoGSAM Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADCounty code:007Owner type:AOwner code:0000SIC:3469NAICS:322116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed date:03/21/2012Violation type:SInitial violation type:S<		
FTA ISA:Not ReportedFTA amended:NoFTA disposition:Not ReportedItem group:Not ReportedItem nr:003NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000SIC guide:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADCounty code:007Owner type:AOwner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed date:03/21/2012Case closed date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abarenet date:03/21/2012Violation type:SNr instances:00002Early date:0000000Abarenet date:03/26/2012Nr instances:00002Initial violation type:SNr instances:00002 <td></td> <td></td>		
FTA amended:NoFTA disposition:Not ReportedItem group:Not ReportedItem nr:003NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:007Owner type:AOwner code:0000SIC:3469NAICS:322116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/21/2012Case closed date:03/21/2012Case closed date:03/21/2012Violation type:SInitial violation type:SNr instances:00000Abatement date:03/221/2012Violation type:SInitial violation type:SNr instances:00000Abatement date:03/221/2012Violation type:SInitial penalty:000000Abatement date:03/26/2012Nr exposed:00000Abatement date:03/26/2012Nr expos	•	
FTA disposition:Not ReportedItem group:Not ReportedItem nr:003NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADCounty code:007Owner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Unin status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:03/19/2012Case closed date:03/19/2012Case closed date:03/19/2012Case closed date:03/21/2012Violation type:SNri instances:00002Nr instances:00002Nr instances:00002Nr instances:00002Nr instances:0002Nr instances:0002Nr instances:0002Nr instances:0002Nr instances:0002Nr instances:0002Nr instances:000240Nr instances:000240	-	
Item group:Not ReportedItem nr:003NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000SIC inspd:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection scope:BDispection scope:BDispection scope:BDispection scope:SConference closed date:03/19/2012Case closed date:03/21/2012Violation type:SInitial violation type:SInitial violation type:SInitial violation type:SNr instances:00002RarrySNr instances:00002Adternent date:03/26/2012Nr exposed:00004Alintal penalty:000240		
Item nr: 003 NAICS ins: 000000 Office code: 00 Region: 01 Penalty contested: No SIC guide: 0000 SiC guide: 0000 SiC inspd: 0000 Standard 50: 19100217 B04 II Violation contested: No OSHA Inspection Activity #: 123193393 Facility name: BEVIN BROTHERS MANUFACTURING C facility address: 10 BEVIN ROAD EAST HAMPTON, CT 06424 County code: Owner code: 0000 SIC: 3469 NAICS: 332116 Area code: 115 Date opened: 12/22/2011 Union status: No Advanced notice: No Advanced notice: No Inspection scope: B Disposition: Not Reported Case closed date: 03/19/2012 Case closed date: 03/21/2012 Case closed date: 03/21/2012	•	
NAICS ins:000000Office code:00Region:01Penalty contested:NoSIC guide:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADcounty code:007Owner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCase closed date:03/19/2012Case closed date:03/21/2012Case closed date:03/21/2012Violation type:SInitial violation type:SInitial violation type:SInitial violation type:SInitial violation type:SInitial penalty:00002Early date:00002Initial penalty:000240Initial penalty:000240		
Region:01Penalty contested:NoSIC guide:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection scope:BDisposition:Not ReportedCase closed date:03/19/2012Case closed date:03/21/2012Violation type:SInitial violation type:SInitial violation type:SNr instances:00002East y date:000000Citation ID:01Issuance date:03/21/2012Violation type:SNr instances:00002Early date:000000Abatement date:03/26/2012Nr instances:00002Early date:00004Aitel penalty:0002640Current penalty:0002640Current penalty:0001000	NAICS ins:	
Parally contested:NoSIC guide:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADFacility address:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed date:03/21/2012Violation type:SInitial violation type:SInitial violation type:SNr instances:00002East y date:0000000Abatement date:03/21/2012Violation type:SInitial penalty:0002640Current penalty:0001000	Office code:	00
Penalty contested:NoSIC guide:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoInspection scope:BDisposition:Not ReportedCase closed date:03/19/2012Case closed date:03/21/2012Violation type:SIntial violation type:SInitial violation type:SNr instances:00002Early date:0000000Abarment date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Initial penalty:0002640Current penalty:0001000	Region:	01
SIC guide:0000SIC inspd:0000Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADfacility address:10 BEVIN ROADCounty code:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed date:03/21/2012Violation type:SInitial violation type:SInitial violation type:SInitial violation type:SNr instances:00002Katenet date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:0002640Current penalty:0001000	•	No
Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:Owner type:AOwner code:000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr exposed:00002East date:03/21/2012Violation type:SInitial violation type:SNr exposed:000000Abaement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		0000
Standard 50:19100217 B04 IIViolation contested:NoOSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:Owner type:AOwner code:000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr exposed:00002East date:03/21/2012Violation type:SInitial violation type:SNr exposed:000000Abaement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	•	0000
OSHA Inspection Activity #:123193393Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROADEAST HAMPTON, CT 06424County code:Owner type:AOwner code:000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection scope:BDisposition:Not ReportedCase closed date:03/19/2012Case closed date:03/21/2012Case closed date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Advanced natice:03/21/2012Case closed date:03/21/2012Case closed date:03/21/2012Violation type:SNr instances:00002Early date:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		19100217 B04 II
Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROAD EAST HAMPTON, CT 06424County code:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed date:03/21/2012Violation type:1Itsuance date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:000000Abatement penalty:0001000	Violation contested:	No
Facility name:BEVIN BROTHERS MANUFACTURING Cfacility address:10 BEVIN ROAD EAST HAMPTON, CT 06424County code:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed date:03/21/2012Violation type:1Itsuance date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:000000Abatement penalty:0001000	OSHA Inspection Activity #:	123193393
County code: O07 Owner type: A Owner code: 0000 SIC: 3469 NAICS: 332116 Area code: 115 Date opened: 12/22/2011 Union status: No Advanced notice: No Inspection type: UNPROGRAMMED Inspection scope: B Disposition: Not Reported Category: S Conference closed date: 03/19/2012 Case closed: No Issuance date: 03/21/2012 Violation type: S Initial violation type: S Nr instances: 000000 Abatement date: 03/26/2012 Nr exposed: 00004 Initial penalty: 0002640		BEVIN BROTHERS MANUFACTURING C
County code:007Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoIssuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Farly date:000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	facility address:	10 BEVIN ROAD
Owner type:AOwner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		EAST HAMPTON, CT 06424
Owner code:0000SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:03/26/2012Nr exposed:000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	County code:	007
SIC:3469NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Owner type:	A
NAICS:332116Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Owner code:	0000
Area code:115Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	SIC:	3469
Date opened:12/22/2011Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	NAICS:	332116
Union status:NoAdvanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Area code:	115
Advanced notice:NoInspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Date opened:	12/22/2011
Inspection type:UNPROGRAMMEDInspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Union status:	No
Inspection scope:BDisposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:0000000Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Advanced notice:	No
Disposition:Not ReportedCategory:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Inspection type:	UNPROGRAMMED
Category:SConference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:000000Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Inspection scope:	В
Conference closed date:03/19/2012Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	•	Not Reported
Case closed:NoCase closed date:0000000Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	Category:	S
Case closed date: 0000000 Citation ID: 01 Issuance date: 03/21/2012 Violation type: S Initial violation type: S Nr instances: 0000000 Early date: 0000000 Abatement date: 03/26/2012 Nr exposed: 00004 Initial penalty: 0002640 Current penalty: 0001000	Conference closed date:	03/19/2012
Citation ID:01Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		
Issuance date:03/21/2012Violation type:SInitial violation type:SNr instances:00002Early date:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		
Violation type:SInitial violation type:SNr instances:00002Early date:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		
Initial violation type:SInitial violation type:00002Kr instances:0000000Early date:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		
Nr instances:00002Early date:0000000Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000	••	
Early date: 0000000 Abatement date: 03/26/2012 Nr exposed: 00004 Initial penalty: 0002640 Current penalty: 0001000		
Abatement date:03/26/2012Nr exposed:00004Initial penalty:0002640Current penalty:0001000		
Nr exposed:00004Initial penalty:0002640Current penalty:0001000		
Initial penalty:0002640Current penalty:0001000		
Current penalty: 0001000		
Kecora: C		
	Record:	U

Emphasis:	Not Reported
Gravity:	05
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	004
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100219 B01
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	01
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	S
Nr instances:	00001 00000000
Early date: Abatement date:	
Nr exposed:	03/26/2012 00004
1	00004
Initial papalty:	0002640
Initial penalty: Current penalty:	0002640 0003000

Record:	С
Emphasis:	Not Reported
Gravity:	05
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	A
Item nr:	005
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100217 B04 II
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	
Inspection scope:	B
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date: Citation ID:	0000000
	01
Issuance date: Violation type:	03/21/2012 S
Initial violation type:	S
Nr instances:	00001
Early date:	0000000
Abatement date:	04/24/2012
Nr exposed:	00004
Initial penalty:	0004620

Current penalty:	000000
Record:	C
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	В
Item nr:	005
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100217 C01 I
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	02
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	R
Nr instances:	00001
Early date:	0000000
Abatement date:	04/24/2012
Nr exposed:	00006

Initial penalty:	0005000
Current penalty:	0002500
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	02
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	001
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19100132 D01
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	- Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	02
Issuance date:	03/21/2012
Violation type:	S
Initial violation type:	R
Nr instances:	00001
Early date:	0000000
Abatement date:	05/24/2012

Nr exposed:	00006
Initial penalty:	0005280
Current penalty:	0002500
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	02
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	00000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	002
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19101200 E01
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
-	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	03
Issuance date:	03/21/2012
Violation type:	0
Initial violation type:	0
Nr instances:	00001
Early date:	0000000

Abatement date:	03/26/2012
Nr exposed:	00006
Initial penalty:	000000
Current penalty:	000000
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	00
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	001
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19040029 A
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	A
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	03
Issuance date:	03/21/2012
Violation type:	0
Initial violation type:	0
Nr instances:	00001

	0000000
Early date:	
Abatement date: Nr exposed:	03/26/2012
1	00006
Initial penalty:	0000540
Current penalty:	0000300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	00
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	0000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	002
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19040029 A
Violation contested:	No
OSHA Inspection Activity #:	123193393
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	007
Owner type:	Α
Owner code:	0000
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	12/22/2011
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	S
Conference closed date:	03/19/2012
Case closed:	No
Case closed date:	0000000
Citation ID:	03
Issuance date:	03/21/2012
Violation type:	0
Initial violation type:	0

Nr instances:	00001
Early date:	0000000
Abatement date:	03/26/2012
Nr exposed:	00006
Initial penalty:	0000540
Current penalty:	0000300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	00
Hazardous category:	Not Reported
FTA contest date:	0000000
FTA final date:	0000000
FTA penalty amount:	00000000
FTA insp nr:	00000000
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	003
NAICS ins:	000000
Office code:	00
Region:	01
Penalty contested:	No
SIC guide:	0000
SIC inspd:	0000
Standard 50:	19040029 A
Violation contested:	No

NAME

TOWN OF EAST HAMPTON, PUBLIC W WALNUT AVENUE (ON THE STREET) 1 EAST HAMPTON, CT 06424

EDR ID: O-305615585

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 168 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

OSHA: Occupational Safety and Health Administration OSHA INSPECTIONS DETAILS:

OSHA Inspection Activity #:	305615585
Establishment Name:	TOWN OF EAST HAMPTON, PUBLIC W
Esablishment Address:	WALNUT AVENUE (ON THE STREET) 1
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	HIGHWAY AND STREET CONSTRUCTION
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0150900-S
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	12/08/06
Total Inspection Time:	3.0
Unionized:	UNION

45

STARR AUTO INC. 2 STAR PLACE EAST HAMPTON, CT 06424 EDR ID: 0-309489581

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 169 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

▼	OSHA: Occupational Safety and Health Administration
	OSHA DETAILS:

OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	А
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	450
Current penalty:	225
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	1
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0

STARR AUTO INC., 2 STAR PLACE EAST HAMPTON, CT 06424 (Continued)

FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	1
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100134 C02 II
Violation contested:	No
OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	H
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S S
Initial violation type:	-
Nr instances:	1 0
Early date: Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported

STARR AUTO INC., 2 STAR PLACE EAST HAMPTON, CT 06424 (Continued)

	No
FTA amended:	No Not Domonto d
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100134 D01 III
Violation contested:	No
OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No

STARR AUTO INC., 2 STAR PLACE EAST HAMPTON, CT 06424 (Continued)

	Not Deperted
FTA disposition:	Not Reported
Item group:	A
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd: Standard 50:	0
	19100134 E01
Violation contested:	No 200480581
OSHA Inspection Activity #:	309489581 STARR AUTO INC.
Facility name:	2 STAR PLACE
facility address:	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	– Not Reported
Category:	Н
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported

	5
Item group:	В
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100134 H01
Violation contested:	No
OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	Η
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006 1
Nr exposed:	0
Initial penalty:	0
Current penalty: Record:	
	Not Reported
Emphasis:	Not Reported
Gravity:	2 Not Poportod
Hazardous category:	Not Reported
FTA penalty amount:	0 0
FTA insp nr: FTA ISA:	-
FTA ISA: FTA amended:	Not Reported No
FTA disposition:	Not Reported C
Item group:	0

Item nr:	3
NAICS ins:	0
Office code:	0
	1
Region:	No
Penalty contested:	0
SIC guide:	-
SIC inspd:	0
Standard 50:	19100134 K06
Violation contested:	No
OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No UNPROGRAMMED
Inspection type:	B
Inspection scope:	-
Disposition:	Not Reported H
Category: Conference closed date:	
Conference closed date.	01/26/2007 Yes
Case closed date:	06/02/2006
Case closed date.	1
Issuance date:	06/22/2006
	S
Violation type: Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	4
	•

NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100134 I01 II
Violation contested:	No
OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	5
NAICS ins:	0

Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101025 D02
Violation contested:	No
OSHA Inspection Activity #:	309489581
Facility name:	STARR AUTO INC.
facility address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	7532
NAICS:	811121
Area code:	115
Date opened:	03/20/2006
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	н
Conference closed date:	01/26/2007
Case closed:	Yes
Case closed date:	06/02/2006
Citation ID:	1
Issuance date:	06/22/2006
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	07/25/2006
Nr exposed:	1
Initial penalty:	450
Current penalty:	225
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	1
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	6
NAICS ins:	0
0///	

STARR AUTO INC., 2 STAR PLACE EAST HAMPTON, CT 06424 (Continued)

0

Office code:

Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101200 E01
Violation contested:	No
OSHA INSPECTIONS DETAILS:	
OSHA Inspection Activity #:	309489581
Establishment Name:	STARR AUTO INC.
Esablishment Address:	2 STAR PLACE
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	TOP & BODY REPAIR AND PAINT SHOPS (1987)
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	1/26/07
Total Inspection Time: Unionized:	44.5 NONUNION
Unionizea.	NONUNION
OSHA VIOLATIONS DETAILS:	
OSHA Inspection Activity #:	309489581
Standard Violated:	1910.134 C02 II
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	225
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	309489581
Standard Violated:	1910.134 D01 III
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	6/22/06
Abatement Date:	7/25/06

Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	309489581
Standard Violated:	1910.134 E01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003A
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	309489581
Standard Violated:	1910.134 H01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003B
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	309489581
Standard Violated:	1910.134 I01 II
Event Title:	Not Reported
Event Title: Citation Type:	Not Reported Serious
Event Title: Citation Type: Disposition:	Not Reported Serious INFORMAL

Citation ID:	01004
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	309489581
Standard Violated:	1910.134 K06
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01003C
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	309489581
Standard Violated:	19101025 D02
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01005
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate	0
Penalty:	
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	309489581
Standard Violated:	19101200 E01

Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01006
Issue Date:	6/22/06
Abatement Date:	7/25/06
Abatement Status:	Completed
Original \$ Penalty:	450
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	225
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

NAME

BEVIN BROTHERS MANUFACTURING C 10 BEVIN ROAD EAST HAMPTON, CT 06424 EDR ID: 0-310920889

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 181 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

▼ OSHA: Occupational Safety and Health Administration OSHA DETAILS:

OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	4
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	6
Initial penalty:	750
Current penalty:	500
Record:	R
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0

47

FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	1
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100095 C01
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	H
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	2 450
Initial penalty:	
Current penalty:	225 Nat Deported
Record:	Not Reported
Emphasis: Gravity:	Not Reported 1
-	
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr: FTA ISA:	
	Not Reported

FTA amended:	No
FTA disposition:	Not Reported
Item group:	A
Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100132 A
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	2
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	4
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0 Nat Departed
FTA ISA:	Not Reported
FTA amended:	No

FTA disposition:	Not Reported
Item group:	B
Item nr:	2
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100133 A01
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed: Initial penalty:	8 1050
Current penalty:	525
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	5
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported

Item group:	Not Reported
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100132 D01
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	Α
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	2
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2 Nu Deventud
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr: FTA ISA:	0 Not Reported
FTA ISA: FTA amended:	Not Reported No
FTA disposition:	Not Reported Not Reported
Item group:	Not Reported

Item nr:	4
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100134 C01
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
-	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	2
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	2
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2 Not Deported
Hazardous category:	Not Reported
FTA penalty amount: FTA insp nr:	0 0
FTA IISP III: FTA ISA:	0 Not Reported
FTA isa: FTA amended:	Not Reported
FTA disposition:	No Not Reported
Item group:	A
Item nr:	5
Romm.	

NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100134 E01
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	2
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No Not Described
FTA disposition:	Not Reported
Item group:	B
Item nr:	5
NAICS ins:	0

Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
-	0
SIC inspd: Standard 50:	19100134 F01
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
lacinty address.	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	12/12/2007
Nr exposed:	8
Initial penalty:	1050
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	5
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	6
NAICS ins:	0
Office code:	0

Degion	1
Region: Penalty contested:	1 No
•	0
SIC guide:	0
SIC inspd: Standard 50:	0 19100138 B
	No
Violation contested:	
OSHA Inspection Activity #:	
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
County and a	EAST HAMPTON, CT 06424 7
County code: Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
	05/25/2007
Date opened: Union status:	03/23/2007 No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	12/12/2007
Nr exposed:	3
Initial penalty:	1500
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	A
Item nr:	7
NAICS ins:	0
Office code:	0
Region:	1

Penalty contested:	Νο
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 D01 I
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	11/06/2008
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/09/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	12/12/2007
Nr exposed:	3
Initial penalty:	0
Current penalty: Record:	0 Not Reported
	Not Reported
Emphasis: Gravity:	Not Reported 10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	В
Item nr:	7
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No

SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 D01 IIB
Violation contested:	No
OSHA Inspection Activity #:	310920889
Facility name:	BEVIN BROTHERS MANUFACTURING C
facility address:	10 BEVIN ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3469
NAICS:	332116
Area code:	115
Date opened:	05/25/2007
Union status:	No
Advanced notice:	No
Inspection type:	
Inspection scope:	B Not Demontoid
Disposition:	Not Reported
Category: Conference closed date:	H 11/06/2008
Conference closed date: Case closed:	
Case closed date:	Yes
	06/27/2007 1
Citation ID:	
Issuance date:	11/09/2007
Violation type:	S S
Initial violation type:	3
Nr instances:	0
Early date: Abatement date:	12/12/2007
Nr exposed:	3
Initial penalty:	750
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	8
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
-	

	C inspd:	0
	andard 50:	19101052 L01
	olation contested:	No
	SHA Inspection Activity #:	310920889
	acility name:	BEVIN BROTHERS MANUFACTURING C
fa	cility address:	10 BEVIN ROAD
		EAST HAMPTON, CT 06424
Co	ounty code:	7
O	wner type:	A
	wner code:	0
SI	C:	3469
N/	AICS:	332116
Ar	ea code:	115
Da	ate opened:	05/25/2007
Ur	nion status:	No
Ac	dvanced notice:	No
In	spection type:	UNPROGRAMMED
In	spection scope:	В
Di	sposition:	Not Reported
Ca	ategory:	Н
Co	onference closed date:	11/06/2008
Ca	ase closed:	Yes
Ca	ase closed date:	06/27/2007
Ci	tation ID:	1
ls	suance date:	11/09/2007
Vi	olation type:	S
In	itial violation type:	S
Nr	instances:	1
Ea	arly date:	0
At	patement date:	02/29/2008
Nr	exposed:	5
In	itial penalty:	600
С	urrent penalty:	300
Re	ecord:	Not Reported
Er	nphasis:	Not Reported
Gi	ravity:	2
	azardous category:	Not Reported
	ΓA penalty amount:	0
	ΓA insp nr:	0
F٦	ΓA ISA:	Not Reported
F٦	ΓA amended:	No
F٦	ΓA disposition:	Not Reported
lte	em group:	A
	em nr:	9
	AICS ins:	0
O	fice code:	0
	egion:	1
	enalty contested:	No
	C guide:	0
SI	C inspd:	0

Stan	ndard 50:	19101200 E01
	ation contested:	No
	A Inspection Activity #:	310920889
	lity name:	BEVIN BROTHERS MANUFACTURING C
	ity address:	10 BEVIN ROAD
laoin		EAST HAMPTON, CT 06424
Cou	nty code:	7
	ner type:	A
	ner code:	0
SIC:		3469
NAI		332116
	a code:	115
_	e opened:	05/25/2007
	on status:	No
	anced notice:	No
	ection type:	UNPROGRAMMED
•	ection scope:	B
•	osition:	Not Reported
•	egory:	Н
	ference closed date:	11/06/2008
	e closed:	Yes
	e closed date:	06/27/2007
Citat	tion ID:	1
Issu	ance date:	11/09/2007
Viola	ation type:	S
	al violation type:	S
	istances:	1
Earl	y date:	0
Abat	tement date:	02/29/2008
Nr e	xposed:	5
Initia	al penalty:	0
Curr	ent penalty:	0
Rec	ord:	Not Reported
Emp	hasis:	Not Reported
Grav	vity:	2
Haza	ardous category:	Not Reported
FTA	penalty amount:	0
FTA	insp nr:	0
FTA	ISA:	Not Reported
FTA	amended:	No
FTA	disposition:	Not Reported
Item	group:	В
Item	nr:	9
NAI	CS ins:	0
	e code:	0
Reg		1
	alty contested:	No
	guide:	0
	inspd:	0
Stan	ndard 50:	19101200 H

BEVIN BROTHERS MANUFACTURING C, 10 BEVIN ROAD EAST HAMPTON, CT 06424 (Continued)

No

Violation contested: OSHA INSPECTIONS DETAILS:

310920889 BEVIN BROTHERS MANUFACTURING C 10 BEVIN ROAD EAST HAMPTON, CT 06424 MIDDLESEX METAL STAMPINGS, NEC Not Reported Not Reported Not Reported 0111500 Not Reported Not Reported Not Reported (OPEN)
57.0
NONUNION
310920889 RELA-SUBS: Not Reported Not Reported
310920889 1910.095 C01 Related to a Referral Serious Petition to Modify Abatement 01001 11/09/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement

Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	310920889
Standard Violated:	1910.132 A
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01002A
Issue Date:	11/09/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	310920889
Standard Violated:	1910.132 D01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01003
Issue Date:	11/09/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	310920889
Standard Violated:	1910.133 A01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01002B
Issue Date:	11/09/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement

Original Failure-to-Abate	Petition to Modify Abatement
Penalty: Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate	Petition to Modify Abatement
Penalty:	
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
involved.	
OSHA Inspection Activity #:	310920889
Standard Violated:	1910.134 C01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01004
Issue Date:	11/09/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate	Petition to Modify Abatement
Penalty: Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	310920889
OSHA Inspection Activity #: Standard Violated:	310920889 1910.134 E01
Standard Violated:	1910.134 E01
Standard Violated: Event Title:	1910.134 E01 Not Reported
Standard Violated: Event Title: Citation Type:	1910.134 E01 Not Reported Serious
Standard Violated: Event Title: Citation Type: Disposition:	1910.134 E01 Not Reported Serious Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported 310920889
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported 310920889 1910.134 F01
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported 310920889 1910.134 F01 Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported 310920889 1910.134 F01 Not Reported Serious
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition:	1910.134 E01 Not Reported Serious Petition to Modify Abatement 01005A 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported Serious Petition to Modify Abatement

Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	310920889
Standard Violated:	19101200 E01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01009A
Issue Date:	11/09/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
	-
Hazardous Substance Involved:	Not Reported
	Not Reported 310920889
Involved:	
Involved: OSHA Inspection Activity #:	310920889
Involved: OSHA Inspection Activity #: Standard Violated:	310920889 19101200 H
Involved: OSHA Inspection Activity #: Standard Violated: Event Title:	310920889 19101200 H Not Reported
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type:	310920889 19101200 H Not Reported Serious
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported
Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	310920889 19101200 H Not Reported Serious Petition to Modify Abatement 01009B 11/09/07 2/29/08 Completed Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported S10920889 DEL-1910.138 B

Disposition:	INFORMAL	
Citation ID:	01006	
Issue Date:	11/09/07	
Abatement Date:	12/12/07	
Abatement Status:	Not Reported	
Original \$ Penalty:	1050	
Original Failure-to-Abate Penalty:	Not Reported	
Actual Penalty Amount:	Not Reported	
Actual Failure-to-Abate Penalty:	Not Reported	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	310920889	
Standard Violated:	DEL-19101052 D01	I
Event Title:	Not Reported	
Citation Type:	Serious	
Disposition:	INFORMAL	
Citation ID:	01007A	
Issue Date:	11/09/07	
Abatement Date:	12/12/07	
Abatement Status:	Not Reported	
Original \$ Penalty:	1500	
Original Failure-to-Abate Penalty:	Not Reported	
Actual Penalty Amount:	Not Reported	
Actual Failure-to-Abate Penalty:	Not Reported	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	310920889	
Standard Violated:	DEL-19101052 D01	I
Event Title:	Not Reported	
Citation Type:	Serious	
Disposition:	INFORMAL	
Citation ID:	01007B	
Issue Date:	11/09/07	
Abatement Date:	12/12/07	
Abatement Status:	Not Reported	
Original \$ Penalty:	0	
Original Failure-to-Abate Penalty:	Not Reported	
Actual Penalty Amount:	Not Reported	
Actual Failure-to-Abate Penalty:	Not Reported	
Penalty Contested:	Not Reported	
Hazardous Substance Involved:	Not Reported	
OSHA Inspection Activity #:	310920889	

Standard Violated:	DEL-19101052 L01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01008
Issue Date:	11/09/07
Abatement Date:	12/12/07
Abatement Status:	Not Reported
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported
Actual Failure-to-Abate Penalty:	Not Reported
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

P.S.I. PLUS, INC. 10 BEVINS ROAD EAST HAMPTON, CT 06424 EDR ID: 0-311058309

FINDINGS

OSHA: Occupational Safety and Health Administration ______ Page 200 Specific inspection, violation and fatality/catastrophe information regarding inspec...Full Description>>

DETAILS

•	OSHA: Occupational Safety and Health Administration	
	OSHA DETAILS:	
	OSHA Inspection Activity #:	311058309
	Facility name:	P.S.I. PLUS, INC.
	facility address:	10 BEVINS ROAD
		EAST HAMPTON, CT 06424
	County code:	7
	Owner type:	А
	Owner code:	0
	SIC:	3999
	NAICS:	332999
	Area code:	115
	Date opened:	05/24/2007
	Union status:	No
	Advanced notice:	No
	Inspection type:	UNPROGRAMMED
	Inspection scope:	В
	Disposition:	Not Reported
	Category:	Н
	Conference closed date:	04/05/2010
	Case closed:	Yes
	Case closed date:	06/27/2007
	Citation ID:	1
	Issuance date:	11/14/2007
	Violation type:	S
	Initial violation type:	S
	Nr instances:	2
	Early date:	0
	Abatement date:	01/19/2008
	Nr exposed:	1
	Initial penalty:	1500
	Current penalty:	750

Not Reported

Not Reported

Not Reported

10

0

0

Record:

Gravity:

Emphasis:

Hazardous category:

FTA penalty amount: FTA insp nr:

P.S.I. PLUS, INC., 10 BEVINS ROAD EAST HAMPTON, CT 06424 (Continued)

, -,	,
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	1
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19100095 C01
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	01/19/2008
Nr exposed:	2
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported

P.S.I. PLUS, INC., 10 BEVINS ROAD EAST HAMPTON, CT 06424 (Continued)

FTA amended:	No
FTA disposition:	
	Not Reported Not Reported
Item group: Item nr:	2
NAICS ins:	0
Office code:	0
	1
Region:	No
Penalty contested:	0
SIC guide:	0
SIC inspd: Standard 50:	-
Violation contested:	19100132 D01 No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC. 10 BEVINS ROAD
facility address:	
County and a	EAST HAMPTON, CT 06424 7
County code: Owner type:	A
Owner type: Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	- Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	1
Initial penalty:	1500
Current penalty:	750
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No

P.S.I. PLUS, INC., 10 BEVINS ROAD EAST HAMPTON, CT 06424 (Continued)

	Not Demonto d
FTA disposition:	Not Reported
Item group:	A
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 D01 I
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
County order	EAST HAMPTON, CT 06424 7
County code: Owner type:	A
Owner code:	0
SIC:	
NAICS:	3999 332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	1
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported

	_
Item group:	В
Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 D01 IIB
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened: Union status:	05/24/2007 No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	1
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	10
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	C

Item nr:	3
NAICS ins:	0
Office code:	0
Region:	1
•	No
Penalty contested:	
SIC guide:	0
SIC inspd: Standard 50:	19101052 D02
Violation contested:	No
OSHA Inspection Activity #: Facility name:	311058309
•	P.S.I. PLUS, INC. 10 BEVINS ROAD
facility address:	EAST HAMPTON, CT 06424
County and	7
County code:	A
Owner type: Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
	05/24/2007
Date opened: Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	B
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	1
Initial penalty:	750
Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	4

NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 G02 I
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	2
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	2
Initial penalty:	1050
Current penalty:	525
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	5
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	5
NAICS ins:	0

	,
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 H01
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	02/29/2008
Nr exposed:	1
Initial penalty:	600
Current penalty:	300
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	2
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	Not Reported
Item nr:	6
NAICS ins:	0
Office code:	0

PSIPHISH	, 10 BEVINS ROAD EAST HAMPTON, CT (6424 (Continued)
F.J.I. FLUJ, II	, TO DEVING ROAD EAST HAMFTON, OT O	

Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 01
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	H
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date: Abatement date:	0 02/29/2008
	2
Nr exposed:	2 750
Initial penalty: Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	A
Item nr:	7
NAICS ins:	0
Office code:	0
Region:	1
2	

Penalty contested:	No
SIC guide:	0
SIC inspd:	0
Standard 50:	19101052 K
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	Н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	01/19/2008
Nr exposed:	3
Initial penalty:	0
Current penalty:	0
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	В
Item nr:	7
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
,	-

	0
SIC guide:	0
SIC inspd: Standard 50:	-
Violation contested:	19101052 L01
	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	
Inspection scope:	B
Disposition:	Not Reported
Category:	Η
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	01/19/2008
Nr exposed:	2 0
Initial penalty:	0
Current penalty: Record:	-
	Not Reported
Emphasis:	Not Reported 3
Gravity:	
Hazardous category: FTA penalty amount:	Not Reported 0
FTA insp nr:	0
FTA ISA:	Not Reported
FTA amended:	No
FTA disposition:	Not Reported
Item group:	C
Item nr:	7
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
oro guide.	0

SIC inspd:	0
Standard 50:	19101052 L04
Violation contested:	No
OSHA Inspection Activity #:	311058309
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
County code:	7
Owner type:	Α
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	UNPROGRAMMED
Inspection scope:	В
Disposition:	Not Reported
Category:	н
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	01/19/2008
Nr exposed:	2
Initial penalty:	750
Current penalty:	375
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr:	0
FTA IISP III. FTA ISA:	Not Reported
FTA ISA. FTA amended:	No
FTA disposition:	Not Reported
Item group:	A 8
Item nr:	-
NAICS ins:	0
Office code:	0
Region:	1
Penalty contested:	No
SIC guide:	0
SIC inspd:	0

Standard 50:	19101200 E01
Violation contested:	No
	311058309
OSHA Inspection Activity #:	
Facility name:	P.S.I. PLUS, INC.
facility address:	10 BEVINS ROAD
Country and a	EAST HAMPTON, CT 06424
County code:	7
Owner type:	A
Owner code:	0
SIC:	3999
NAICS:	332999
Area code:	115
Date opened:	05/24/2007
Union status:	No
Advanced notice:	No
Inspection type:	
Inspection scope:	B
Disposition:	Not Reported
Category:	Η
Conference closed date:	04/05/2010
Case closed:	Yes
Case closed date:	06/27/2007
Citation ID:	1
Issuance date:	11/14/2007
Violation type:	S
Initial violation type:	S
Nr instances:	1
Early date:	0
Abatement date:	01/19/2008
Nr exposed:	2
Initial penalty:	0
Current penalty:	0 Not Demosteri
Record:	Not Reported
Emphasis:	Not Reported
Gravity:	3 Not Demosteri
Hazardous category:	Not Reported
FTA penalty amount:	0
FTA insp nr: FTA ISA:	0 Not Roported
FTA ISA. FTA amended:	Not Reported No
FTA disposition:	Not Reported
Item group:	B 8
Item nr: NAICS ins:	8 0
Office code:	0
	1
Region:	No
Penalty contested:	NO 0
SIC guide:	0
SIC inspd: Standard 50:	-
Stanuaru SU.	19101200 H01

P.S.I. PLUS, INC., 10 BEVINS ROAD EAST HAMPTON, CT 06424 (Continued)

No

Violation contested: OSHA INSPECTIONS DETAILS:

OSHA Inspection Activity #:	311058309
Establishment Name:	P.S.I. PLUS, INC.
Esablishment Address:	10 BEVINS ROAD
	EAST HAMPTON, CT 06424
Esablishment County:	MIDDLESEX
Primary SIC:	MANUFACTURING INDUSTRIES, NEC
Secondary SIC:	Not Reported
Employees at Site:	Not Reported
Total Empoyees:	Not Reported
Inspection Report ID:	0111500
Lost Workday Injury Rate:	Not Reported
Inspector Title:	Not Reported
Case Completed Date:	(OPEN)
Total Inspection Time:	49.0
Unionized:	NONUNION

OSHA VIOLATIONS DETAILS:

OSHA Inspection Activity #:	311058309
Standard Violated:	RELA-SUBS:
Event Title:	Not Reported
Citation Type:	Not Reported
Disposition:	Not Reported
Citation ID:	Not Reported
Issue Date:	Not Reported
Abatement Date:	Not Reported
Abatement Status:	Not Reported
Original \$ Penalty:	Not Reported
Original Failure-to-Abate Penalty:	Not Reported
Actual Penalty Amount:	Not Reported
Actual Failure-to-Abate Penalty:	Not Reported
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	1910.095 C01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01001
Issue Date:	11/14/07
Abatement Date:	1/19/08
Abatement Status:	Not Reported
Original \$ Penalty:	1500
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	750

Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	1910.132 D01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01002
Issue Date:	11/14/07
Abatement Date:	1/19/08
Abatement Status:	Completed
Original \$ Penalty:	600
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	300
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 D01 I
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01003A
Issue Date:	11/14/07
Abatement Date:	2/29/08
Abatement Status:	Not Reported
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 D01 IIB
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01003B
Issue Date:	11/14/07
Abatement Date:	2/29/08
Abatement Status:	Not Reported
Original \$ Penalty:	Petition to Modify Abatement
	-

Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance	Not Reported
Involved:	
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 D02
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01003C
Issue Date:	11/14/07
Abatement Date:	2/29/08
Abatement Status:	Not Reported
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
, ,	
Standard Violated:	19101052 G02 I
	19101052 G02 I Not Reported
Standard Violated: Event Title: Citation Type:	
Standard Violated: Event Title:	Not Reported
Standard Violated: Event Title: Citation Type:	Not Reported Serious
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported 311058309 19101052 H01
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Soft Reported Not Reported Not Reported 311058309 19101052 H01 Not Reported
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition: Citation ID:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported Serious Petition to Modify Abatement 01005
Standard Violated: Event Title: Citation Type: Disposition: Citation ID: Issue Date: Abatement Date: Abatement Date: Abatement Status: Original \$ Penalty: Original Failure-to-Abate Penalty: Actual Penalty Amount: Actual Penalty Amount: Actual Failure-to-Abate Penalty: Penalty Contested: Hazardous Substance Involved: OSHA Inspection Activity #: Standard Violated: Event Title: Citation Type: Disposition:	Not Reported Serious Petition to Modify Abatement 01004 11/14/07 2/29/08 Not Reported Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Petition to Modify Abatement Not Reported Not Reported Not Reported Serious Petition to Modify Abatement

Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01006
Issue Date:	11/14/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 K
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	Petition to Modify Abatement
Citation ID:	01007A
Issue Date:	11/14/07
Abatement Date:	2/29/08
Abatement Status:	Completed
Original \$ Penalty:	Petition to Modify Abatement
Original Failure-to-Abate Penalty:	Petition to Modify Abatement
Actual Penalty Amount:	Petition to Modify Abatement
Actual Failure-to-Abate Penalty:	Petition to Modify Abatement
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 L01
	10101002 201
Event Title:	Not Reported
Event Title: Citation Type:	

Disposition:	INFORMAL
Citation ID:	01007B
Issue Date:	11/14/07
Abatement Date:	1/19/08
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101052 L04
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01007C
Issue Date:	11/14/07
Abatement Date:	1/19/08
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309
Standard Violated:	19101200 E01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01008A
Issue Date:	11/14/07
Abatement Date:	1/19/08
Abatement Status:	Completed
Original \$ Penalty:	750
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	375
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported
OSHA Inspection Activity #:	311058309

Standard Violated:	19101200 H01
Event Title:	Not Reported
Citation Type:	Serious
Disposition:	INFORMAL
Citation ID:	01008B
Issue Date:	11/14/07
Abatement Date:	1/19/08
Abatement Status:	Completed
Original \$ Penalty:	0
Original Failure-to-Abate Penalty:	0
Actual Penalty Amount:	0
Actual Failure-to-Abate Penalty:	0
Penalty Contested:	Not Reported
Hazardous Substance Involved:	Not Reported

NAME

L & W INDUSTRIES, INC. 85 MAIN STREET, REAR EAST HAMPTON, CT 06424

EDR ID: S104187574

FINDINGS CPCS: Contaminated or Potentially Contaminated Sites Page 219 Contaminated or Potentially Contaminated Sites...Full Description>> Page 219 SDADB: Site Discovery and Assessment Database Page 219 All sites reported to Permitting, Enforcement, and Remediation Division where it is ...Full Description>> Page 219 PROPERTY: Property Transfer Filings Page 221 A listing of sites that meet the definition of a hazardous waste establishment. The...Full Description>> E

DETAILS

 CPCS: Contaminated or Potentially Contaminated Sites CPCS:

Site Type:	Projects
Lust Status code:	Not Reported
Lust Status:	Not Reported
PTP Form:	III
Program:	Property Transfer Program
Comments:	Projects
Site Type Definition:	Property Transfer Form III

▼ SDADB: Site Discovery and Assessment Database

Site Discovery and Assessment:

Facility ID:	835
Rem Master ID:	1253
PTP ld:	Not Reported
WPC Number:	Not Reported
Postal District:	Not Reported
Latitude:	Not Reported
Longitude:	Not Reported
Lat/Long Determined By:	Not Reported
Ground Water Quality Classification:	GA
Surface Water Quality Classification:	Not Reported
Waste Type:	Not Reported
Disposal:	Not Reported
Sample Data Available:	False
Updated By:	Not Reported
Update Program:	Not Reported
Updated:	Not Reported
Date Created:	Not Reported
Duplicate:	False
SDA Federal:	

L & W INDUSTRIES, INC., 85 MAIN STREET, REAR EAST HAMPTON, CT 06424 (Continued)

EPA CERCLIS Id:	Not Reported
Number EPA RCRIS Id:	Not Reported
Site on EPA's CERCLIS:	Not Reported
Site Archived from CERCLIS:	Not Reported
Archive Date:	Not Reported
EPA's Removal at Site:	Not Reported
Deferred to another EPA Program:	Not Reported
EPA Env Priority Initiative Site:	Not Reported
Federal Facility:	Not Reported
Site on EPA's National Priority List:	Not Reported
Part of an NPL site:	Not Reported
RCRA Generator Status:	Not Reported
RCRA Permit Status:	Not Reported
SDA Referral:	
Referral Id:	788
Source of referral:	PTP
Date Received:	7/1/1987
Staff Assigned:	Not Reported
Remediation Program:	Not Reported
Date dt_assigned:	Not Reported
Remediation Complete Approved DEP/Verified by LEP:	Not Reported
Outcome:	Not Reported
Outcome: SDA Remedial:	Not Reported
SDA Remedial:	
SDA Remedial: Remedial Id:	268
SDA Remedial: Remedial Id: PTP Id:	268 476
SDA Remedial: Remedial ld: PTP ld: Remediation Program:	268 476 III
SDA Remedial: Remedial Id: PTP Id:	268 476
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program	268 476 III
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program Entered:	268 476 III Not Reported
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned:	268 476 III Not Reported WILCOX, J.
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program:	268 476 III Not Reported WILCOX, J. PTP
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase:	268 476 III Not Reported WILCOX, J. PTP Not Reported A
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order Number: Date order issued:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order Number:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order number: Date order issued: Remedial Investigation	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported Not Reported
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order issued: Order Number: Date order issued: Remedial Investigation Start: Remedial Investigation Completed: Remedial Design Start:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported Not Reported Not Reported Not Reported Not Reported
SDA Remedial: Remedial Id: PTP Id: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order issued: Order Number: Date order issued: Remedial Investigation Start: Remedial Investigation Completed:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported Not Reported Not Reported Not Reported
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order Aumber: Date order issued: Order Number: Date order issued: Remedial Investigation Start: Remedial Investigation Completed: Remedial Design Start: Remedial Design complet: Remedial Action Start:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order Number: Date order issued: Remedial Investigation Start: Remedial Investigation Start: Remedial Design Start: Remedial Design complet: Remedial Action Start: Remedial Action Completed:	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported Not Reported
SDA Remedial: Remedial ld: PTP ld: Remediation Program: Remediation Program Entered: Staff Assigned: Remediation Program: Date dt_assign: Project Phase: Order issued: Order Number: Date order issued: Remedial Investigation Start: Remedial Investigation Start: Remedial Investigation Completed: Remedial Design Start: Remedial Design complet: Remedial Action Start: Remedial Action	268 476 III Not Reported WILCOX, J. PTP Not Reported A False Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported Not Reported

L & W INDUSTRIES, INC., 85 MAIN STREET, REAR EAST HAMPTON, CT 06424 (Continued)

Remediation complete Approved DEP/Verified by LEP:	Not Reported
SDA Orders:	
Order Id:	Not Reported
Order Number:	Not Reported
Date order issued:	Not Reported
Staff Assigned:	Not Reported
Type of Order:	Not Reported
Order Respondent:	Not Reported
Admin Appeal Date:	Not Reported
Date of Admin Appeal Ruling:	Not Reported
Date of Admin Appeal Ruling:	Not Reported
Date of Final Order:	Not Reported
Date of Court Appeal:	Not Reported
Date of Court Ruling:	Not Reported
Date of Court Ruling:	Not Reported
Date Order Modified:	Not Reported
Date Referred to AG:	Not Reported
Judgement:	Not Reported
Date of AGR judgement:	Not Reported
Penalty assessed:	Not Reported
Order Complete:	Not Reported
In compliance:	Not Reported
Comments:	Not Reported
▼ PROPERTY: Property Transfer Filings	
CT Property:	
Seller Name:	Walter J. Smith
Buyer Name:	David Yeager
Certifying Party:	Not Reported
Certifying Attention Person:	Not Reported
Title Of Certifying Person:	Not Reported

Not Reported Form III (DEP-PERD-PTP-203) when a discharge, spillage, uncontrolled loss, seepage or filtration of hazardous waste has occurred at the parcel that has not been fully remediated or the environmental conditions at the parcel are unknown. The person signing the Form III certification agrees to investigate and remediate the site in accordance with the remediation standards. The statute does not require completion of remediation before the parcel is transferred. Any person submitting a Form III shall simultaneously submit a completed Environmental Condition Assessment Form (ECAF)(DEP-PERD-PTP-200).

Date Recieved:
Ackn Date:
Determination Date:
LEP Verified/DEP Approval Date:
Rem Id:
Remediation Location Id:
Date Entered:

Certifying Person Address:

Property Transfer Forms:

Certifying Person City,St,Zip:

1611 1061 Not Reported

Not Reported

07/29/1987 08/21/1987 Not Reported Not Reported

L & W INDUSTRIES, INC., 85 MAIN STREET, REAR EAST HAMPTON, CT 06424 (Continued)

Drogrom:	Bronorty Tronofor Brogrom
Program: GAO Site:	Property Transfer Program False
Staff Full Name:	Mary Jane Dapkus
	Not Reported
Super/Date: Stage Of Project:	NO ACTIVITY
RP Level Of Activity:	LOW
RP Needed Level Of	LOW
Activity:	LOW
Staff Level Of Activity:	LOW
Staff Needed Level Of Activity:	LOW
Public Intrest:	LOW
PRP Cooperation:	LOW
Enforcement Status:	NONE TAKEN
Level Of Complexity:	LOW
Complex Eng Or Sci:	False
Complex Due To Public Involvement:	False
Politically Complex:	False
Complex Enforcement:	False
Coordination With Other Bureaus:	False
EPA Involvement:	False
Staff Prefrence:	PASS ON
Readiness For Transfer:	READY TO TRANSFER NOW
Project Transfer Time:	7/1/00
Transfer Comments:	Not Reported
Staff As Of July 2000:	Wilcox Jeff
Initial Staff:	JBW
Type Of Transfer:	Not Reported
Salutation:	Not Reported
Relationship To Transfer:	Not Reported
Audit Date:	Not Reported
Verif Type:	Not Reported
Audit Outcome:	Not Reported
GW:	GB/GA
Basin:	Not Reported
1st Payment:	Not Reported
Pay Tag1:	Not Reported
2nd Payment:	Not Reported
Pay Tag2:	Not Reported
RTN:	Not Reported
Revised:	Not Reported
ECAF Received:	Not Reported
Old Determination Date:	Not Reported
Redeterminationdate:	Not Reported
Previous Determination:	Not Reported
Monitoringoption:	Not Reported
Postremedialmonitoring:	Not Reported
Schedule Of I/R:	Not Reported
Schedule Overdue:	Not Reported
Aprvl Sched:	Not Reported

L & W INDUSTRIES, INC., 85 MAIN STREET, REAR EAST HAMPTON, CT 06424 (Continued)

X A B	
Yr 1 Report:	Not Reported
Yr 2 Report:	Not Reported
Report Overdue:	Not Reported
Ext Aprvl Sched:	Not Reported
License #:	Not Reported
Project Phase:	Not Reported
PT Comments:	not transferred
EPA Id Number:	Not Reported
GW Class:	Not Reported
SW Class:	Not Reported
AO/C0:	Not Reported
Water Lead(Y Or N):	Not Reported
Priority:	Not Reported
Project Status(A, I Or D):	Not Reported
Last Updated:	Not Reported
SR Comments:	Not Reported
Priority Or Work-Load:	Not Reported
Status:	Not Reported
Notes:	Not Reported
Special Project Name:	Not Reported
Special Project Comments:	Not Reported
DOT Project:	Not Reported
Pt Counter:	Not Reported
Project Complete:	False
Project Inactive:	False
Int Deposit #:	Not Reported
Deposit #:	Not Reported
Spill Case #:	Not Reported
Diversion Id:	Not Reported
Public Notice:	Not Reported
RAP Received:	Not Reported
RAP Approved:	Not Reported
Compliance Category:	Not Reported
Delete Record:	False
ECAF Reviewed By:	Not Reported
Not Locatable:	False
Primary Address:	True
AKA Site Name:	False
Primary Site Name:	True
AKA Site Address:	False
Lead:	Not Reported
	•

NAME

RICHARD VESCE 56 MAIN STREET

EAST HAMPTON, CT 06424

EDR ID: S104311474

FINDINGS CPCS: Contaminated or Potentially Contaminated Sites Page 224 Contaminated or Potentially Contaminated Sites...Full Description>> Page 224 LUST: Leaking Underground Storage Tank List Page 224 Leaking Underground Storage Tank Incident Reports. LUST records contain an inventor...Full Description>> Page 224 SPILLS: Oil & Chemical Spill Database Page 227 Oil and Chemical Spill Data....Full Description>> Image 227

DETAILS

▼ CPCS: Contaminated or Potentially Contaminated Sites

CPCS:

Site Type:	LUST
Lust Status code:	4
Lust Status:	Lust Completed (DEP's significant hazard definition)
PTP Form:	Not Reported
Program:	Not Reported
Comments:	1000, Heating Oil, Private, 1000 Lust : Tank & Soil Removed
Site Type Definition:	Leaking Underground Storage Tanks Completed

▼ LUST: Leaking Underground Storage Tank List

LUST:	C C
LUST Id:	8956
UST Facility Id:	Not Reported
LUST Case Id:	36982
Lust Status:	Lust Completed
Processing Status:	Not Reported
EPA Reportable:	False
Motor Fuel:	False
Diesel:	False
Gasoline:	False
Other:	False
Other Release:	Not Reported
No Release:	False
Leak:	False
Tank:	False
Piping:	False
Overfill:	False
Removal:	False
Incident Date:	09/20/1999
Entry Date:	Not Reported
Site Case Id:	9906385
UST Site Id:	Not Reported

50

RICHARD VESCE, 56 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Cost Recovery Spill Case #:	Not Reported
Old SITS Number:	Not Reported
Case Log Id:	Not Reported
Monthly Report Id:	0
UST Owner Id:	Not Reported
LUST Owner Id:	Not Reported
UST Event Id:	9137
Contact Info:	Not Reported
Contact EMail:	Not Reported
Site Contact City, St, Zip:	UNKNOWN
2nd Contact:	Not Reported
2nd Contact EMail:	Not Reported
2nd Contact Address:	Not Reported
2nd Contact City,St,Zip:	UNKNOWN
2nd Contact Address 2:	Not Reported
2nd Contact City 2:	Not Reported
2nd Contact Phone	
Number:	Not Reported
2nd Contact Fax Number:	Not Reported
2nd Contact Type:	Not Reported
Facility City Num:	42
Site Contact:	Not Reported
Site Contact Address:	Not Reported
Site Contact Add 2:	Not Reported
Site Contact City 2:	Not Reported
Site Contact Phone:	Not Reported
Site Contact Fax:	Not Reported
Site Contact Type:	Not Reported
Department Contact 1:	Not Reported
Department Contact 2:	Not Reported
Referral Source:	Not Reported
Offsite Source:	False
Date Referred:	Not Reported
Emergency:	False
Private Heating Fuel:	True
Commercial Heating Fuel:	False
0	
Commercial HF < 2100 Gal.:	False
Commercial HF > 2100 Gal.:	False
Commercial HF - Size Unk:	False
No LUST Site:	False
Cost Recvry Prgm Candidate:	False
OCSRD Complete:	True
Follow Up Flag:	False
Alternate Water Supply:	False
Relocation:	False
Responsible Party:	False
Responsible EMail:	Not Reported
Resp Party Name:	Not Reported
Resp Party Address:	Not Reported

RICHARD VESCE, 56 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Resp Party City,St,Zip:	Not Reported
Resp Party Town Number:	UNKNOWN
Resp Party Phone:	Not Reported
Resp Party Fax:	Not Reported
Resp Party Name 2:	Not Reported
Resp Party Address 2:	Not Reported
Resp Party Phone 2:	Not Reported
Investigator Id:	35
Follow Update:	Not Reported
Area Lextent:	Not Reported
Annual Precipitation:	Not Reported
Affected Population:	Not Reported
Population Setting:	Not Reported
Ground Water Direction:	Not Reported
Ground Water Gradient:	Not Reported
Hydro Basin:	Not Reported
Drastic:	Not Reported
Geo Setting:	Not Reported
Ground Water Classification:	Not Reported
Receptor:	Not Reported
Ground Water Flow Direction:	Not Reported
Ground Water Depth:	Not Reported
Areas Of Concern:	Not Reported
Free Product Inches:	Not Reported
Fund Date:	Not Reported
Fund Planned:	No
Fund Obligated:	No
Fund Outlayed:	No
Fund Judgment:	No
Fund Recovered:	No
Cellar Borings:	False
Install Micro Wells:	False
Ground Water Sample:	False
Soil Sample:	False
Soil Gas:	False
Site Inspect:	False
Soil Excavate:	False
Geo Probe:	False
Geo Probe: Survey:	False False
Survey:	False
Survey: Potable Well Sample:	False False
Survey: Potable Well Sample: Sample MWS:	False False False
Survey: Potable Well Sample: Sample MWS: Ground Water Gauging:	False False False False
Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting:	False False False False False
Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active:	False False False False False False
Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action:	False False False False False False None
Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action: NOV Issued:	False False False False False None Not Reported
Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action: NOV Issued: NOV Due:	False False False False False None Not Reported Not Reported

RICHARD VESCE, 56 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

NOV Disc Date:	Not Reported
NOV Issued Date:	Not Reported
NOV Compliance Sched:	Not Reported
NOV Admin Order:	Not Reported
NOV Referred To Ag:	Not Reported
Stop All NOV Actions:	False
Release Invest Rpt:	False
DEP App Letter 1:	False
Correct Action Plan:	False
DEP App Letter 2:	False
Rem Sys Install:	False
Rem Sys Install Date:	Not Reported
Closure Date:	Not Reported
Rem Sys Monitoring Rpt:	False
Qrtly Gwater Mon Rpts:	False
Closure Req Rpt:	False
DEP Closure Letter:	False
Referred To:	Not Reported
No Wells:	Not Reported
Lph Wells:	Not Reported
User Stamp:	Not Reported
Date Stamp:	Not Reported
Correspondence:	Not Reported
Environmental Impact:	Not Reported
FollowUp:	Not Reported
GW Comments:	Not Reported
Location Desc:	Not Reported
NOV Comments:	Not Reported
Release Desc:	Not Reported
Running Comments:	1000, Heating Oil, PRIVATE, 1000 LUST : TANK & SOIL REMOVED
Work Performed:	Not Reported

▼ SPILLS: Oil & Chemical Spill Database

SPILLS:

Year of Database:	1999
Case Number:	9906385
Who Took Spill:	914
Assigned To:	0
Report Date:	09/20/1999
Report Time:	15:42:38
Date Release:	09/20/1999
Time Responded:	Not Reported
Reported By:	THOMAS RANKEL
Phone:	860 2950036
Representing:	Self
Terminated:	Not Reported
Recovd (Total):	0
Total (Water):	0
Facility Status:	Closed
Continuous Spill:	False

RICHARD VESCE, 56 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Released Substance:	#2 FUEL OIL
Qty:	0 (Gallons)
Emergency Measure:	1000 LUST : TANK & SOIL REMOVED
Water Body:	NONE
Discharger:	RICHARD VESCE
Telephone:	860 2670163
Responsible Party:	YES
RP Address 1:	SAA
RP City,St,Zip:	СТ
Historic:	False
Waterbody:	False
Time Stamp:	1999-09-20 15:46:49
Sr Inspector:	Porter, John
At Inspctor:	**NO RESPONSE
User Stamp:	Not Reported
Comments:	Not Reported
Action:	Removed Tank
Other Action:	Not Reported
Action:	Soil Removed
Other Action:	Not Reported
Agency ID:	Local Fire Marshal
Other Agency:	Not Reported
DEP Bureau:	Not Reported
DEP Agency:	Not Reported
Cause ID:	Inground Tank Failure
Other Cause:	Not Reported
Media ID:	Other
Other Media:	SOIL
Class ID:	Private
Other Class:	Not Reported
Release Type:	petroleum
Other Release:	Not Reported

NAME

AT&T EAST HAMPTON CENTRAL OFFICE (#7631) 115 MAIN STREET EAST HAMPTON, CT 064241105

EDR ID: S104563032

FINDINGS SDADB: Site Discovery and Assessment Database Page 229 All sites reported to Permitting, Enforcement, and Remediation Division where it is ...Full Description>> Page 231 LUST: Leaking Underground Storage Tank List Page 231 Leaking Underground Storage Tank Incident Reports. LUST records contain an inventor...Full Description>> Page 231 PROPERTY: Property Transfer Filings Page 234 A listing of sites that meet the definition of a hazardous waste establishment. The...Full Description>> Image 234

DETAILS

▼ S	DADB: Site Discovery and Assessment Data Site Discovery and Assessment:	base
	Facility ID:	4072
	Rem Master ID:	2241
	PTP ld:	2970
	WPC Number:	Not Reported
	Postal District:	Not Reported
	Latitude:	Not Reported
	Longitude:	Not Reported
	Lat/Long Determined By:	Not Reported
	Ground Water Quality Classification:	GA
	Surface Water Quality Classification:	Not Reported
	Waste Type:	Not Reported
	Disposal:	Not Reported
	Sample Data Available:	False
	Updated By:	Not Reported
	Update Program:	Not Reported
	Updated:	Not Reported
	Date Created:	Not Reported
	Duplicate:	False
	SDA Federal:	
	EPA CERCLIS Id:	Not Reported
	Number EPA RCRIS Id:	Not Reported
	Site on EPA's CERCLIS:	Not Reported
	Site Archived from CERCLIS:	Not Reported
	Archive Date:	Not Reported
	EPA's Removal at Site:	Not Reported
	Deferred to another EPA Program:	Not Reported
	EPA Env Priority Initiative Site:	Not Reported

51

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

Federal Facility:	Not Reported
Site on EPA's National	Not Reported
Priority List:	
Part of an NPL site:	Not Reported
RCRA Generator Status:	Not Reported
RCRA Permit Status:	Not Reported
SDA Referral:	
Referral Id:	4220
Source of referral:	PTP
Date Received:	11/4/1998
Staff Assigned:	Not Reported
Remediation Program:	PTP
Date dt_assigned:	Not Reported
Remediation Complete	11/4/1998
Approved DEP/Verified by LEP:	
Outcome:	PTP
SDA Remedial:	
Domodial Id:	Not Donortod
Remedial Id: PTP Id:	Not Reported
	Not Reported
Remediation Program: Remediation Program	Not Reported Not Reported
Entered:	Not Reported
Staff Assigned:	Not Reported
Remediation Program:	Not Reported
Date dt_assign:	Not Reported
Project Phase:	Not Reported
Order issued:	Not Reported
Order Number:	Not Reported
Date order issued:	Not Reported
Remedial Investigation Start:	Not Reported
Remedial Investigation Completed:	Not Reported
Remedial Design Start:	Not Reported
Remedial Design complet:	Not Reported
Remedial Action Start:	Not Reported
Remedial Action Completed:	Not Reported
Date Oper/ maintenance	Not Reported
Started:	
GW monitoring:	Not Reported
Remediation complete Approved DEP/Verified by	Not Reported
LEP:	
SDA Orders:	
Order Id:	Not Reported
Order Number:	Not Reported
Date order issued:	Not Reported
Staff Assigned:	Not Reported
Type of Order:	Not Reported
Order Respondent:	Not Reported

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

Admin Appeal Date:	Not Reported
Date of Admin Appeal Ruling:	Not Reported
Date of Admin Appeal Ruling:	Not Reported
Date of Final Order:	Not Reported
Date of Court Appeal:	Not Reported
Date of Court Ruling:	Not Reported
Date of Court Ruling:	Not Reported
Date Order Modified:	Not Reported
Date Referred to AG:	Not Reported
Judgement:	Not Reported
Date of AGR judgement:	Not Reported
Penalty assessed:	Not Reported
Order Complete:	Not Reported
In compliance:	Not Reported
Comments:	Not Reported

▼ LUST: Leaking Underground Storage Tank List

```
LUST:
```

LUST Id:	0
UST Facility Id:	10609
LUST Case Id:	59371
Lust Status:	Lust Completed
Processing Status:	Not Reported
EPA Reportable:	False
Motor Fuel:	False
Diesel:	True
Gasoline:	False
Other:	False
Other Release:	Not Reported
No Release:	False
Leak:	False
Tank:	True
Piping:	False
Overfill:	False
Removal:	True
Incident Date:	08/27/2009
Entry Date:	01/28/2010
Site Case Id:	0
UST Site Id:	0
Cost Recovery Spill Case #:	0
Old SITS Number:	0
Case Log Id:	0
Monthly Report Id:	0
UST Owner Id:	8261
LUST Owner Id:	Not Reported
UST Event Id:	0
Contact Info:	Not Reported
Contact EMail:	Not Reported
Site Contact City,St,Zip:	121, MA 030791953

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

2nd Contact:	Petra Construction Corp.
2nd Contact EMail:	Not Reported
2nd Contact Address:	Rebeschi Drive
2nd Contact City,St,Zip:	93, CT 06473
2nd Contact Address 2:	Not Reported
2nd Contact City 2:	New Haven
2nd Contact Phone Number:	2038656043
2nd Contact Fax Number:	2038656847
2nd Contact Type:	Not Reported
Facility City Num:	42
Site Contact:	John Ernst (Shaw Environmental, Inc.)
Site Contact Address:	11 Northeastern Boulevard
Site Contact Add 2:	Not Reported
Site Contact City 2:	Salem
Site Contact Phone:	8602807756
Site Contact Fax:	2034136356
Site Contact Type:	Petroleum Engineer
Department Contact 1:	Not Reported
Department Contact 2:	Not Reported
Referral Source:	Not Reported
Offsite Source:	False
Date Referred:	Not Reported
Emergency:	False
Private Heating Fuel:	False
Commercial Heating Fuel:	True
Commercial HF < 2100 Gal.:	False
Commercial HF > 2100 Gal.:	False
Commercial HF - Size Unk:	False
No LUST Site:	False
Cost Recvry Prgm Candidate:	False
OCSRD Complete:	False
Follow Up Flag:	False
Alternate Water Supply:	False
Relocation:	
Responsible Party:	False
Responsible EMail:	Not Reported
Resp Party Name:	AT&T Corporation
Resp Party Address:	308 S Akard Street
Resp Party City,St,Zip: Resp Party Town Number:	Dallas, TX 752025315 Not Reported
Resp Party Phone:	Not Reported 2144642477
Resp Party Fax:	
Resp Party Name 2:	Not Reported Rayshell Wamsley (Enviro, Health & Safety Manager)
Resp Party Address 2:	
Resp Party Phone 2:	Not Reported 8776482073
Investigator Id:	0
Follow Update:	Not Reported
Area Lextent:	Not Reported

6fce47c8-d564-4dcd-ac20-df0c927870c7

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

Annual Precipitation:	Not Reported
Affected Population:	Not Reported
Population Setting:	Not Reported
Ground Water Direction:	Not Reported
Ground Water Gradient:	Not Reported
Hydro Basin:	Not Reported
Drastic:	Not Reported
Geo Setting:	Not Reported
Ground Water Classification:	GA (may be impaired)
Receptor:	Not Reported
Ground Water Flow Direction:	Not Reported
Ground Water Depth:	Not Reported
Areas Of Concern:	Not Reported
Free Product Inches:	0
Fund Date:	Not Reported
Fund Planned:	No
Fund Obligated:	No
Fund Outlayed:	No
Fund Judgment:	No
Fund Recovered:	No
Cellar Borings:	False
Install Micro Wells:	False
Ground Water Sample:	False
Soil Sample:	True
Soil Gas:	False
Site Inspect:	False
Soil Excavate:	False
Geo Probe:	False
Survey:	False
Potable Well Sample:	False
Sample MWS:	False
Ground Water Gauging:	False
Soil Venting:	False
Active:	True
NOV Action:	None
NOV Issued:	Not Reported
NOV Due:	Not Reported
NOV Received:	Not Reported
NOV Closed:	Not Reported
NOV Disc Date:	Not Reported
NOV Issued Date:	Not Reported
NOV Compliance Sched:	Not Reported
NOV Admin Order:	Not Reported
NOV Referred To Ag:	Not Reported
Stop All NOV Actions:	False
Release Invest Rpt:	False
DEP App Letter 1:	False
Correct Action Plan:	False
DEP App Letter 2:	False

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

Rem Sys Install:	False
Rem Sys Install Date:	Not Reported
Closure Date:	Not Reported
Rem Sys Monitoring Rpt:	False
Qrtly Gwater Mon Rpts:	False
Closure Req Rpt:	False
DEP Closure Letter:	False
Referred To:	Not Reported
No Wells:	0
Lph Wells:	0
User Stamp:	Allison Forrest/AForrest
Date Stamp:	01/28/2010
Correspondence:	Not Reported
Environmental Impact:	Not Reported
FollowUp:	Not Reported
GW Comments:	Potable water wells are located within ~500 ft of sire (ECO)
Location Desc:	Not Reported
NOV Comments:	Not Reported
Release Desc:	Not Reported
Running Comments:	Not Reported
Work Performed:	Not Reported

▼ PROPERTY: Property Transfer Filings

CT Property:

Seller Name:	SNET
Buyer Name:	SBC Communications Inc.
Certifying Party:	SNET/Donald Shassian
Certifying Attention Person:	Not Reported
Title Of Certifying Person:	Not Reported
Certifying Person Address:	Not Reported
Certifying Person City,St,Zip:	Not Reported
Property Transfer Forms:	Form I (DEP-PERD-PTP-201) when no release of hazardous waste has occurred at the parcel being transferred.
Date Recieved:	11/04/1998
Ackn Date:	03/16/1999
Determination Date:	Not Reported
LEP Verified/DEP Approval Date:	Not Reported
Rem Id:	4035
Remediation Location Id:	1872
Date Entered:	Not Reported
Program:	Property Transfer Program
GAO Site:	False
Staff Full Name:	Not Reported
Super/Date:	Not Reported
Stage Of Project:	Not Reported
RP Level Of Activity:	Not Reported
RP Needed Level Of Activity:	Not Reported
Staff Level Of Activity:	Not Reported

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

	•
Staff Needed Level Of Activity:	Not Reported
Public Intrest:	Not Reported
PRP Cooperation:	Not Reported
Enforcement Status:	Not Reported
Level Of Complexity:	Not Reported
Complex Eng Or Sci:	False
Complex Due To Public Involvement:	False
Politically Complex:	False
Complex Enforcement:	False
Coordination With Other Bureaus:	False
EPA Involvement:	False
Staff Prefrence:	Not Reported
Readiness For Transfer:	Not Reported
Project Transfer Time:	Not Reported
Transfer Comments:	Not Reported
Staff As Of July 2000:	Not Reported
Initial Staff:	Not Reported
Type Of Transfer:	Not Reported
Salutation:	Not Reported
Relationship To Transfer:	transferor
Audit Date:	Not Reported
Verif Type:	Not Reported
Audit Outcome:	Not Reported
GW:	Not Reported
Basin:	Not Reported 200
1st Payment:	
Pay Tag1: 2nd Payment:	Not Reported Not Reported
Pay Tag2:	Not Reported
RTN:	Not Reported
Revised:	Not Reported
ECAF Received:	Not Reported
Old Determination Date:	Not Reported
Redetermination date:	Not Reported
Previous Determination:	Not Reported
Monitoringoption:	Not Reported
Postremedialmonitoring:	Not Reported
Schedule Of I/R:	Not Reported
Schedule Overdue:	Not Reported
Aprvl Sched:	Not Reported
Yr 1 Report:	Not Reported
Yr 2 Report:	Not Reported
Report Overdue:	Not Reported
Ext Aprvl Sched:	Not Reported
License #:	Not Reported
Project Phase:	Not Reported
PT Comments:	Not Reported
EPA Id Number:	Not Reported

AT&T EAST HAMPTON CENTRAL OFFICE (#7631), 115 MAIN STREET EAST HAMPTON, CT 064241105 (Continued)

GW Class:	Not Reported
SW Class:	Not Reported
AO/C0:	Not Reported
Water Lead(Y Or N):	Not Reported
Priority:	Not Reported
Project Status(A, I Or D):	Not Reported
Last Updated:	Not Reported
SR Comments:	Not Reported
Priority Or Work-Load:	Not Reported
Status:	Not Reported
Notes:	Not Reported
Special Project Name:	Not Reported
Special Project Comments:	Not Reported
DOT Project:	Not Reported
Pt Counter:	Not Reported
Project Complete:	False
Project Inactive:	False
Int Deposit #:	Not Reported
Deposit #:	Not Reported
Spill Case #:	Not Reported
Diversion Id:	Not Reported
Public Notice:	Not Reported
RAP Received:	Not Reported
RAP Approved:	Not Reported
Compliance Category:	Not Reported
Delete Record:	False
ECAF Reviewed By:	Not Reported
Not Locatable:	False
Primary Address:	True
AKA Site Name:	False
Primary Site Name:	True
AKA Site Address:	False
Lead:	Not Reported

NAME

G & S SERVICE INC. 100 MAIN ST EAST HAMPTON, CT 06424

EDR ID: S105441336

FINDINGS CPCS: Contaminated or Potentially Contaminated Sites Page 237 Contaminated or Potentially Contaminated Sites...Full Description>> Page 237 ENF: Enforcement Case Listing Page 237 The types of enforcement actions included are administrative consent orders, final u...Full Description>> Page 238 NPDES: Wastewater Permit Listing Page 238 A listing of permits issued by the DEP....Full Description>> Image: Contemport

DETAILS

CPCS: Contaminated or Potentially Contaminated Sites CPCS:

Site Type:	LUST
Lust Status code:	4
Lust Status:	Lust Completed (DEP's significant hazard definition)
PTP Form:	Not Reported
Program:	Not Reported
Comments:	Diesel Fuel, Commercial, 2k Diesel, Tank & Soil Removal4/29/99 Gw Sample Results Have Btex And Mtbe Below Ct-dep Standards.
Site Type Definition:	Leaking Underground Storage Tanks Completed

▼ ENF: Enforcement Case Listing

ENFORCEMENT:

Enforcement Action ID:	NOVUST-LF14-0001
Enforcement Type Code:	Notice Of Violation
Program Id:	Not Reported
Enforcement Action Date:	03/10/2014
Penalty Amount:	\$0.00
Sep Amt:	Not Reported
Bureau Name:	Materials Management & Compliance Assurance
Program:	Underground Storage Tank Enforcement
Status:	Active
Date of Discovery:	03/10/2014
Resolution Date:	Not Reported
Resolution Type:	None
Staff:	Wilde Philip
ENF Action Comment:	Cathodic protection systems require annual testing to ensure that a structure to soil test voltage reading of at least minus 0.85 volts is maintained Documentation showing that the monitors for tanks impressed current systems have been inspected every 30 days was not available Inventory volume measurements for inputs, withdrawals, and remaining amounts are not recorded each operating day and reconciled weekly as required The owner or operator has failed to perform, or has performed inadequately, the requisite monthly visual inspections at their UST facility or facilities The owner or operator has failed to submit the requisite annual UST facility notification and/or the requisite annual UST facility fee(s) The tanks cathodic protection documentation not maintained The tanks cathodic protection was not ested within six (6) months of in

52

G & S SERVICE INC., 100 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Number Violations:	20
Civil Penalty:	Not Reported
SEP Description:	Not Reported
Associated Els:	Underground Storage Tank Notification (42-559)
Client Affiliation Type:	Respondent
Affiliation Name:	LEROY GOFF
Affiliation Address Line1:	100 MAIN ST
Affiliation Address Line2:	Not Reported
Affiliation City/State/Zip:	EAST HAMPTON, CT 06424 1125
Contact Title:	Not Reported
Contact Name:	Not Reported
Contact EMail:	Not Reported

▼ NPDES: Wastewater Permit Listing

NPDES:

Town Id:	42
Company Name:	G & S SERVICE, INC.
Permit Number:	GGR001154
Permit Issued Date:	01/25/1999
Permit Expiration Date:	08/13/2006
Application Received Date:	01/22/1999
Affiliation Type:	Not Reported
Permit EI Type:	Not Reported
App Id:	Not Reported
Site Address Description:	Not Reported
Site Address Line 2:	Not Reported
Permit Description:	Not Reported
Status:	Not Reported
Affiliate Address Line 1:	Not Reported
Affiliate Address Line 2:	Not Reported
Affiliate City/State/Zip:	Not Reported
Contact Name:	Not Reported
Contact Title:	Not Reported
Contact EMail:	Not Reported
Town Id:	42
Company Name:	G & S SERVICE INC.
Permit Number:	GGR001154
Permit Issued Date:	01/25/1999
Permit Expiration Date:	08/13/2006
Application Received Date:	01/22/1999
Affiliation Type:	Not Reported
Permit EI Type:	Not Reported
App Id:	Not Reported
Site Address Description:	Not Reported
Site Address Line 2:	Not Reported
Permit Description:	Not Reported
Status:	Not Reported
Affiliate Address Line 1:	Not Reported
Affiliate Address Line 2:	Not Reported

G & S SERVICE INC., 100 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Affiliate City/State/Zip:	Not Reported
Contact Name:	Not Reported
Contact Title:	Not Reported
Contact EMail:	Not Reported

NAME

ROENIGK 26 BARTON HILL ROAD EAST HAMPTON, CT 06424

EDR ID: S105444418

FI	FINDINGS			
	CPCS: Contaminated or Potentially Contaminated Sites	Page 240		
	Contaminated or Potentially Contaminated SitesFull Description>>			
	LUST: Leaking Underground Storage Tank List	Page 240		
	Leaking Underground Storage Tank Incident Reports. LUST records contain an inventorFull Description>>			
	SPILLS: Oil & Chemical Spill Database	Page 243		
	Oil and Chemical Spill DataFull Description>>			

DETAILS

LUST:

CPCS: Contaminated or Potentially Contaminated Sites CPCS:

Site Type:	LUST
Lust Status code:	4
Lust Status:	Lust Completed (DEP's significant hazard definition)
PTP Form:	Not Reported
Program:	Not Reported
Comments:	1000, Heating Oil, Private, 20 Tons Of Soil Removed (1000 Gal Tank Removed)
Site Type Definition:	Leaking Underground Storage Tanks Completed

▼ LUST: Leaking Underground Storage Tank List

LUST Id:	8352
UST Facility Id:	Not Reported
LUST Case Id:	36403
Lust Status:	Lust Completed
Processing Status:	Not Reported
EPA Reportable:	False
Motor Fuel:	False
Diesel:	False
Gasoline:	False
Other:	False
Other Release:	Not Reported
No Release:	False
Leak:	False
Tank:	False
Piping:	False
Overfill:	False
Removal:	False
Incident Date:	06/16/1999
Entry Date:	Not Reported
Site Case Id:	9903897
UST Site Id:	Not Reported

53

ROENIGK, 26 BARTON HILL ROAD EAST HAMPTON, CT 06424 (Continued)

Cost Recovery Spill Case #:	Not Reported
Old SITS Number:	Not Reported
Case Log Id:	Not Reported
Monthly Report Id:	0
UST Owner Id:	Not Reported
LUST Owner Id:	Not Reported
UST Event Id:	8533
Contact Info:	Not Reported
Contact EMail:	Not Reported
Site Contact City, St, Zip:	UNKNOWN
2nd Contact:	Not Reported
2nd Contact EMail:	Not Reported
2nd Contact Address:	Not Reported
2nd Contact City,St,Zip:	UNKNOWN
2nd Contact Address 2:	Not Reported
2nd Contact City 2:	Not Reported
2nd Contact Phone	Not Reported
Number:	
2nd Contact Fax Number:	Not Reported
2nd Contact Type:	Not Reported
Facility City Num:	42
Site Contact:	Not Reported
Site Contact Address:	Not Reported
Site Contact Add 2:	Not Reported
Site Contact City 2:	Not Reported
Site Contact Phone:	Not Reported
Site Contact Fax:	Not Reported
Site Contact Type:	Not Reported
Department Contact 1:	Not Reported
Department Contact 2:	Not Reported
Referral Source:	Not Reported
Offsite Source:	False
Date Referred:	Not Reported
Emergency:	False
Private Heating Fuel:	True
Commercial Heating Fuel:	False
Commercial HF < 2100	False
Gal.:	
Commercial HF > 2100	False
Gal.:	
Commercial HF - Size Unk:	False
No LUST Site:	False
Cost Recvry Prgm Candidate:	False
OCSRD Complete:	True
Follow Up Flag:	False
Alternate Water Supply:	False
Relocation:	False
Responsible Party:	False
Responsible EMail:	Not Reported
Resp Party Name:	Not Reported
Resp Party Address:	Not Reported

ROENIGK, 26 BARTON HILL ROAD EAST HAMPTON, CT 06424 (Continued)

·	
Resp Party City, St, Zip:	Not Reported
Resp Party Town Number:	UNKNOWN
Resp Party Phone:	Not Reported
Resp Party Fax:	Not Reported
Resp Party Name 2:	Not Reported
Resp Party Address 2:	Not Reported
Resp Party Phone 2:	Not Reported
Investigator Id:	35
Follow Update:	Not Reported
Area Lextent:	Not Reported
Annual Precipitation:	Not Reported
Affected Population:	Not Reported
Population Setting:	Not Reported
Ground Water Direction:	Not Reported
Ground Water Gradient:	Not Reported
Hydro Basin:	Not Reported
Drastic:	Not Reported
Geo Setting:	Not Reported
Ground Water Classification:	Not Reported
Receptor:	Not Reported
Ground Water Flow Direction:	Not Reported
Ground Water Depth:	Not Reported
Areas Of Concern:	Not Reported
Free Product Inches:	Not Reported
Fund Date:	Not Reported
Fund Planned:	No
Fund Obligated:	No
Fund Outlayed:	No
Fund Judgment:	No
Fund Recovered:	No
Cellar Borings:	False
Install Micro Wells:	False
Ground Water Sample:	False
Soil Sample:	False
Soil Gas:	False
Site Inspect:	False
Soil Excavate:	False
Geo Probe:	False
Survey:	False
Potable Well Sample:	False
Sample MWS:	False
Ground Water Gauging:	False
Soil Venting:	False
Active:	False
NOV Action:	None
NOV Issued:	Not Reported
NOV Due:	Not Reported
NOV Received:	Not Reported
NOV Closed:	Not Reported

ROENIGK, 26 BARTON HILL ROAD EAST HAMPTON, CT 06424 (Continued)

NOV Disc Date:	Not Reported
NOV Issued Date:	Not Reported
NOV Compliance Sched:	Not Reported
NOV Admin Order:	Not Reported
NOV Referred To Ag:	Not Reported
Stop All NOV Actions:	False
Release Invest Rpt:	False
DEP App Letter 1:	False
Correct Action Plan:	False
DEP App Letter 2:	False
Rem Sys Install:	False
Rem Sys Install Date:	Not Reported
Closure Date:	Not Reported
Rem Sys Monitoring Rpt:	False
Qrtly Gwater Mon Rpts:	False
Closure Req Rpt:	False
DEP Closure Letter:	False
Referred To:	Not Reported
No Wells:	Not Reported
Lph Wells:	Not Reported
User Stamp:	Not Reported
Date Stamp:	Not Reported
Correspondence:	Not Reported
Environmental Impact:	Not Reported
FollowUp:	Not Reported
GW Comments:	Not Reported
Location Desc:	Not Reported
NOV Comments:	Not Reported
Release Desc:	Not Reported
Running Comments:	1000, Heating Oil, PRIVATE, 20 TONS OF SOIL REMOVED (1000 GAL TANK REMOVED)
Work Performed:	Not Reported

▼ SPILLS: Oil & Chemical Spill Database

SPILLS:	
Year of Database:	1999
Case Number:	9903897
Who Took Spill:	934
Assigned To:	0
Report Date:	06/16/1999
Report Time:	10:30:00
Date Release:	06/16/1999
Time Responded:	Not Reported
Reported By:	JOANN
Phone:	860 6516545
Representing:	UNDERGROUND SYSTEMS INC.
Terminated:	YES
Recovd (Total):	0
Total (Water):	0
Facility Status:	closed

ROENIGK, 26 BARTON HILL ROAD EAST HAMPTON, CT 06424 (Continued)

Continuous Spill:	False
Released Substance:	#2 FUEL OIL
Qty:	0 (Gallons)
Emergency Measure:	20 TONS OF SOIL REMOVED (1000 GAL TANK REMOVED)
Water Body:	Not Reported
Discharger:	ROENIGK
Telephone:	860 2678682
Responsible Party:	YES
RP Address 1:	26 BARTON HILL ROAD
RP City,St,Zip:	EAST HAMPTON, CT 06424
Historic:	False
Waterbody:	False
Time Stamp:	1999-06-17 13:16:33
Sr Inspector:	Williamson, Matt
At Inspctor:	**NO RESPONSE
User Stamp:	Not Reported
Comments:	Not Reported
Action:	Removed Tank
Other Action:	Not Reported
Cause ID:	Inground Tank Failure
Other Cause:	Not Reported
Media ID:	Ground Surface
Other Media:	Not Reported
Class ID:	Private
Other Class:	Not Reported
Release Type:	petroleum
Other Release:	Not Reported

NAME

EAST HAMPTON CONGREGATIONAL CHURCH 59 MAIN STREET EAST HAMPTON, CT 06424

EDR ID: S105457878

FINDINGS

CPCS: Contaminated or Potentially Contaminated Sites	. Page 245
Contaminated or Potentially Contaminated SitesFull Description>>	-
	. Page 245
Leaking Underground Storage Tank List	

DETAILS

▼ CPCS: Contaminated or Potentially Contaminated Sites

Site Type:	LUST
Lust Status code:	3
Lust Status:	Cleanup Initiated
PTP Form:	Not Reported
Program:	Not Reported
Comments:	Not Reported
Site Type Definition:	Leaking Underground Storage Tanks Rem. Started

▼ LUST: Leaking Underground Storage Tank List

LUST:

LUST Id:	3529
UST Facility Id:	Not Reported
LUST Case Id:	31555
Lust Status:	Cleanup Initiated
Processing Status:	Not Reported
EPA Reportable:	False
Motor Fuel:	False
Diesel:	False
Gasoline:	False
Other:	False
Other Release:	Not Reported
No Release:	False
Leak:	False
Tank:	False
Piping:	False
Overfill:	False
Removal:	False
Incident Date:	09/24/1998
Entry Date:	Not Reported
Site Case Id:	9806495
UST Site Id:	Not Reported
Cost Recovery Spill Case #:	Not Reported
Old SITS Number:	Not Reported

EAST HAMPTON CONGREGATIONAL CHURCH, 59 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Case Log Id:	Not Reported
Monthly Report Id:	0
UST Owner Id:	Not Reported
LUST Owner Id:	Not Reported
UST Event Id:	3588
Contact Info:	Not Reported
Contact EMail:	Not Reported
Site Contact City,St,Zip:	UNKNOWN, UNKNOWN
2nd Contact:	Not Reported
2nd Contact EMail:	Not Reported
2nd Contact Address:	Not Reported
2nd Contact City,St,Zip:	UNKNOWN
2nd Contact Address 2:	Not Reported
2nd Contact City 2:	Not Reported
2nd Contact Phone Number:	Not Reported
2nd Contact Fax Number:	Not Reported
2nd Contact Type:	Not Reported
Facility City Num:	42
Site Contact:	John Podgorski
Site Contact Address:	Valley Oil Co.
Site Contact Add 2:	Not Reported
Site Contact City 2:	ZipCode Unknown
Site Contact Phone:	(860) 342-3500
Site Contact Fax:	Not Reported
Site Contact Type:	Not Reported
Department Contact 1:	Not Reported
Department Contact 2:	Not Reported
Referral Source:	Not Reported
Offsite Source:	False
Date Referred:	Not Reported
Emergency:	False
Private Heating Fuel:	False
Commercial Heating Fuel:	True
Commercial HF < 2100 Gal.:	False
Commercial HF > 2100 Gal.:	False
Commercial HF - Size Unk:	True
No LUST Site:	False
Cost Recvry Prgm Candidate:	False
OCSRD Complete:	True
Follow Up Flag:	False
Alternate Water Supply:	False
Relocation:	False
Responsible Party:	False
Responsible EMail:	Not Reported
Resp Party Name:	Not Reported
Resp Party Address:	Not Reported
Resp Party City,St,Zip:	Not Reported
Resp Party Town Number:	UNKNOWN

EAST HAMPTON CONGREGATIONAL CHURCH, 59 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Resp Party Phone:	Not Reported
Resp Party Fax:	Not Reported
Resp Party Name 2:	Not Reported
Resp Party Address 2:	Not Reported
Resp Party Phone 2:	Not Reported
Investigator Id:	29
Follow Update:	Not Reported
Area Lextent:	Not Reported
Annual Precipitation:	Not Reported
Affected Population:	Not Reported
Population Setting:	Not Reported
Ground Water Direction:	Not Reported
Ground Water Gradient:	Not Reported
Hydro Basin:	Not Reported
Drastic:	Not Reported
Geo Setting:	Not Reported
Ground Water Classification:	Not Reported
Receptor:	Not Reported
Ground Water Flow Direction:	Not Reported
Ground Water Depth:	Not Reported
Areas Of Concern:	Not Reported
Free Product Inches:	Not Reported
Fund Date:	Not Reported
Fund Planned:	No
Fund Obligated:	No
Fund Outlayed:	No
Fund Judgment:	No
Fund Recovered:	No
Cellar Borings:	False
Install Micro Wells:	False
Ground Water Sample:	False
Ground Water Sample: Soil Sample:	False False
1	
Soil Sample:	False
Soil Sample: Soil Gas:	False False
Soil Sample: Soil Gas: Site Inspect:	False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe:	False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey:	False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe:	False False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS:	False False False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging:	False False False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS:	False False False False False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting:	False False False False False False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active:	False False False False False False False False False False False None
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action:	False False False False False False False False False False
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action: NOV Issued:	False False False False False False False False False False False None Not Reported
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action: NOV Issued: NOV Due:	False False False False False False False False False False False None Not Reported Not Reported
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action: NOV Issued: NOV Issued: NOV Due: NOV Received:	False False False False False False False False False False False None Not Reported Not Reported Not Reported
Soil Sample: Soil Gas: Site Inspect: Soil Excavate: Geo Probe: Survey: Potable Well Sample: Sample MWS: Ground Water Gauging: Soil Venting: Active: NOV Action: NOV Action: NOV Issued: NOV Due: NOV Received: NOV Closed:	False False False False False False False False False False False None Not Reported Not Reported Not Reported Not Reported

EAST HAMPTON CONGREGATIONAL CHURCH, 59 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

NOV Compliance Sched:	Not Reported
NOV Admin Order:	Not Reported
NOV Referred To Ag:	Not Reported
Stop All NOV Actions:	False
Release Invest Rpt:	False
DEP App Letter 1:	False
Correct Action Plan:	False
DEP App Letter 2:	False
Rem Sys Install:	False
Rem Sys Install Date:	Not Reported
Closure Date:	Not Reported
Rem Sys Monitoring Rpt:	False
Qrtly Gwater Mon Rpts:	False
Closure Req Rpt:	False
DEP Closure Letter:	False
Referred To:	Not Reported
No Wells:	Not Reported
Lph Wells:	Not Reported
User Stamp:	Not Reported
Date Stamp:	Not Reported
Correspondence:	Not Reported
Environmental Impact:	Not Reported
FollowUp:	Not Reported
GW Comments:	Not Reported
Location Desc:	Not Reported
NOV Comments:	Not Reported
Release Desc:	Not Reported
Running Comments:	Not Reported
Work Performed:	Not Reported

NAME

G & S SERVICE STATION 100 MAIN STREET EAST HAMPTON, CT 06424

EDR ID: S108301211

FINDINGS

LUST: Leaking Underground Storage Tank List Leaking Underground Storage Tank Incident Reports. LUST records contain an inventorFull Description>>	F	Page 249
SPILLS: Oil & Chemical Spill Database Oil and Chemical Spill DataFull Description>>		Page 252

DETAILS

LUST: Leaking Underground Storage Tank List LUST: LUST Id: 7222 UST Facility Id: 559 LUST Case Id: 35297 Lust Status: Lust Completed Processing Status: Not Reported

Lust Status:	Lust Completed
Processing Status:	Not Reported
EPA Reportable:	False
Motor Fuel:	True
Diesel:	True
Gasoline:	False
Other:	False
Other Release:	Not Reported
No Release:	False
Leak:	False
Tank:	False
Piping:	False
Overfill:	False
Removal:	False
Incident Date:	01/05/1999
Entry Date:	Not Reported
Site Case Id:	9900142
UST Site Id:	Not Reported
Cost Recovery Spill Case #:	Not Reported
Old SITS Number:	Not Reported
Case Log Id:	Not Reported
Monthly Report Id:	0
UST Owner Id:	4018
LUST Owner Id:	Not Reported
UST Event Id:	7338
Contact Info:	Not Reported
Contact EMail:	Not Reported
Site Contact City,St,Zip:	UNKNOWN
2nd Contact:	Not Reported
2nd Contact EMail:	Not Reported

55

G & S SERVICE STATION, 100 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

2nd Contact Address:	Not Reported
2nd Contact City,St,Zip:	UNKNOWN
2nd Contact Address 2:	Not Reported
2nd Contact City 2:	Not Reported
2nd Contact Phone Number:	Not Reported
2nd Contact Fax Number:	Not Reported
2nd Contact Type:	Not Reported
Facility City Num:	42
Site Contact:	Not Reported
Site Contact Address:	Not Reported
Site Contact Add 2:	Not Reported
Site Contact City 2:	Not Reported
Site Contact Phone:	Not Reported
Site Contact Fax:	Not Reported
Site Contact Type:	Not Reported
Department Contact 1:	Not Reported
Department Contact 2:	Not Reported
Referral Source:	Not Reported
Offsite Source:	False
Date Referred:	Not Reported
Emergency:	False
Private Heating Fuel:	False
Commercial Heating Fuel:	False
Commercial HF < 2100 Gal.:	False
Commercial HF > 2100	False
Gal.:	
	False
Gal.:	False False
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate:	
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm	False
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate:	False False
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete:	False False True
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag:	False False True False
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party:	False False True False False
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible EMail:	False False True False False False False Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible EMail: Resp Party Name:	False False True False False False False Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible EMail: Resp Party Name: Resp Party Address:	False False True False False False Not Reported Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible EMail: Resp Party Name: Resp Party Address: Resp Party City,St,Zip:	False False True False False False Not Reported Not Reported Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible EMail: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number:	False False True False False False Not Reported Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible EMail: Resp Party Name: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number: Resp Party Phone:	False False True False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible Party: Resp Party Name: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party City,St,Zip: Resp Party Phone: Resp Party Fax:	False False True False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible Party: Resp Party Name: Resp Party Name: Resp Party City,St,Zip: Resp Party City,St,Zip: Resp Party Phone: Resp Party Fax: Resp Party Name 2:	False False True False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible Party: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number: Resp Party Fax: Resp Party Fax: Resp Party Name 2: Resp Party Address 2:	False False True False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible Party: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number: Resp Party Phone: Resp Party Fax: Resp Party Phone 2:	False False True False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported Not Reported Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible PMail: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number: Resp Party Phone: Resp Party Fax: Resp Party Phone 2: Resp Party Phone 2: Investigator Id:	False False False False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible PMail: Resp Party Name: Resp Party Name: Resp Party Address: Resp Party Town Number: Resp Party Phone: Resp Party Fax: Resp Party Phone: Resp Party Address 2: Resp Party Phone 2: Investigator Id: Follow Update:	False False False False False False False Not Reported Not Reported Not Reported UNKNOWN Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible PMail: Resp Party Name: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number: Resp Party Phone: Resp Party Phone: Resp Party Phone: Resp Party Address 2: Resp Party Address 2: Resp Party Phone 2: Investigator Id: Follow Update: Area Lextent:	False False True False False False False Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible Party: Resp Party Name: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Fax: Resp Party Fax: Resp Party Fax: Resp Party Phone: Resp Party Address 2: Resp Party Phone 2: Investigator Id: Follow Update: Area Lextent: Annual Precipitation:	False False True False False False False False Not Reported Not Reported
Gal.: Commercial HF - Size Unk: No LUST Site: Cost Recvry Prgm Candidate: OCSRD Complete: Follow Up Flag: Alternate Water Supply: Relocation: Responsible Party: Responsible PMail: Resp Party Name: Resp Party Name: Resp Party Address: Resp Party City,St,Zip: Resp Party Town Number: Resp Party Phone: Resp Party Phone: Resp Party Phone: Resp Party Address 2: Resp Party Address 2: Resp Party Phone 2: Investigator Id: Follow Update: Area Lextent:	False False True False False False False Not Reported Not Reported

G & S SERVICE STATION, 100 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

···· · · · · · · · · · · · · · · · · ·	-
Population Setting:	Not Reported
Ground Water Direction:	Not Reported
Ground Water Gradient:	Not Reported
Hydro Basin:	Not Reported
Drastic:	Not Reported
Geo Setting:	Not Reported
Ground Water Classification:	Not Reported
Receptor:	Not Reported
Ground Water Flow Direction:	Not Reported
Ground Water Depth:	Not Reported
Areas Of Concern:	Not Reported
Free Product Inches:	Not Reported
Fund Date:	Not Reported
Fund Planned:	No
Fund Obligated:	No
Fund Outlayed:	No
Fund Judgment:	No
Fund Recovered:	No
Cellar Borings:	False
Install Micro Wells:	False
Ground Water Sample:	False
Soil Sample:	False
Soil Gas:	False
Site Inspect:	False
Soil Excavate:	False
Geo Probe:	False
Survey:	False
Potable Well Sample:	False
Sample MWS:	False
Ground Water Gauging:	False
Soil Venting:	False
Active:	False
NOV Action:	None
NOV Issued:	Not Reported
NOV Due:	Not Reported
NOV Received:	Not Reported
NOV Closed:	Not Reported
NOV Disc Date:	Not Reported
NOV Issued Date:	Not Reported
NOV Compliance Sched:	Not Reported
NOV Admin Order:	Not Reported
NOV Referred To Ag:	Not Reported
Stop All NOV Actions:	False
Release Invest Rpt:	False
DEP App Letter 1:	False
Correct Action Plan:	False
DEP App Letter 2:	False
Rem Sys Install:	False
Rem Sys Install Date:	Not Reported

G & S SERVICE STATION, 100 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Closure Date:	Not Reported
Rem Sys Monitoring Rpt:	False
Qrtly Gwater Mon Rpts:	False
Closure Req Rpt:	False
DEP Closure Letter:	False
Referred To:	Not Reported
No Wells:	Not Reported
Lph Wells:	Not Reported
User Stamp:	Not Reported
Date Stamp:	Not Reported
Correspondence:	Action: General Correspondence Issued:9/21/1999 Received:9/21/1999In
	response to the questionnaire, G&S Service Station sent in GW sample
	results.
Environmental Impact:	Not Reported
FollowUp:	Not Reported
GW Comments:	Not Reported
Location Desc:	Not Reported
NOV Comments:	Not Reported
Release Desc:	Not Reported
Running Comments:	DIESEL FUEL, Commercial, 2K DIESEL, TANK & SOIL REMOVAL4/29/99 GW
	sample results have BTEX and MTBE below CT-DEP standards.
Work Performed:	Not Reported

▼ SPILLS: Oil & Chemical Spill Database

SPILLS:	
---------	--

Year of Database:	1998
Case Number:	9805407
Who Took Spill:	207
Assigned To:	0
Report Date:	08/13/1998
Report Time:	16:38:01
Date Release:	08/13/1998
Time Responded:	16:34:00
Reported By:	jerry cloutier
Phone:	860 5373415
Representing:	colchester dispatch
Terminated:	YES
Recovd (Total):	0
Total (Water):	0
Facility Status:	closed
Continuous Spill:	False
Released Substance:	DIESEL FUEL
Qty:	100 (Gallons)
Emergency Measure:	SPILL DISSIPATED BETWEEN OLD LYME AND EAST HAMPTON
Water Body:	Not Reported
Discharger:	g n s gas
Telephone:	Not Reported
Responsible Party:	YES
RP Address 1:	100 main street
RP City,St,Zip:	СТ

G & S SERVICE STATION, 100 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

Historic:	False
Waterbody:	False
Time Stamp:	1998-08-31 13:30:19
Sr Inspector:	CHEMACKI,TODD
At Inspector:	**NO RESPONSE
User Stamp:	Not Reported
Comments:	Not Reported
Action:	Dissipated
Other Action:	Not Reported
Agency ID:	Local Police
Other Agency:	Not Reported
DEP Bureau:	Not Reported
DEP Agency:	Not Reported
Agency ID:	DEP Dispatch
Other Agency:	Not Reported
DEP Bureau:	Not Reported
DEP Agency:	Not Reported
Agency ID:	
Other Agency:	Not Reported
DEP Bureau:	Not Reported
DEP Agency:	Not Reported
Cause ID:	Fuel Tank Failure
Other Cause:	Not Reported
Media ID:	Ground Surface
Other Media:	Not Reported
Release Type:	petroleum
Other Release:	Not Reported
other release.	NorReported
Year of Database:	1999
Case Number:	9900142
Who Took Spill:	914
Assigned To:	933
Report Date:	01/05/1999
Report Time:	15:22:41
Date Release:	01/05/1999
Time Responded:	Not Reported
Reported By:	MIKE ORSINI
Phone:	203 6302772
Representing:	UNDERGROUND TANK SYSTEMS & PIPING
Terminated:	NO
Recovd (Total):	0
Total (Water):	0
Facility Status:	Closed
Continuous Spill:	False
Released Substance:	DIESEL FUEL
Qty:	0 (Gallons)
Emergency Measure:	2K DIESEL, TANK & SOIL REMOVAL
Water Body:	GROUND WATER
Discharger:	G & S SERVICE STATION
Telephone:	860 2674284
Responsible Party:	YES

G & S SERVICE STATION, 100 MAIN STREET EAST HAMPTON, CT 06424 (Continued)

RP Address 1:	100 MAIN ST
RP City,St,Zip:	EAST HAMPTON, CT 06424
Historic:	False
Waterbody:	False
Time Stamp:	1999-05-26 12:35:04
Sr Inspector:	Porter, John
At Inspctor:	Santacroce, Jim
User Stamp:	Not Reported
Comments:	Not Reported
Action:	Removed Tank
Other Action:	Not Reported
Action:	Soil Removed
Other Action:	Not Reported
Agency ID:	Local Fire Marshal
Other Agency:	Not Reported
DEP Bureau:	Not Reported
DEP Agency:	Not Reported
Cause ID:	Inground Tank Failure
Other Cause:	Not Reported
Media ID:	Other
Other Media:	SOIL
Class ID:	Commercial
Other Class:	Not Reported
Release Type:	petroleum
Other Release:	Not Reported
Waterbody:	Groundwater
Other Wtrbody:	Not Reported

NAME

EAST HAMPTON CENTER VILLAGE WATER SYSTEM 7 SUMMIT ST EAST HAMPTON, CT 06424 EDR ID: \$108306501

FINDINGS

NPDES: Wastewater Permit Listing ______ Page 255 A listing of permits issued by the DEP....Full Description>> _____

DETAILS

▼ NPDES: Wastewater Permit Listing

NPDES:

Town Id:	Not Reported
Company Name:	Not Reported
	•
Permit Number:	GWT000242
Permit Issued Date:	09/07/2010
Permit Expiration Date:	03/29/2016
Application Received Date:	Not Reported
Affiliation Type:	Permittee
Permit EI Type:	Water Treatment Wastewater-GP
App Id:	201005414
Site Address Description:	Not Reported
Site Address Line 2:	Not Reported
Permit Description:	East Hampton Center Village Water System 7 Summit St. (East Hampton, Ct. 06424)
Status:	Active
Affiliate Address Line 1:	PO BOX 218
Affiliate Address Line 2:	WATER POLLUTION CONTROL AUTHORITY
Affiliate City/State/Zip:	EAST HAMPTON, CT 06424-0218
Contact Name:	VINCENT F. SUSCO, JR
Contact Title:	PUBLIC UTILITIES ADMIN
Contact EMail:	vsuco@sbcglobal.net

 \equiv

56

L & W INDUSTRIES INC 87 (REAR) MAIN ST EAST HAMPTON, CT 06424 EDR ID: \$109725180

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 256 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Year:	1987
Manifest Id:	MAC050889
EPA ID:	CTD004533543
TSDF EPA ID:	CTD093616613
TSDF Name:	ENVIRITE CORP
TSDF Address:	OLD WATERBURY RD
TSDF City,St,Zip:	THOMASTON, CT 06787
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	01/27/1987
Transporter EPA ID:	CTD000636498
Transporter Name:	TRI-S INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	CT
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032679858
Generator Mailing Addr:	87 (REAR) MAIN ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	No
Date Shipped:	01/27/1987
Date Received:	Not Reported
Last modified date:	04/27/2004
Last modified by:	IG

L & W INDUSTRIES INC, 87 (REAR) MAIN ST EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

Comments.	Nor Reported
Waste:	
Year:	1987
Manifest Id:	MAC050889
Waste Occurence:	1
UNNA:	9189
Hazard Class:	ORM-E
US Dot Description:	HAZARDOUS WASTE LIQUID, NOS
No of Containers:	001
Container Type:	TT
Quantity:	4286
Weight/Volume:	G
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last	2004-04-27 00:00:00
Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	F006
Recycled Waste?:	False
Date Record Was Last	2004-04-27 00:00:00
Modified:	
Detail:	
Year:	1986
Manifest Id:	MAC049722
EPA ID:	CTD004533543
TSDF EPA ID:	CTD093616613
TSDF Name:	ENVIRITE CORP
TSDF Address:	OLD WATERBURY RD
TSDF City,St,Zip:	THOMASTON, CT 06787
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	10/14/1986
Transporter EPA ID:	CTD000636498
Transporter Name:	TRI-S INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	CT
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	
Trans 2 City,St,Zip:	Not Reported CT
• •	
Trans 2 Country:	USA Not Reported
Trans 2 Phone:	Not Reported
Generator Phone:	2032679858
Generator Mailing Addr:	87 (REAR) MAIN ST

L & W INDUSTRIES INC, 87 (REAR) MAIN ST EAST HAMPTON, CT 06424 (Continued)

Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	No
Date Shipped:	10/14/1986
Date Received:	10/15/1986
Last modified date:	04/27/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1986
Manifest Id:	MAC049722
Waste Occurence:	1
UNNA:	9189
Hazard Class:	ORM-E
US Dot Description:	HAZARDOUS WASTE LIQUID, NOS
No of Containers:	001
Container Type:	TT
Quantity:	4600
Weight/Volume:	G
Additional Description:	Not Reported
Handling Code:	T01
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	F006
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00

NAME

PRESSURE PAK CONTAINER CO INC 25 SKINNER ST EAST HAMPTON, CT 06424 EDR ID: \$109727546

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 259 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	1988
Manifest Id:	CTC0148918
EPA ID:	CTD055509772
TSDF EPA ID:	MAD019371079
TSDF Name:	GENERAL CHEMICAL CORP
TSDF Address:	133 LELAND ST
TSDF City,St,Zip:	FRAMINGHAM, MA 01701
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	06/13/1988
Transporter EPA ID:	CTD055310759
Transporter Name:	HUBBARD HALL INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	06/15/1988
Trans 2 EPA ID:	MAD019371079
Trans 2 Name:	GENERAL CHEMICAL CORPORATION,
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032678468
Generator Mailing Addr:	25 SKINNER ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	No
Discrepancies:	No
Date Shipped:	06/13/1988
Date Received:	06/16/1988
Last modified date:	04/27/2004
Last modified by:	IG

58

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

Waste:

Year:	1988
Manifest Id:	CTC0148918
Waste Occurence:	1
UNNA:	2831
Hazard Class:	ORM-A
US Dot Description:	WASTE 111 TRICHLOROETHANE
No of Containers:	008
Container Type:	DM
Quantity:	440
Weight/Volume:	G
Additional Description:	Ν
Handling Code:	Т63
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	F001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00

Year:	1987
Manifest Id:	MAC229866
EPA ID:	CTD055509772
TSDF EPA ID:	MAD019371079
TSDF Name:	GENERAL CHEMICAL CORP
TSDF Address:	133 LELAND ST
TSDF City,St,Zip:	FRAMINGHAM, MA 01701
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	07/07/1987
Transporter EPA ID:	CTD055310759
Transporter Name:	HUBBARD HALL INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	07/08/1987
Trans 2 EPA ID:	MAD019371079
Trans 2 Name:	GENERAL CHEMICAL CORPORATION,
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032678468
Generator Mailing Addr:	25 SKINNER ST

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	No
Discrepancies:	No
Date Shipped:	07/07/1987
Date Received:	07/09/1987
Last modified date:	04/27/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1987
Manifest Id:	MAC229866
Waste Occurence:	1
UNNA:	2831
Hazard Class:	ORM-A
US Dot Description:	WASTE III TRICHLOROETHANE MIXED W/OIL
No of Containers:	003
Container Type:	DM
Quantity:	165
Weight/Volume:	G
Additional Description:	Y
Handling Code:	T63
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	F001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00
Moumeu.	
Detail:	
Year:	1986
Manifest Id:	NYA3444175
EPA ID:	CTD055509772
TSDF EPA ID:	NYD049836679
TSDF Name:	SCA CHEMICAL SEVICES INC
TSDF Address:	1550 BALMER RD
TSDF City,St,Zip:	MODEL CITY, NY 14107
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	04/08/1986
Transporter EPA ID:	CTD000636498
Transporter Name:	TRI-S INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032678468
Generator Mailing Addr:	25 SKINNER ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	No
Date Shipped:	04/08/1986
Date Received:	Not Reported
Last modified date:	04/27/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1986
Manifest Id:	NYA3444175
Waste Occurence:	1
UNNA:	9189
Hazard Class:	ORM-E
US Dot Description:	HAZARDOUS WASTE, SOLID, NOS
No of Containers:	009
Container Type:	DM
Quantity:	2700
Weight/Volume:	Ρ
Additional Description:	Y
Handling Code:	L
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D008
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00
Detail:	
Year:	1985

Year:	1985
Manifest Id:	NYA1025046
EPA ID:	CTD055509772
TSDF EPA ID:	NYD049836679
TSDF Name:	SCA CHEMICAL SEVICES INC
TSDF Address:	1550 BALMER RD
TSDF City,St,Zip:	MODEL CITY, NY 14107

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

TSDF Country:USATSDF Telephone:Not ReportedTransport Date:01/14/1985Transporter EPA ID:CTD000636498Transporter Address:Not ReportedTransporter Address:Not ReportedTransporter Phone:USATrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Pame:Not ReportedTrans 2 Pame:Not ReportedTrans 2 Pame:Not ReportedTrans 2 Pame:Not ReportedTrans 2 Phone:Not ReportedTrans 2 Phone:Not ReportedTrans 2 Phone:Not ReportedGenerator Mailing Address:Not ReportedGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NotNoNeportedDiscrepancies:NotNot Reported0/14/1985Date Shipped:0/1/14/1985Date Scoprence:1UNNA:9/189 <th></th> <th></th>		
Transport01/14/1985Transporter PAID:CTD000636498Transporter Name:TRI-SINC.Transporter Citly, SLZp:CTTransporter Country:USATransporter Phone:Not ReportedTransporter S2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 PAID:Not ReportedTrans 2 Anne:Not ReportedTrans 2 Address:Not ReportedTrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Mailing Addr:2032678468Generator Mailing Oddr2032678468Generator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046WasteValarDADUS WASTE SOLID NOSNo dottaries:GelDot Description:HAZARDOUS WASTE SOLID NOSNo dottaries:Off-0No dottaries:GelUNNA:9189Hazard Class:ORM-EUS Dot Description:YH	TSDF Country:	USA
Transporter EPA ID:CTD000636498Transporter Name:TRI-S INC.Transporter Address:Not ReportedTransporter City,SLZip:CTTransporter Phone:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 EPA ID:Not ReportedTrans 2 EVA ID:Not ReportedTrans 2 Address:Not ReportedTrans 2 Address:Not ReportedTrans 2 Address:Not ReportedGenerator Phone:2032678468Generator Phone:2032678468Generator Mailing06424City/State/Zip:Generator MailingGenerator Mailing06424City/State/Zip:USASpecial Handling:Not ReportedDiscrepancies:NoDate Received:01/14/1985Date Received:01/14/1985Last modified by:IGComments:Not ReportedWasteVaste:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:OFM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of ContainerType:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00ModifiedFilseDate Record Was L	TSDF Telephone:	Not Reported
Transporter Name:TRI-S INC.Transporter Address:Not ReportedTransporter City,St.Zip:CTTransporter Phone:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Name:Not ReportedTrans 2 Adress:Not ReportedTrans 2 City,St.Zip:CTTrans 2 Country:USATrans 2 Country:USATrans 2 Country:USATrans 2 Country:USATrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:203678468Generator Mailing06424City/Statz/p:CTGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified date:04/27/2004Last modified date:0FM-EUNNA:9189Hazard Class:ORM-EUS Do Description:HAZARDOUS WASTE SOLID NOSNo of Containers:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:FEPO Was Last ModifiedIGRecord Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00	Transport Date:	01/14/1985
Transporter Address:Not ReportedTransporter City,St,Zp:CTTransporter Phone:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Address:Not ReportedTrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/14/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste Courence:1UNNA:9189Hazard Class:OfNo I Date Scription:HAZARDOUS WASTE SOLID NOSNo Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGEFA Waste Code:D008Record Was Last2004-	Transporter EPA ID:	CTD000636498
Transporter City, St, Zip:CTTransporter Country:USATrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Adress:Not ReportedTrans 2 Adress:Not ReportedTrans 2 Adress:Not ReportedTrans 2 City, St, Zip:CTTrans 2 Country:USATrans 2 Country:USATrans 2 Country:USATrans 2 Country:USATrans 2 Phone:2032678468Generator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Mainfest Id:NYA1025046WasteOthalescolus WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGEFA Nusste Code:D008Record Waste?FalseDate Record Waste?:FalseDate Record Waste?:FalseDate Record Waste?:False	Transporter Name:	TRI-S INC.
Transporter Country:USATransporter Phone:Not ReportedTrans 2 Date:Not ReportedTrans 2 EPA ID:Not ReportedTrans 2 Address:Not ReportedTrans 2 Address:Not ReportedTrans 2 Country:USATrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/14/1985Last modified date:04/27/2004Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046WasteUS OD Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGEPA Waste Code:D008Record Was Last2004-04-27 00:00:00Modified:FalseDate Record Was Last2004-04-27 00:00:00Modified:FalseDate Record Was Last2004-04-27	Transporter Address:	Not Reported
Transporter Phone:Not ReportedTrans 2 Date:Not ReportedTrans 2 Date:Not ReportedTrans 2 Name:Not ReportedTrans 2 Name:Not ReportedTrans 2 Address:Not ReportedTrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing (Country:USAGenerator Mailing (Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Scieperator Mailing (Country:USADate Received:01/14/1985Date Received:01/14/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046WasteORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:Description:Pate Record Waste?:FalseDate Record Waste?:FalseDate Record Waste?:FalseDate Record Waste?:FalseDate Record Waste?:FalseDate Record Waste?:FalseDate Record Waste?:False<	Transporter City,St,Zip:	СТ
Trans 2 Date:Not ReportedTrans 2 EPA ID:Not ReportedTrans 2 Name:Not ReportedTrans 2 Address:Not ReportedTrans 2 City, St, Zip:CTTrans 2 Country:USATrans 2 Done:Not ReportedGenerator Phone:2032678468Generator Mailing06424City/Stat/Zip:D6424City/Stat/Zip:Not ReportedGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Received:01/14/1985Date Received:01/14/1985Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:OG9Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00ModifiedIGContainer Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:EEV A Waste Code:D008Record Was Last2004-04-27 00:00:00	Transporter Country:	USA
Trans 2 EPA ID:Not ReportedTrans 2 Name:Not ReportedTrans 2 Address:Not ReportedTrans 2 Courty:USATrans 2 Courty:USATrans 2 Courty:USAGenerator Phone:2032678468Generator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:Not ReportedDiscrepancies:Not ReportedDiscrepancies:Not ReportedDate Shipped:01/14/1985Last modified date:04/27/2004Last modified date:04/27/2004US Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Containers:069Containers:069 <trd>Containers:04/24</trd>	Transporter Phone:	Not Reported
Trans 2 Name:Not ReportedTrans 2 Address:Not ReportedTrans 2 City,St,Zip:CTTrans 2 Country:USATrans 2 Phone:2032678468Generator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USAGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/14/1985Last modified date:04/27/2004Last modified date:04/27/2004Last modified date:04/27/2004Last modified date:1985Manifest Id:NYA1025046Waste:Year:Year:1989Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:EPA Waste Code:D008Record Waste Code:D008Record Waste Code:D008Record Waste?FalseDate Record Waste Code:D008Record Waste Code:D008Record Waste Code:D008Record Waste Code:D008Record Waste Code:D008Record Waste Code:D008Record Waste Code:D008	Trans 2 Date:	Not Reported
Trans 2 Address:Not ReportedTrans 2 Country:USATrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00ModifiedIGRecord Waste Code:D008Recycled Waste?FalseDate Record Wast Last2004-04-27 00:00:00	Trans 2 EPA ID:	Not Reported
Trans 2 City, St, Zip:CTTrans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo Gotaliners:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00ModifiedIGRecord:EDate Record Was Last2004-04-27 00:00:00ModifiedIGRecord:EDate Record Was Last2004-04-27 00:00:00ModifiedIGRecord Waste Code:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Trans 2 Name:	Not Reported
Trans 2 Country:USATrans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:04/27/2004Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:1985Year:1985Manifest Id:NYA1025046Waste:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo f Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00ModifiedIGRecord:EDate Record Was Last2004-04-27 00:00:00	Trans 2 Address:	Not Reported
Trans 2 Phone:Not ReportedGenerator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS D Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00MotifiedIGRecord:EDEO Who Last ModifiedIGRecord:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Trans 2 City,St,Zip:	СТ
Generator Phone:2032678468Generator Mailing Addr:25 SKINNER STGenerator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:1Year:1985Mainfest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:D008Record:EsDate Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Modified:EsDate Record Was Last2004-04-27 00:00:00Modified:EsDate Record Was Last2004-04-27 00:00:00Modified:EsDate Record Was Last2004-04-27 00:00:00Modified:EsDate Record Was Last2004-04-27 00:00:00Modified:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Trans 2 Country:	USA
Generator Mailing Addr:25 SKINNER STGenerator Mailing City/State/Zip:06424Generator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:1985Year:1985Mainfest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00ModifiedIGRecord:EDO Who Last ModifiedRecord:D008Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Modified?FalseDED Who Last ModifiedIGRecord:EDOWEPA Waste Code:D008Record Was Last2004-04-27 00:00:00	Trans 2 Phone:	Not Reported
Generator Mailing City/State/Zip:06424City/State/Zip:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDE Record Was Last2004-04-27 00:00:00ModifiedRecord:EPA Waste Code:D008Record:EastDate Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Date Record Was LastD008Record:EastDate Record Was Last2004-04-27 00:00:00Date Record Was LastD008Record Was Last2004-04-27 00:00:00	Generator Phone:	2032678468
City/State/Zip:Generator Mailing Country:USASpecial Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDE Record Was Last2004-04-27 00:00:00Modified:EPE Waste Code:D008Record:EADate Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Bate Record Was Last2004-04-27 00:00:00Cantified:EDE O Who Last Modified Record:FalseDate Record Was Last2004-04-27 00:00:00Bate Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00Container P:FalseDate Record Was Last20	Generator Mailing Addr:	25 SKINNER ST
Special Handling:Not ReportedDiscrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Year:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00		06424
Discrepancies:NoDate Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:Varre:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:D008Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00	Generator Mailing Country:	USA
Date Shipped:01/14/1985Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:1985Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHanding Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGRecord:EPA Waste Code:Du08Recycled Waste?:FalseDot8Date Record Was Last2004-04-27 00:00:00Date Record Was Last2004-04-27 00:00:00	Special Handling:	Not Reported
Date Received:01/15/1985Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:	Discrepancies:	No
Last modified date:04/27/2004Last modified by:IGComments:Not ReportedWaste:*********************************	Date Shipped:	01/14/1985
Last modified by:IGComments:Not ReportedWaste:	Date Received:	01/15/1985
Comments:Not ReportedWaste:985Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGRecycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Last modified date:	04/27/2004
Waste:Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Last modified by:	IG
Year:1985Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Comments:	Not Reported
Manifest Id:NYA1025046Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:D008Record:EPA Waste Code:Date Record Was Last2004-04-27 00:00:00Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Waste:	
Waste Occurence:1UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last Modified:2004-04-27 00:00:00DEO Who Last Modified Record:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last Recycled Waste?:2004-04-27 00:00:00	Year:	1985
UNNA:9189Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:D08Record:EPA Waste Code:Date Record Was Last2004-04-27 00:00:00Description:YContainer Type:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Manifest Id:	NYA1025046
Hazard Class:ORM-EUS Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:DEO Who Last ModifiedDEO Who Last ModifiedIGRecord:EPA Waste Code:Date Record Was Last2004-04-27 00:00:00Modified:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Waste Occurence:	1
US Dot Description:HAZARDOUS WASTE SOLID NOSNo of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGDEO Who Last ModifiedIGRecord:EPA Waste Code:Date Record Was Last2004-04-27 00:00:00Modified:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	UNNA:	9189
No of Containers:069Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last Modified:2004-04-27 00:00:00DEO Who Last Modified Record:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Hazard Class:	ORM-E
Container Type:DMQuantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last Modified:2004-04-27 00:00:00DEO Who Last Modified Record:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last 2004-04-27 00:00:00	US Dot Description:	HAZARDOUS WASTE SOLID NOS
Quantity:24150Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last Modified:2004-04-27 00:00:00DEO Who Last Modified Record:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last 2004-04-27 00:00:00	No of Containers:	069
Weight/Volume:PAdditional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:DEO Who Last ModifiedDEO Who Last ModifiedIGRecord:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Container Type:	DM
Additional Description:YHandling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGDEO Who Last ModifiedIGRecord:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Quantity:	24150
Handling Code:LDate Record Was Last2004-04-27 00:00:00Modified:IGDEO Who Last ModifiedIGRecord:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Weight/Volume:	P
Date Record Was Last Modified:2004-04-27 00:00:00DEO Who Last Modified Record:IGEPA Waste Code:D008Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00	Additional Description:	Y
Modified: IG DEO Who Last Modified IG Record: D008 Recycled Waste?: False Date Record Was Last 2004-04-27 00:00:00	Handling Code:	L
Record: D008 Recycled Waste?: False Date Record Was Last 2004-04-27 00:00:00		2004-04-27 00:00:00
Recycled Waste?:FalseDate Record Was Last2004-04-27 00:00:00		IG
Date Record Was Last 2004-04-27 00:00:00	EPA Waste Code:	D008
	Recycled Waste?:	False
		2004-04-27 00:00:00

PRESSURE PAK CONTAINER CO INC, 25 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Year:	1984
Manifest Id:	CTA0023039
EPA ID:	CTD055509772
TSDF EPA ID:	CTD072138969
TSDF Name:	ENVIRONMENTAL WASTE RESOURCES INC
TSDF Address:	130 FREIGHT ST
TSDF City,St,Zip:	WATERBURY, CT 06702
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	12/06/1984
Transporter EPA ID:	CTD000636498
Transporter Name:	TRI-S INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032678468
Generator Mailing Addr:	25 SKINNER ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	No
Date Shipped:	12/06/1984
Date Received:	12/06/1984
Last modified date:	04/27/2004
Last modified by:	IG
Comments:	Not Reported

BEVIN BROTHERS MFG CO BEVIN RD EAST HAMPTON, CT 06424 EDR ID: \$109732114

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 265 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Year:	1997
Manifest Id:	CTF0593858
EPA ID:	CTD982777757
TSDF EPA ID:	OHD980681571
TSDF Name:	NORTHEAST CHEMICAL CORP
TSDF Address:	3301 MONROE AVE
TSDF City,St,Zip:	CLEVELAND, OH 44113
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	10/01/1997
Transporter EPA ID:	PAD987358587
Transporter Name:	ST JOSEPH MOTOR LINES
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032674431
Generator Mailing Addr:	BEVIN RD
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Not Reported
Date Shipped:	10/01/1997
Date Received:	10/01/1997
Last modified date:	04/26/2004
Last modified by:	IG

BEVIN BROTHERS MFG CO, BEVIN RD EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

Waste:

Year:	1997
Manifest Id:	CTF0593858
Waste Occurence:	1
UNNA:	1263
Hazard Class:	3
US Dot Description:	paint related material, paint
No of Containers:	002
Container Type:	DM
Quantity:	110
Weight/Volume:	G
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2004-04-26 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-26 00:00:00

X	4000
Year:	1996
Manifest Id:	CTF0542164
EPA ID:	CTD982777757
TSDF EPA ID:	OHD980681571
TSDF Name:	NORTHEAST CHEMICAL CORP
TSDF Address:	3301 MONROE AVE
TSDF City,St,Zip:	CLEVELAND, OH 44113
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	06/03/1996
Transporter EPA ID:	CT5000000570
Transporter Name:	BELL HARBOR ENVIRONMENTAL CO
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032674431
Generator Mailing Addr:	BEVIN RD

BEVIN BROTHERS MFG CO, BEVIN RD EAST HAMPTON, CT 06424 (Continued)

Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Yes
Date Shipped:	06/03/1996
Date Received:	06/14/1996
Last modified date:	04/26/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1996
Manifest Id:	CTF0542164
Waste Occurence:	1
UNNA:	1993
Hazard Class:	3
US Dot Description:	FLAMMABLE LIQUID N.O.S.
No of Containers:	002
Container Type:	DM
Quantity:	35
Weight/Volume:	G
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2004-04-26 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-26 00:00:00
Detail:	
Year:	1994
Manifest Id:	MAH722220
EPA ID:	CTD982777757
TSDF EPA ID:	MAD053452637
TSDF Name:	CLEAN HARBORS OF BRAINTREE INC
TSDF Address:	385 QUINCY AVE
TSDF City,St,Zip:	BRAINTREE, MA 02184
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	11/03/1994
Transporter EPA ID:	MAD039322250
Transporter Name:	CLEAN HARBOR ENVIRONMETAL SERVICES
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Bhono:	Not Poported

Not Reported

Transporter Phone:

Trans 2 Date:	11/04/1994
Trans 2 EPA ID:	MAD039322250
Trans 2 Name:	CLEAN HARBOR ENVIRONMETAL SERVICES
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032674431
Generator Mailing Addr:	BEVIN RD
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	No
Date Shipped:	11/03/1994
Date Received:	11/04/1994
Last modified date:	04/26/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1994
Manifest Id:	MAH722220
Waste Occurence:	1
UNNA:	1325
Hazard Class:	4.1
US Dot Description:	WASTE FLAMMABLE SOLID
No of Containers:	002
Container Type:	DM
Quantity:	900
Weight/Volume:	Р
Additional Description:	Y
Handling Code:	S01
Date Record Was Last Modified:	2004-04-26 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-26 00:00:00
Detail:	
Year:	1990
Manifest Id:	CTC0177309

Year:	1990
Manifest Id:	CTC0177309
EPA ID:	CTD982777757
TSDF EPA ID:	CTD009717604
TSDF Name:	SOLVENTS RECOVERY SERVICE OF NEW ENGLAND INC
TSDF Address:	LAZY LANE
TSDF City,St,Zip:	SOUTHINGTON, CT 06489

TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	06/14/1990
Transporter EPA ID:	CTD009717604
Transporter Name:	SOLVENTS RECOVERY SERVICE OF NEW ENGLAND INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	CT
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	CT
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032674431
Generator Mailing Addr:	BEVIN RD
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	No
Date Shipped:	06/14/1990
Date Received:	06/14/1990
Last modified date:	04/27/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1990
Manifest Id:	CTC0177309
Waste Occurence:	1
UNNA:	1325
Hazard Class:	FLAMMABLE
US Dot Description:	WASTE FLAMMABLE SOLID, NOS
No of Containers:	006
Container Type:	DM
Quantity:	2424
Weight/Volume:	P
Additional Description:	Y
Handling Code:	S01
Date Record Was Last	2004-04-27 00:00:00
Modified:	
DEO Who Last Modified Record:	IG
EPA Waste Code:	F005
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00
EPA Waste Code:	F001

Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00
Year:	1990
Manifest Id:	CTC0177309
Waste Occurence:	2
UNNA:	1710
Hazard Class:	ORM-A
US Dot Description:	WASTE TRICHLOROETHYLENE
No of Containers:	001
Container Type:	DM
Quantity:	55
Weight/Volume:	G
Additional Description:	Y
Handling Code:	S01
Date Record Was Last	2004-04-27 00:00:00
Modified:	2004-04-27 00.00.00
DEO Who Last Modified Record:	IG
EPA Waste Code:	F005
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00
EPA Waste Code:	F001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00
Detail:	
Year:	1989
Manifest Id:	CTC0284701
EPA ID:	CTD982777757
TSDF EPA ID:	MAD039322250
TSDF Name:	CLEAN HARBORS INC
TSDF Address:	100 JOSEPH ST
TSDF City,St,Zip:	KINGSTON, MA 02364
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	12/22/1989
Transporter EPA ID:	MAD039322250
Transporter Name:	CLEAN HARBORS INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	CT

Trans 2 Country	116.4
Trans 2 Country:	USA Not Departed
Trans 2 Phone:	Not Reported
Generator Phone:	2032674431
Generator Mailing Addr:	BEVIN RD
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Yes
Discrepancies:	Yes
Date Shipped:	12/28/1989
Date Received:	12/28/1989
Last modified date:	04/27/2004
Last modified by:	IG
Comments:	Not Reported
Waste:	
Year:	1989
Manifest Id:	CTC0284701
Waste Occurence:	1
UNNA:	1710
Hazard Class:	ORM-A
US Dot Description:	WASTE TRICHLOROETHYLENE
No of Containers:	006
Container Type:	DM
Quantity:	330
Weight/Volume:	G
Additional Description:	Ν
Handling Code:	T03
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	F001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00

NAME

EAST HAMPTON TOWN OF BD OF E 940 EAST MAIN ST EAST HAMPTON, CT 06424

EDR ID: S109746095

FINDINGS

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	1995
Manifest Id:	CTF0406073
EPA ID:	CTP000017682
TSDF EPA ID:	CTD021816889
TSDF Name:	UNITED OIL RECOVERY UIS DBA ADV LIQ REC
TSDF Address:	136 GRACEY AVE
TSDF City,St,Zip:	MERIDEN, CT 06451
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	05/04/1995
Transporter EPA ID:	CTD021816889
Transporter Name:	UNITED OIL RECOVERY UIS DBA ADV LIQ REC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	Not Reported
Generator Mailing Addr:	940 EAST MAIN ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	No
Date Shipped:	05/04/1995
Date Received:	05/04/1995
Last modified date:	04/26/2004
Last modified by:	IG

60

EAST HAMPTON TOWN OF BD OF E, 940 EAST MAIN ST EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

Waste:

Year:	1995
Manifest Id:	CTF0406073
Waste Occurence:	1
UNNA:	1993
Hazard Class:	3
US Dot Description:	WASTE FLAMMABLE LIQUID NOS
No of Containers:	001
Container Type:	TT
Quantity:	180
Weight/Volume:	G
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2004-04-26 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-26 00:00:00

SNET CO 115 SO MAIN ST EAST HAMPTON, CT 06424 EDR ID: S109749366

FINDINGS

MANIFEST: Hazardous Waste Manifest Data _______ Page 274 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Year:	1999
Manifest Id:	MAK079010
EPA ID:	CTP000021762
TSDF EPA ID:	MAD019371079
TSDF Name:	GENERAL CHEMICAL CORP
TSDF Address:	133 LELAND ST
TSDF City,St,Zip:	FRAMINGHAM, MA 01701
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	02/19/1999
Transporter EPA ID:	CTD983896341
Transporter Name:	LOGANO TRANSPORTATION CO INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	02/22/1999
Trans 2 EPA ID:	MAD019371079
Trans 2 Name:	GENERAL CHEMICAL CORPORATION,
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	Not Reported
Generator Mailing Addr:	115 SO MAIN ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	No
Date Shipped:	02/19/1999
Date Received:	03/03/1999
Last modified date:	04/26/2004
Last modified by:	IG

SNET CO, 115 SO MAIN ST EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

	·
Waste:	
Year:	1999
Manifest Id:	MAK079010
Waste Occurence:	1
UNNA:	3077
Hazard Class:	9
US Dot Description:	ENVIRONMENTALLY HAZ. SUBSTANCES, SOLID
No of Containers:	007
Container Type:	DM
Quantity:	2100
Weight/Volume:	Р
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2004-04-26 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D008
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-26 00:00:00

BARTON J C CO 11 SKINNER ST EAST HAMPTON, CT 06424 EDR ID: S109750431

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 276 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Year:	2002
Manifest Id:	CTF1021318
EPA ID:	CTP000022896
TSDF EPA ID:	CTD021816889
TSDF Name:	UNITED OIL RECOVERY INC
TSDF Address:	136 GRACEY AVE
TSDF City,St,Zip:	MERIDEN, CT 06450
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	03/11/2002
Transporter EPA ID:	CTD021816889
Transporter Name:	UNITED OIL RECOVERY INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	Not Reported
Generator Mailing Addr:	11 SKINNER ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	No
Date Shipped:	03/11/2002
Date Received:	03/11/2002
Last modified date:	04/27/2004
Last modified by:	IG

BARTON J C CO, 11 SKINNER ST EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

Waste:

Year: 2002 Manifest Id: CTF1021318 Waste Occurence: 1 UNNA: 3082 Hazard Class: 9 US Dot Description: env. Hazardous substance liquid nos No of Containers: 001 Container Type: TΤ Quantity: 3500 G Weight/Volume: Additional Description: Not Reported Handling Code: Not Reported Date Record Was Last Modified: 2004-04-27 00:00:00 DEO Who Last Modified IG Record: D039 EPA Waste Code: Recycled Waste?: False Date Record Was Last 2004-04-27 00:00:00 Modified:

US POSTAL SERVICE MAIN ST EAST HAMPTON, CT 06424 EDR ID: \$109751886

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 278 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	2001
Manifest Id:	NYG2638836
EPA ID:	CTP000025526
TSDF EPA ID:	NYD049836679
TSDF Name:	C W M CHEMICAL SERVICES LLC
TSDF Address:	1550 BALMER RD
TSDF City,St,Zip:	MODEL CITY, NY 14107
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	05/29/2001
Transporter EPA ID:	CTD983896341
Transporter Name:	WASTE MGT NEW ENGLAND ENV TRANSP INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	Not Reported
Generator Mailing Addr:	MAIN ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Yes
Date Shipped:	05/29/2001
Date Received:	06/01/2001
Last modified date:	04/27/2004
Last modified by:	IG

63

US POSTAL SERVICE, MAIN ST EAST HAMPTON, CT 06424 (Continued)

Comments:

Not Reported

	•
Waste:	
Year:	2001
Manifest Id:	NYG2638836
Waste Occurence:	1
UNNA:	3077
Hazard Class:	9
US Dot Description:	ENVIRONMENTALLY HAZ. SUBSTANCES, SOLID
No of Containers:	001
Container Type:	DM
Quantity:	300
Weight/Volume:	Р
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D008
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00

J C BARTON CO 11 SKINNER ST EAST HAMPTON, CT 06424-

EDR ID: S109755266

FINDINGS

LUST: Leaking Underground Storage Tank List	Page 280
Leaking Underground Storage Tank Incident Reports. LUST records contain an inventorFull Description>>	-
MANIFEST: Hazardous Waste Manifest Data	. Page 283
Facility and manifest data. Manifest is a document that lists and tracks hazardous Full Description>>	

DETAILS

LUST: Leaking Underground Storage Tank List LUST:		
LUST Id:	0	
UST Facility Id:	480	
LUST Case Id:	59545	
Lust Status:	Lust Completed	
Processing Status:	Not Reported	
EPA Reportable:	False	
Motor Fuel:	False	
Diesel:	False	
Gasoline:	False	
Other:	False	
Other Release:	Not Reported	
No Release:	False	
Leak:	False	
Tank:	True	
Piping:	False	
Overfill:	False	
Removal:	True	
Incident Date:	10/09/2001	
Entry Date:	08/24/2010	
Site Case Id:	0	
UST Site Id:	0	
Cost Recovery Spill Case #:	0	
Old SITS Number:	0	
Case Log Id:	0	
Monthly Report Id:	0	
UST Owner Id:	3274	
LUST Owner Id:	Not Reported	
UST Event Id:	0	
Contact Info:	Not Reported	
Contact EMail:	Not Reported	
Site Contact City,St,Zip:	UNKNOWN	
2nd Contact:	EnviroScience Consultants, Inc	
2nd Contact EMail:	Not Reported	

J C BARTON CO, 11 SKINNER ST EAST HAMPTON, CT 06424- (Continued)

2nd Contact Address:	795 North Mountain Road
2nd Contact City,St,Zip:	94, CT 06111
2nd Contact Address 2:	Not Reported
2nd Contact City 2:	Newington
2nd Contact Phone	Not Reported
Number:	Not Reported
2nd Contact Fax Number:	Not Reported
2nd Contact Type:	enviro.science@envirosci.com
Facility City Num:	42
Site Contact:	Not Reported
Site Contact Address:	Not Reported
Site Contact Add 2:	Not Reported
Site Contact City 2:	Not Reported
Site Contact Phone:	Not Reported
Site Contact Fax:	Not Reported
Site Contact Type:	Not Reported
Department Contact 1:	Not Reported
Department Contact 2:	Not Reported
Referral Source:	Not Reported
Offsite Source:	False
Date Referred:	Not Reported
Emergency:	False
Private Heating Fuel:	True
Commercial Heating Fuel:	False
Commercial HF < 2100 Gal.:	False
Commercial HF > 2100 Gal.:	False
Commercial HF - Size Unk:	False
No LUST Site:	False
Cost Recvry Prgm Candidate:	False
OCSRD Complete:	False
Follow Up Flag:	False
Alternate Water Supply:	False
Relocation:	False
Responsible Party:	False
Responsible EMail:	Not Reported
Resp Party Name:	J. C Barton Co.
Resp Party Address:	11 Skinner Street
Resp Party City,St,Zip:	East Hampton, CT 064241747
Resp Party Town Number:	42
Resp Party Phone:	2032672538
Resp Party Fax:	Not Reported
Resp Party Name 2:	Edwin Barton
Resp Party Address 2:	Not Reported
Resp Party Phone 2:	Not Reported
Investigator Id:	0 Not Deposited
Follow Update:	Not Reported
Area Lextent:	Not Reported
Appuel Dresinitetien	•
Annual Precipitation: Affected Population:	Not Reported Not Reported

J C BARTON CO, 11 SKINNER ST EAST HAMPTON, CT 06424- (Continued)

Population Setting:	Not Reported
Ground Water Direction:	Not Reported
Ground Water Gradient:	Not Reported
Hydro Basin:	Not Reported
Drastic:	Not Reported
Geo Setting:	Not Reported
Ground Water Classification:	GA
Receptor:	Not Reported
Ground Water Flow Direction:	South-southwest (inferred)
Ground Water Depth:	Not Reported
Areas Of Concern:	Not Reported
Free Product Inches:	0
Fund Date:	Not Reported
Fund Planned:	No
Fund Obligated:	No
Fund Outlayed:	No
Fund Judgment:	No
Fund Recovered:	No
Cellar Borings:	False
Install Micro Wells:	False
Ground Water Sample:	False
Soil Sample:	True
Soil Gas:	False
Site Inspect:	False
Soil Excavate:	False
Geo Probe:	False
Survey:	False
Potable Well Sample:	False
Sample MWS:	False
Ground Water Gauging:	False
Soil Venting:	False
Active:	True
NOV Action:	None
NOV Issued:	Not Reported
NOV Due:	Not Reported
NOV Received:	Not Reported
NOV Closed:	Not Reported
NOV Disc Date:	Not Reported
NOV Issued Date:	Not Reported
NOV Compliance Sched:	Not Reported
NOV Admin Order:	Not Reported
NOV Referred To Ag:	Not Reported
Stop All NOV Actions:	False
Release Invest Rpt:	False
DEP App Letter 1:	False
Correct Action Plan:	False
DEP App Letter 2:	False
Rem Sys Install:	False
Rem Sys Install Date:	Not Reported

J C BARTON CO, 11 SKINNER ST EAST HAMPTON, CT 06424- (Continued)

Closure Date:	Not Reported
Rem Sys Monitoring Rpt:	False
Qrtly Gwater Mon Rpts:	False
Closure Req Rpt:	False
DEP Closure Letter:	False
Referred To:	Not Reported
No Wells:	0
Lph Wells:	0
User Stamp:	allison forrest/ForrestA
Date Stamp:	04/17/2013
Correspondence:	Not Reported
Environmental Impact:	Not Reported
FollowUp:	Not Reported
GW Comments:	Site is serviced by municipal water and sewer systems.
Location Desc:	Surficial Geology: Thick till- predominantly porrly sorted,
	non-stratified sediments directly deposited by glacier.Bedrock
	Geology: Brimfield Schist - a grey, medium to coarse interlayered
	schist and gneiss.
NOV Comments:	Not Reported
Release Desc:	Not Reported
Running Comments:	UST Enforcement Files
Work Performed:	Not Reported

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	2007
Manifest Id:	003104719JJK
EPA ID:	CTP000029987
TSDF EPA ID:	RID040098352
TSDF Name:	NORTHLAND ENVIRONMENTAL INC
TSDF Address:	275 ALLENS AVE
TSDF City,St,Zip:	PROVIDENCE, RI 02905
TSDF Country:	USA
TSDF Telephone:	4017816340
Transport Date:	10/11/2007
Transporter EPA ID:	CTR000500389
Transporter Name:	KROPP ENVIRONMENTAL CONTRACTORS INC
Transporter Address:	P.O. BOX 258
Transporter City,St,Zip:	LEBANON, CT 6429-0258
Transporter Country:	USA
Transporter Phone:	(860)642-9952
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported

J C BARTON CO, 11 SKINNER ST EAST HAMPTON, CT 06424- (Continued)

Conceptor Dhanas	(000) 400, 0045
Generator Phone:	(860)463-8645
Generator Mailing Addr:	66 MEEKS POINT RD
Generator Mailing City/State/Zip:	06424-
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Not Reported
Date Shipped:	10/11/2007
Date Received:	11/02/2007
Last modified date:	02/25/2009
Last modified by:	GH
Comments:	Not Reported
Waste:	
Year:	2007
Manifest Id:	003104719JJK
Waste Occurence:	1
UNNA:	1993
Hazard Class:	3
US Dot Description:	FLAMMABLE LIQUIDS, N.O.S.
No of Containers:	1
Container Type:	DF
Quantity:	85
Weight/Volume:	G
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last	2009-02-25 00:00:00
Modified:	
DEO Who Last Modified Record:	GH
EPA Waste Code:	D001
Recycled Waste?:	False
Date Record Was Last Modified:	2009-02-25 00:00:00

EAST HAMPTON TOWN OF 3 WALNUT ST EAST HAMPTON, CT 06424-EDR ID: \$109755308

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 285 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	2008
Manifest Id:	005243055JJK
EPA ID:	CTP000030492
TSDF EPA ID:	MAD047075734
TSDF Name:	TRIUMVIRATE ENVIRONMENTAL MERRIMACK
TSDF Address:	263 HOWARD ST
TSDF City,St,Zip:	LOWELL, MA 01852-
TSDF Country:	USA
TSDF Telephone:	(978)453-7772
Transport Date:	09/04/2008
Transporter EPA ID:	MAD985286988
Transporter Name:	TRIUMVIRATE ENVIRONMENTAL INC
Transporter Address:	61 INNER BELT RD
Transporter City,St,Zip:	SOMERVILLE, MA 02143
Transporter Country:	USA
Transporter Phone:	(617)628-8098
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	(860)267-4468
Generator Mailing Addr:	20 E HIGH ST
Generator Mailing City/State/Zip:	06424-
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Not Reported
Date Shipped:	09/04/2008
Date Received:	09/04/2008
Last modified date:	09/20/2011
Last modified by:	IR

EAST HAMPTON TOWN OF, 3 WALNUT ST EAST HAMPTON, CT 06424- (Continued)

Comments:

Not Reported

Waste:

Waste.	
Year:	2008
Manifest Id:	005243055JJK
Waste Occurence:	1
UNNA:	Not Reported
Hazard Class:	9
US Dot Description:	HAZARDOUS WASTE, SOLID, N.O.S.
No of Containers:	1
Container Type:	CF
Quantity:	40
Weight/Volume:	Р
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2011-09-20 00:00:00
DEO Who Last Modified Record:	IR
EPA Waste Code:	D008
Recycled Waste?:	False
Date Record Was Last Modified:	2011-09-20 00:00:00
Deteil	
Detail:	
Year:	2007
Manifest Id:	002106069JJK
EPA ID:	CTP000030055
TSDF EPA ID: TSDF Name:	NJD991291105 CLEANARTH OF NORTH JERSEY INC
TSDF Address:	105 JACOBUS AVE
TSDF City,St,Zip:	KEARNY, NJ 07032
TSDF Country:	USA
TSDF Telephone:	9733444004
Transport Date:	09/25/2007
Transporter EPA ID:	NJR000029967
Transporter Name:	J & D TRUCKING INC
Transporter Address:	P.O.BOX 674
Transporter City, St, Zip:	NEWFIELD, NJ 08344
Transporter Country:	USA
Transporter Phone:	(856)691-5145
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	(860)704-4763
Generator Mailing Addr:	20 E HIGH ST

EAST HAMPTON TOWN OF, 3 WALNUT ST EAST HAMPTON, CT 06424- (Continued)

Generator Mailing City/State/Zip:	06424-
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Not Reported
Date Shipped:	09/25/2007
Date Received:	09/25/2007
Last modified date:	11/25/2008
Last modified by:	DMG
Comments:	Not Reported

NAME

TOWN OF EAST HAMPTON - LAND PARCEL 13 WATROUS ST EAST HAMPTON, CT 06424 EDR ID: \$110709042

FINDINGS

MANIFEST: Facility and Manifest Data ______ Page 288
 Manifest is a document that lists and tracks hazardous waste from the generator thro...Full Description>>

DETAILS

▼ MANIFEST: Facility and Manifest Data

NY MANIFEST:

EPA ID:	CTP000031332
Country:	USA
Location Address 1:	13 WATROUS ST
Location Address 2:	Not Reported
Location City:	EAST HAMPTON
Location State:	СТ
Location Zip Code:	06424
Location Zip Code 4:	Not Reported
Mailing Info:	
Name:	TOWN OF EAST HAMPTON - LAND PARCEL
Contact:	KEITH HAYDEN
Address:	20 EAST HIGH SCHOOL STREET
City/State/Zip:	EAST HAMPTON, CT 06424
Country:	USA
Phone:	860-267-4747
Manifest:	
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	PAD987347515
Trans2 State ID:	Not Reported
Generator Ship Date:	11/02/2010
Trans1 Recv Date:	11/02/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/03/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	21564.0
Units:	K - Kilograms (2.2 pounds)

Number of Containers:	1.0	
Container Type:	DT - Dump trucks	
Handling Method:	L Landfill.	
Specific Gravity:	1.0	
Year:	2010	
Manifest Tracking Num:	001336169GBF	
Import Ind:	Ν	
Export Ind:	Ν	
Discr Quantity Ind:	Y	
Discr Type Ind:	Ν	
Discr Residue Ind:	Ν	
Discr Partial Reject Ind:	Ν	
Discr Full Reject Ind:	Ν	
Manifest Ref Num:	Not Reported	
Alt Fac RCRA Id:	Not Reported	
Alt Fac Sign Date:	Not Reported	
Mgmt Method Type Code:	H132	
Document ID:	Not Reported	
Manifest Status:	Not Reported	
Trans1 State ID:	NYD046765574	
Trans2 State ID:	Not Reported	
Generator Ship Date:	11/02/2010	
Trans1 Recv Date:	11/02/2010	
Trans2 Recv Date:	Not Reported	
TSD Site Recv Date:	11/03/2010	
Part A Recv Date:	Not Reported	
Part B Recv Date:	Not Reported	
Generator EPA ID:	CTP000031332	
Trans1 EPA ID:	Not Reported	
Trans2 EPA ID:	Not Reported	
TSDF ID:	NYD049836679	
Waste Code:	Not Reported	
Quantity:	21509.0	
Units:	K - Kilograms (2.2 pounds)	
Number of Containers:	1.0	
Container Type:	DT - Dump trucks	
Handling Method:	L Landfill.	
Specific Gravity:	1.0	
Year:	2010	
Manifest Tracking Num:	001336170GBF	
Import Ind:	Ν	
Export Ind:	Ν	
Discr Quantity Ind:	Y	
Discr Type Ind:	Ν	
Discr Residue Ind:	Ν	
Discr Partial Reject Ind:	Ν	
Discr Full Reject Ind:	Ν	
Manifest Ref Num:	Not Reported	

Alt Eac Sign Date:	Not Poportod
Alt Fac Sign Date:	Not Reported H132
Mgmt Method Type Code:	H132
De surre ent ID:	Net Dependent
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	NYD046765579
Trans2 State ID:	Not Reported
Generator Ship Date:	11/02/2010
Trans1 Recv Date:	11/02/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/03/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	26798.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001336171GBF
Import Ind:	Ν
Export Ind:	Ν
Discr Quantity Ind:	Y
Discr Type Ind:	Ν
Discr Residue Ind:	Ν
Discr Partial Reject Ind:	Ν
Discr Full Reject Ind:	Ν
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
3	-
Document ID:	Not Reported
Manifest Status:	
Trans1 State ID:	Not Reported NYD046765574
Trans2 State ID:	
	Not Reported
Generator Ship Date:	11/03/2010
Trans1 Recv Date:	11/03/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/04/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported

Trans2 EPA ID:	Not Reported	
TSDF ID:	NYD049836679	
Waste Code:	Not Reported	
Quantity:	30953.0	
Units:	K - Kilograms (2.2 pounds)	
Number of Containers:	1.0	
Container Type:	DT - Dump trucks	
Handling Method:	L Landfill.	
Specific Gravity:	1.0	
Year:	2010	
Manifest Tracking Num:	001352700GBF	
Import Ind:	N	
Export Ind:	Ν	
Discr Quantity Ind:	Υ	
Discr Type Ind:	Ν	
Discr Residue Ind:	N	
Discr Partial Reject Ind:	N	
Discr Full Reject Ind:	N	
Manifest Ref Num:	Not Reported	
Alt Fac RCRA Id:	Not Reported	
Alt Fac Sign Date:	Not Reported	
Mgmt Method Type Code:	H132	
. 71		
Document ID:	Not Reported	
Manifest Status:	Not Reported	
Trans1 State ID:	NYD046765574	
Trans2 State ID:	Not Reported	
Generator Ship Date:	11/03/2010	
Trans1 Recv Date:	11/03/2010	
Trans2 Recv Date:	Not Reported	
TSD Site Recv Date:	11/05/2010	
Part A Recv Date:	Not Reported	
Part B Recv Date:	Not Reported	
Generator EPA ID:	CTP000031332	
Trans1 EPA ID:	Not Reported	
Trans2 EPA ID:	Not Reported	
TSDF ID:	NYD049836679	
Waste Code:	Not Reported	
Quantity:	31760.0	
Units:	K - Kilograms (2.2 pounds)	
Number of Containers:	1.0	
Container Type:	DT - Dump trucks	
Handling Method:	L Landfill.	
Specific Gravity:	1.0	
Year:	2010	
Manifest Tracking Num:	001352701GBF	
Import Ind:	N	
Export Ind:	N	
Discr Quantity Ind:	Ŷ	
Discr Type Ind:	' N	
eloor type mu.		

	-
Discr Residue Ind:	Ν
Discr Partial Reject Ind:	Ν
Discr Full Reject Ind:	Ν
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	NYD046765574
Trans2 State ID:	Not Reported
Generator Ship Date:	11/03/2010
Trans1 Recv Date:	11/03/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/04/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	33167.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001352702GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date: Mgmt Method Type Code:	Not Reported H132
Mgmt Method Type Code.	11132
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	MAC300008059
Trans2 State ID:	Not Reported
Generator Ship Date:	11/16/2010
Trans1 Recv Date: Trans2 Recv Date:	11/16/2010 Not Reported
Hansz Recy Dale.	Not Reported

TSD Site Recv Date:	11/17/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	6613.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	CM - Metal boxes, cases, roll-offs
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	008346072JJK
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Ŷ
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	PAD987347515
Trans2 State ID:	Not Reported
Generator Ship Date:	11/04/2010
Trans1 Recv Date:	11/04/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/05/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	17000.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010

Manifest Tracking Num:	001352710GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
g	
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	PAD987347515
Trans2 State ID:	Not Reported
Generator Ship Date:	11/04/2010
Trans1 Recv Date:	11/04/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/05/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	19804.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001352711GBF
Import Ind:	Ν
Export Ind:	Ν
Discr Quantity Ind:	Υ
Discr Type Ind:	Ν
Discr Residue Ind:	Ν
Discr Partial Reject Ind:	Ν
Discr Full Reject Ind:	Ν
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
Designed (1D	Net Described
Document ID:	Not Reported
Manifest Status:	Not Reported

Trans1 State ID:	PAD987347515
Trans2 State ID:	Not Reported
Generator Ship Date:	11/04/2010
Trans1 Recv Date:	11/04/2010
Trans2 Recy Date:	Not Reported
TSD Site Recv Date:	11/05/2010
Part A Recy Date:	Not Reported
Part B Recy Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	21872.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001352712GBF
Import Ind:	Ν
Export Ind:	Ν
Discr Quantity Ind:	Y
Discr Type Ind:	Ν
Discr Residue Ind:	Ν
Discr Partial Reject Ind:	Ν
Discr Full Reject Ind:	Ν
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	PAD987347515
Trans2 State ID:	Not Reported
Generator Ship Date:	11/04/2010
Trans1 Recv Date:	11/04/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/05/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	18733.0
Units:	K - Kilograms (2.2 pounds)

Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001352713GBF
Import Ind:	Ν
Export Ind:	Ν
Discr Quantity Ind:	Υ
Discr Type Ind:	Ν
Discr Residue Ind:	Ν
Discr Partial Reject Ind:	Ν
Discr Full Reject Ind:	Ν
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
-	
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	PAD987347515
Trans2 State ID:	Not Reported
Generator Ship Date:	11/05/2010
Trans1 Recv Date:	11/05/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/08/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	19559.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001352717GBF
Import Ind:	N
Export Ind:	N
Discr Quantity Ind:	Y
Discr Type Ind:	N
Discr Residue Ind:	N
Discr Partial Reject Ind:	N
Discr Full Reject Ind:	N Nat Brandad
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported

Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132
Document ID:	Not Reported
Manifest Status:	Not Reported
Trans1 State ID:	NYD046765574
Trans2 State ID:	Not Reported
Generator Ship Date:	11/03/2010
Trans1 Recv Date:	11/03/2010
Trans2 Recv Date:	Not Reported
TSD Site Recv Date:	11/04/2010
Part A Recv Date:	Not Reported
Part B Recv Date:	Not Reported
Generator EPA ID:	CTP000031332
Trans1 EPA ID:	Not Reported
Trans2 EPA ID:	Not Reported
TSDF ID:	NYD049836679
Waste Code:	Not Reported
Quantity:	23986.0
Units:	K - Kilograms (2.2 pounds)
Number of Containers:	1.0
Container Type:	DT - Dump trucks
Handling Method:	L Landfill.
Specific Gravity:	1.0
Year:	2010
Manifest Tracking Num:	001352703GBF
Import Ind:	Ν
Export Ind:	Ν
Discr Quantity Ind:	Y
Discr Type Ind:	Ν
Discr Residue Ind:	Ν
Discr Partial Reject Ind:	Ν
Discr Full Reject Ind:	Ν
Manifest Ref Num:	Not Reported
Alt Fac RCRA Id:	Not Reported
Alt Fac Sign Date:	Not Reported
Mgmt Method Type Code:	H132

FOOD BAG 318 MAIN ST EAST HAMPTON, CT 06424 EDR ID: S113475931

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 298 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	1987
Manifest Id:	CTC0127401
EPA ID:	CTP000006729
TSDF EPA ID:	CTD021816889
TSDF Name:	UNITED WASTE OIL CO INC
TSDF Address:	136 GRACEY AVE
TSDF City,St,Zip:	MERIDEN, CT 06450
TSDF Country:	USA
TSDF Telephone:	Not Reported
Transport Date:	10/26/1987
Transporter EPA ID:	CTD981065758
Transporter Name:	EVERCLEAR ENVIRONMENTAL SERVICES INC
Transporter Address:	Not Reported
Transporter City,St,Zip:	СТ
Transporter Country:	USA
Transporter Phone:	Not Reported
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	2032679385
Generator Mailing Addr:	318 MAIN ST
Generator Mailing City/State/Zip:	06424
Generator Mailing Country:	USA
Special Handling:	No
Discrepancies:	No
Date Shipped:	10/26/1987
Date Received:	10/26/1987
Last modified date:	04/27/2004
Last modified by:	IG

FOOD BAG, 318 MAIN ST EAST HAMPTON, CT 06424 (Continued)

Comments:	Not Reported
Waste:	
Year:	1987
Manifest Id:	CTC0127401
Waste Occurence:	1
UNNA:	1993
Hazard Class:	FLAMMABLE
US Dot Description:	WASTE FLAMMABLE LIQUID, NOS
No of Containers:	001
Container Type:	TT
Quantity:	50
Weight/Volume:	G
Additional Description:	Y
Handling Code:	S02
Date Record Was Last Modified:	2004-04-27 00:00:00
DEO Who Last Modified Record:	IG
EPA Waste Code:	D001
Recycled Waste?:	False
Date Record Was Last Modified:	2004-04-27 00:00:00

FRANK MANTILK 94 MAIN ST EAST HAMPTON, CT 06424-EDR ID: S113478756

FINDINGS

MANIFEST: Hazardous Waste Manifest Data ______ Page 300 Facility and manifest data. Manifest is a document that lists and tracks hazardous ...Full Description>>

DETAILS

▼ MANIFEST: Hazardous Waste Manifest Data

CT MANIFEST:

Detail:

Year:	2008
Manifest Id:	003828776JJK
EPA ID:	CTP000030600
TSDF EPA ID:	MAD047075734
TSDF Name:	TRIUMVIRATE ENVIRONMENTAL MERRIMACK
TSDF Address:	263 HOWARD ST
TSDF City,St,Zip:	LOWELL, MA 01852-
TSDF Country:	USA
TSDF Telephone:	(978)453-7772
Transport Date:	11/03/2008
Transporter EPA ID:	MAD985286988
Transporter Name:	TRIUMVIRATE ENVIRONMENTAL INC
Transporter Address:	61 INNER BELT RD
Transporter City,St,Zip:	SOMERVILLE, MA 02143
Transporter Country:	USA
Transporter Phone:	(617)628-8098
Trans 2 Date:	Not Reported
Trans 2 EPA ID:	Not Reported
Trans 2 Name:	Not Reported
Trans 2 Address:	Not Reported
Trans 2 City,St,Zip:	СТ
Trans 2 Country:	USA
Trans 2 Phone:	Not Reported
Generator Phone:	(860)267-7450
Generator Mailing Addr:	94 MAIN ST
Generator Mailing City/State/Zip:	06424-
Generator Mailing Country:	USA
Special Handling:	Not Reported
Discrepancies:	Not Reported
Date Shipped:	11/03/2008
Date Received:	11/13/2008
Last modified date:	09/01/2011
Last modified by:	IR

FRANK MANTILK, 94 MAIN ST EAST HAMPTON, CT 06424- (Continued)

Comments:

Not Reported

Waste:

Year:	2008
Manifest Id:	003828776JJK
Waste Occurence:	1
UNNA:	Not Reported
Hazard Class:	9
US Dot Description:	HAZARDOUS WASTE, SOLID, N.O.S.
No of Containers:	1
Container Type:	CF
Quantity:	400
Weight/Volume:	Р
Additional Description:	Not Reported
Handling Code:	Not Reported
Date Record Was Last Modified:	2011-09-01 00:00:00
DEO Who Last Modified Record:	IR
EPA Waste Code:	D008
Recycled Waste?:	False
Date Record Was Last Modified:	2011-09-01 00:00:00

2 BEVIN BLVD

EAST HAMPTON, CT 06424

EDR ID: S116358648

FINDINGS

LEAD: Lead Inspection Database Lead Inspection Database ... Full Description>>

DETAILS

LEAD: Lead Inspection Database

LEAD: Drinking Water No Reason Not Reported 0: Drinking Water 0: Yes Dwelling Type: Multi-unit Dust Remove Workflow 1: Not Reported Dust No Reason 0: Not Reported Dust Remove Workflow 0: Not Reported Dust 0: Yes Exterior Doors Deteriorated Not Reported 1: Exterior Doors Intact 0: No **Exterior Foundation** Not Reported Deteriorated 0: **Exterior Foundation Intact 0:** No Exterior Garage Deteriorated 0: Not Reported Exterior Garage Intact 0: No Not Reported Exterior Porch Deteriorated 0: **Exterior Porch Intact 0:** No Exterior Paint Tested 0: No **Exterior Siding Deteriorated** Not Reported Exterior Siding Intact 0: No Exterior Stairs Deteriorated No 0: Exterior Stairs Intact 0: Yes **Exterior Windows** Not Reported Deteriorated 0: Exterior Windows Intact 0: No Inv Site Testing Performed Comprehensive Lead Inspection 0: Inv Site Testing Performed Not Reported 1: Inv Site Type Daycare Not Reported Name: Inv Site Type 0: Residence Inv Site Year Built: Not Reported Inspector Agency Name 0: Chatham Health District

..... Page 302

, 2 BEVIN BLVD EAST HAMPTON, CT 06424 (Continued)

Inspector Certificate 0:Not ReportedLead Inspector First Name 0:JamesInspector Highest Floors 0:291Inspector Highest OtherNot ReportedResult 1:Inspector Highest OtherResult 2:Not ReportedInspector Highest OtherNot ReportedResult 1:Inspector Highest OtherInspector Highest OtherNot ReportedInspector Highest OtherNot ReportedInspector Highest PaintN/AChips Unit 0:Not ReportedInspector Highest PaintN/AChips Unit 0:1640 mg/kgInspector Highest Vindow419Sills 0:Inspector Highest WindowInspector Highest Vindow19,500Wells 0:19,500Inspection Highest Window19,500Inspection Highest Vindow19,500Inspection Interior SealeYesRooms Vindflow:Not ReportedInspection InteriorYesInspection InteriorYesInspection Interior CeilingsNoInspection Interior CeilingsNoInspection Interior CeilingsNoInspection Interior ClosetYesDeteriorated 0:YesInspection Interior ClosetYesDeteriorated 0: <th></th> <th></th>		
Foundation Intact 1:Inspection Highest Floors 0:291Inspection Highest Other Result 1:Not ReportedResult 1:Inspection Highest Other Result 1:Not ReportedInspection Highest Other Result 1:Not ReportedInspection Highest Other Item 10:Not ReportedInspection Highest Paint Chips Other 10:Not ReportedInspection Highest Paint Chips 0:Not ReportedInspection Highest Paint Chips 0:Not ReportedInspection Highest ValueMageInspection Highest ValueMageInspection Highest Window419Sills 0:1.84Inspection Highest Window19.500Wells 0:Inspection Highest WindowInspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Interior Baseboard InteriorYesRooms 0:Closet under stairs, many walls, windows etc due to clutterRooms 0:NoInspection Interior Baseboard InteriorYesInspection Interior Closet Inspection Interior ClosetNoInspection Interior Closet Intact 0:YesInspection Interior Closet Intact 0:YesInspection Interior Closet Intact 0:YesInspection Interior Closet Intact 0:YesInspection Interior Floor Intact 0:YesInspection Interior Floor Intact 0:YesInspection Interior Floor Intact 0:Y	Inspector Certificate 0:	Not Reported
Inspection Highest Floors 0:291Inspection Highest Other Result 1:Not ReportedInspection Highest Other Result 2:Not ReportedInspection Highest Other Item 1 0:Not ReportedHighest Other Item 2:Not ReportedInspection Highest Paint Chips OtherN/AInspection Highest Paint Chips 0:Not ReportedInspection Highest Paint Chips 0:Not ReportedInspection Highest Window419Sills 0:Inspection Highest WindowInspection Highest Window19,500Inspection Highest Water Unit 0:mcg/l or ppbInspection Highest Xfr Remove Workflow:Not ReportedInspection Highest Xfr Remove Workflow:Not ReportedInspection Inaccessable Rooms 0:YesBaseboard Deteriorated 0:YesInspection Interior Baseboard Deteriorated 0:YesInspection Interior Coset Deteriorated 0:YesInspection Interior Closet Inspection Interior Closet Deteriorated 0:YesInspection Interior Closet Inspection Interior Floor Inspection Interior Paint YesInspection Interior Floor Inspection Interior Floor Inspection Interior Floor Inspection Interior Floor Inspection Interior Paint TeseInspection Interior Floor Inspection Interior Floor Inspection Interior Floor Inspection Interior Floor Inspection Interior Floor Inspection Int		Not Reported
Inspection Highest Other Result 1:Not ReportedInspection Highest Other Result 2:Not ReportedInspection Highest Other Item 1 0:Not ReportedHighest Other Item 2:Not ReportedInspection Highest Paint Chips Unit 0:NAInspection Highest Paint Chips 0:NAInspection Highest Soil 0:1640 mg/kgInspection Highest Value Walls 0:19,500Inspection Highest Water Unit 0:mcg/l or ppbUnit 0:19,500Inspection Highest Water 0:1.8Inspection Highest Water 0:1.8Inspection Highest Water 0:1.8Inspection Highest Water 0:2.9Inspection Highest XfrlNot ReportedRemove Workflow:PessInspection Highest XfrlNot ReportedRemove Workflow:YesBaseboard Intaccessable Rooms 0:YesInspection Interior Baseboard Intact 0:YesInspection Interior Collings Deteriorated 0:NoInspection Interior Collings Deteriorated 0:NoInspection Interior Collings Deteriorated 0:YesInspection Interior Closet Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspect	Inspector First Name 0:	James
Result 1:Not ReportedInspection Highest Other Result 2:Not ReportedHighest Other Item 2:Not ReportedHighest Other Item 2:Not ReportedInspection Highest Paint Chips Unit 0:N/AInspection Highest Paint Chips Unit 0:Not ReportedInspection Highest Paint Chips Unit 0:Not ReportedInspection Highest Soil 0:1640 mg/kgInspection Highest Water Unit 0:mcg/l or ppbInspection Highest Water Unit 0:mcg/l or ppbInspection Highest Water 0:1.8Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Inaccessable Rooms 0:Closet under stairs, many walls, windows etc due to clutterRooms Ves List:Inspection Interior PessInspection Interior Baseboard Interior Deteriorated 0:YesInspection Interior Coset Inspection Interior Coset Deteriorated 0:NoInspection Interior Coset Inspection Interior Coset Deteriorated 0:YesInspection Interior Coset Inspection Interior Coset Deteriorated 0:YesInspection Interior Coset Inspection Interior Coset Inspection Interior Coset Inspection Interior Coset Inspection Interior Coset Inspection Interior Floor Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Inspection Interior Floor Deteriorated 0:YesInspection Interior Floor Inspe	Inspection Highest Floors 0:	291
Result 2:Not ReportedInspection Highest OtherNot ReportedHighest Other Item 2:Not ReportedInspection Highest PaintN/AChips 0:1640 mg/kgInspection Highest Soil 0:1640 mg/kgInspection Highest Soil 0:1640 mg/kgInspection Highest Window419Sills 0:19,500Inspection Highest Watermcg/l or ppbUnit 0:1.8Inspection Highest Water 0:1.8Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 0:>9.9Inspection Inaccessablecloset under stairs, many walls, windows etc due to clutterRooms VS List:Inspection InaccessableInspection InteriorYesBaseboard Deteriorated 0:NoInspection Interior CeilingsNoInspection Interior ClosetYesDeteriorated 0:NoInspection Interior FloorYesDeteriorated 0:Inspection Interior ClosetInspection Interior FloorYesDeteriorated 0:Inspection Interior FloorInspection Interior FloorYesInspection Interior FloorYesInspection Interior Floor		Not Reported
Item 1 0: Highest Other Item 2: Inspection Highest Paint Chips Unit 0: Inspection Highest Paint NVA Reported Inspection Highest Soil 0: Inspection Highest Soil 0: Inspection Highest Window Sils 0: Inspection Highest Water Unit 0: Inspection Highest Water 0: Inspection Highest Water 0: Inspection Highest Xrf 0: Inspection Indicessable Remove Workflow: Inspection Inaccessable Rooms 0: Inspection Interior Baseboard Deteriorated 0: Inspection Interior Ceilings Deteriorated 0: Inspection Interior Coset Deteriorated 0: Inspection Interior Floor Inspection Interior Stairs Deteriorated 0: Inspection Interior Stairs Deteriorated 0: In		Not Reported
Inspection Highest Paint Chips Unit 0:N/AInspection Highest Paint Chips 0:Not ReportedInspection Highest Soil 0:1640 mg/kgInspection Highest Window Sills 0:419Sills 0:Inspection Highest Water Unit 0:mcg/l or ppbInspection Highest Window Wells 0:19,500Inspection Highest Water 0:1.8Inspection Highest Xrl 0:>9.9Inspection Highest Xrl 0:>9.9Inspection Ingest Xrl Remove Workflow:Not ReportedInspection Inaccessable Rooms 0:YesInspection Inaccessable Raseboard Deteriorated 0:YesInspection Interior Baseboard Intact 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Colset Deteriorated 0:YesInspection Interior Doors Intact 0:YesInspection Interior Doors Inspection Interior Floor Deteriorated 0:YesInspection Interior Floor Inspection Interior Stairs Deteriorated 0:YesInspection Interior Stairs Deteriorated 0:YesInspection Interior Stairs Deteriorated 0:<		Not Reported
Chips Unit 0:Not ReportedInspection Highest Paint Chips 0:Not ReportedInspection Highest Soil 0:1640 mg/kgInspection Highest Window419Sills 0:Inspection Highest WindowInspection Highest Watermcg/l or ppbUnit 0:Inspection Highest WindowInspection Highest Window19,500Wells 0:Inspection Highest Xrl 0:Inspection Highest Xrl 7Not ReportedRemove Workflow:Inspection Highest XrlInspection Indighest Xrl 7Not ReportedRemove Workflow:Closet under stairs, many walls, windows etc due to clutterRooms 0:YesInspection Intercessable Rooms 0:YesInspection Interior Baseboard Deteriorated 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Clings Intact 0:NoInspection Interior Closet Deteriorated 0:YesInspection Interior Doors Intact 0:YesInspection Interior Floor Intact 0:YesInspection Interior Floor Inspection Interior Floor Inspection Interior Floor Inspection Interior Paint Tested 0:YesInspection Interior Paint Tested 0:YesInspection Interior Stairs Deteriorated 0:YesInspection Interior Stairs Deteri	Highest Other Item 2:	Not Reported
Chips 0:1640 mg/kgInspection Highest Soil 0:1640 mg/kgInspection Highest Window419Sills 0:mcg/l or ppbInspection Highest Watermcg/l or ppbUnit 0:1.8Inspection Highest Water 0:1.8Inspection Highest Xrf 0:>9.9Inspection Highest XrfNot ReportedRemove Workflow:closet under stairs, many walls, windows etc due to clutterRooms 0:YesInspection InteriorYesBaseboard Deteriorated 0:YesInspection Interior CeilingsNoDeteriorated 0:NoInspection Interior CeilingsNoInspection Interior ClosetYesDeteriorated 0:YesInspection Interior DoorsYesInspection Interior DoorsYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior PlaintYesInspection Interior PlaintYesInspection Interior PlaintYesInspection Interior PlaintYesInspection Interior StairsYesInspection Interior Stairs<		N/A
Inspection Highest Window419Sills 0:Inspection Highest Watermcg/l or ppbInspection Highest Water 0:1.8Inspection Highest Water 0:1.8Inspection Highest Xrf>9.9Inspection Highest XrfNot ReportedRemove Workflow:closet under stairs, many walls, windows etc due to clutterInspection Inaccessablecloset under stairs, many walls, windows etc due to clutterRooms Ves List:closet under stairs, many walls, windows etc due to clutterInspection InaccessableYesRooms 0:YesInspection InteriorYesBaseboard Deteriorated 0:NoInspection Interior CeilingsNoDeteriorated 0:YesInspection Interior CeilingsNoInspection Interior ClosetYesDeteriorated 0:NoInspection Interior ClosetYesDeteriorated 0:YesInspection Interior DoorsYesInspection Interior DoorsYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior PaintYesInspection Interior PaintYesInspection Interior StairsNot ReportedInspection Interior StairsYesInspection Interior StairsYesInspection Interior StairsYesInspection Interior StairsYesInspection Interior StairsYesInspection Interior StairsYesInspection Inte		Not Reported
Sills 0:mcg/l or ppbInspection Highest Watermcg/l or ppbInspection Highest Window19,500Wells 0:Inspection Highest Water 0:1.8Inspection Highest Xrf 0:>9.9Inspection Highest XrfNot ReportedRemove Workflow:closet under stairs, many walls, windows etc due to clutterInspection InaccessableYesRooms 0:YesInspection InteriorYesBaseboard Deteriorated 0:YesInspection Interior CellingsNoDeteriorated 0:YesInspection Interior CellingsNoInspection Interior CellingsNoInspection Interior ColosetYesDeteriorated 0:YesInspection Interior ColosetYesInspection Interior ClosetNoInspection Interior ClosetYesDeteriorated 0:YesInspection Interior ClosetNoInspection Interior DoorsYesDeteriorated 0:YesInspection Interior FloorYesInspection Interior Floor <td>Inspection Highest Soil 0:</td> <td>1640 mg/kg</td>	Inspection Highest Soil 0:	1640 mg/kg
Unit 0:Inspection Highest Window19,500Inspection Highest Water 0:1.8Inspection Highest Xrf 0:>9.9Inspection Highest Xrf 1Not ReportedRemove Workflow:closet under stairs, many walls, windows etc due to clutterInspection Inaccessablecloset under stairs, many walls, windows etc due to clutterRooms Yes List:resInspection InaccessableYesRooms 0:YesInspection InteriorYesBaseboard Deteriorated 0:YesInspection Interior CeilingsNoDeteriorated 0:YesInspection Interior ClosetYesDeteriorated 0:YesInspection Interior ClosetYesDeteriorated 0:NoInspection Interior ClosetNoInspection Interior ClosetYesDeteriorated 0:YesInspection Interior ClosetNoInspection Interior ClosetYesDeteriorated 0:YesInspection Interior DoorsYesInspection Interior FloorYesInspection Interior FloorYes <td< td=""><td></td><td>419</td></td<>		419
Wells 0:1.8Inspection Highest Water 0:1.8Inspection Highest XrfNot ReportedRemove Workflow:closet under stairs, many walls, windows etc due to clutterRooms Yes List:closet under stairs, many walls, windows etc due to clutterRooms 0:Inspection InaccessableYesInspection InteriorYesBaseboard Deteriorated 0:Inspection InteriorInspection Interior CeilingsNoDeteriorated 0:YesInspection Interior CeilingsNoInspection Interior ColosetYesDeteriorated 0:YesInspection Interior DoorsYesDeteriorated 0:YesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior PaintYesInspection Interior PaintYesInspection Interior PaintYesLead Inspector Interior StairsYesLead Inspector Interior StairsYesDeteriorated 0:Inspection Interior StairsInspection Interior StairsYesDeteriorated 0:Inspection Interior StairsInspection Interior StairsYesInspection Interior StairsYes		mcg/l or ppb
Inspection Highest Xrf 0:>9.9Inspection Highest Xrf Remove Workflow:Not ReportedInspection Inaccessable Rooms Yes List:closet under stairs, many walls, windows etc due to clutterInspection Inaccessable Rooms 0:YesInspection Interior Baseboard Deteriorated 0:YesInspection Interior Baseboard Interior CeilingsYesInspection Interior CeilingsNoInspection Interior CeilingsNoInspection Interior CeilingsNoInspection Interior Coset Deteriorated 0:YesInspection Interior Coset Deteriorated 0:YesInspection Interior Coset Deteriorated 0:YesInspection Interior Coset Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Floor Intact 0:YesInspection Interior Plaint Tested 0:YesInspection Interior Plaint Tested 0:YesInspection Interior Stairs Deteriorated 0:YesInspection Interior Stairs Deteriorated 0:Yes		19,500
Inspection Highest Xrf Remove Workflow:Not ReportedInspection Inaccessable Rooms Yes List:closet under stairs, many walls, windows etc due to clutterInspection Inaccessable Rooms 0:YesInspection Interior Baseboard Deteriorated 0:YesInspection Interior Baseboard Intact 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Deteriorated 0:NoInspection Interior Coloset Deteriorated 0:YesInspection Interior Coloset Deteriorated 0:YesInspection Interior Coloset Deteriorated 0:YesInspection Interior Coloset Deteriorated 0:NoInspection Interior Coloset Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Floor Intact 0:YesInspection Interior Paint Tested 0:YesInspection Interior Paint Tested 0:YesLead Inspection Inspector Liconse 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes	Inspection Highest Water 0:	1.8
Remove Workflow:Inspection Inaccessable Rooms Yes List:closet under stairs, many walls, windows etc due to clutter Rooms 0:Inspection Interior Baseboard Deteriorated 0:YesInspection Interior Baseboard Intact 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Colset Deteriorated 0:YesInspection Interior Closet Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Intact 0:YesInspection Interior Ploor Deteriorated 0:YesInspection Interior Ploor Intact 0:YesInspection Interior Plaint Tested 0:YesLead Inspection Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes	Inspection Highest Xrf 0:	>9.9
Rooms Yes List:Inspection Inaccessable Rooms 0:YesInspection Interior Baseboard Deteriorated 0:YesInspection Interior Baseboard Intact 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Inspection Interior CeilingsNoInspection Interior Ceilings Inspection Interior Closet Deteriorated 0:YesInspection Interior Closet Deteriorated 0:YesInspection Interior Doors Inspection Interior Doors Inspection Interior Doors Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Paint Tested 0:YesLead Inspection Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes		Not Reported
Roims 0:YesInspection Interior Baseboard Deteriorated 0:YesInspection Interior Baseboard Intact 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Intact 0:NoInspection Interior Closet Deteriorated 0:YesInspection Interior Closet Deteriorated 0:YesInspection Interior Closet Inspection Interior Closet Inspection Interior Doors Deteriorated 0:NoInspection Interior Doors Inspection Interior Floor Deteriorated 0:YesInspection Interior Floor Inspection Interior Floor Inspection Interior Ploor Inspection Interior Plaint Tested 0:Inspection Interior Plaint Tested 0:YesLead Inspection Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes		closet under stairs, many walls, windows etc due to clutter
Baseboard Deteriorated 0:Inspection Interior Baseboard Intact 0:YesInspection Interior Ceilings Deteriorated 0:NoInspection Interior Ceilings Intact 0:NoInspection Interior Ceilings Intact 0:NoInspection Interior Closet Deteriorated 0:YesInspection Interior Closet Intact 0:YesInspection Interior Doors Intact 0:YesInspection Interior Doors Intact 0:YesInspection Interior Doors Inspection Interior Doors Inspection Interior Paint Tested 0:YesInspection Interior Floor Intact 0:YesInspection Interior Paint Tested 0:YesInspection Interior Paint Tested 0:YesInspection Interior Stairs Deteriorated 0:Yes		Yes
Baseboard Intact 0:Inspection Interior CeilingsNoDeteriorated 0:NoInspection Interior CeilingsNoInspection Interior ClosetYesDeteriorated 0:NoInspection Interior ClosetNoInspection Interior ClosetNoInspection Interior ClosetNoInspection Interior ClosetNoInspection Interior DoorsYesDeteriorated 0:YesInspection Interior DoorsYesInspection Interior FloorYesInspection Interior FloorYesDeteriorated 0:YesInspection Interior PaintYesInspection Interior PaintYesLead Inspection Interior StairsYesInspection Interior StairsYesDeteriorated 0:Not Reported		Yes
Deteriorated 0:Inspection Interior CeilingsNoInspection Interior ClosetYesDeteriorated 0:NoInspection Interior ClosetNoInspection Interior ClosetNoInspection Interior DoorsYesDeteriorated 0:YesInspection Interior DoorsYesInspection Interior DoorsYesInspection Interior DoorsYesInspection Interior DoorsYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior PaintYesInspection Interior PaintYesLead Inspection InspectorNot ReportedLead Inspection Interior StairsYesDeteriorated 0:Yes		Yes
Intact 0:Inspection Interior Closet Deteriorated 0:YesInspection Interior Closet Intact 0:NoInspection Interior Doors Deteriorated 0:YesInspection Interior Doors Deteriorated 0:YesInspection Interior Doors Inspection Interior Floor Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Inspection Interior Floor Intact 0:YesInspection Interior Ploor Intact 0:YesInspection Interior Plaint Tested 0:YesLead Inspector Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes		No
Deteriorated 0:Inspection Interior ClosetNoInspection Interior DoorsYesDeteriorated 0:YesInspection Interior DoorsYesInspection Interior DoorsYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior FloorYesInspection Interior PaintYesTested 0:Not ReportedLead Inspection InspectorNot ReportedLicense 0:YesInspection Interior StairsYes		No
Intact 0:Inspection Interior Doors Deteriorated 0:YesInspection Interior Doors Intact 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Intact 0:YesInspection Interior Ploor Intact 0:YesInspection Interior Ploor Intact 0:YesInspection Interior Ploor Intact 0:YesInspection Interior Paint Tested 0:YesLead Inspector Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes		Yes
Deteriorated 0:Inspection Interior Doors Intact 0:YesInspection Interior Floor Deteriorated 0:YesInspection Interior Floor Intact 0:YesInspection Interior Paint Tested 0:YesLead Inspection Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes		No
Intact 0:Inspection Interior Floor Deteriorated 0:YesInspection Interior Floor Intact 0:YesInspection Interior Paint Tested 0:YesLead Inspection Inspector License 0:Not ReportedInspection Interior Stairs Deteriorated 0:Yes	Inspection Interior Doors Deteriorated 0:	Yes
Deteriorated 0:Inspection Interior FloorYesIntact 0:YesInspection Interior PaintYesTested 0:Not ReportedLead Inspection InspectorNot ReportedLicense 0:YesInspection Interior StairsYesDeteriorated 0:Yes	Inspection Interior Doors Intact 0:	Yes
Intact 0: Inspection Interior Paint Yes Tested 0: Lead Inspection Inspector Not Reported License 0: Inspection Interior Stairs Yes Deteriorated 0:		Yes
Tested 0: Lead Inspection Inspector Not Reported License 0: Inspection Interior Stairs Yes Deteriorated 0:		Yes
License 0: Inspection Interior Stairs Yes Deteriorated 0:		Yes
Deteriorated 0:	Lead Inspection Inspector License 0:	Not Reported
Inspector Last Name 0: Karrenberg		Yes
	Inspector Last Name 0:	Karrenberg

, 2 BEVIN BLVD EAST HAMPTON, CT 06424 (Continued)

Lead Inspection Abatement 0:	Yes
Lead Inspection Interior Stairs Deteriorated 1:	Not Reported
Lead Inspection Interior Stairs Intact 0:	Yes
Lead Inspection Interior Walls Deteriorated 0:	Yes
Lead Inspection Interior Walls Intact 0:	Yes
Lead Inspection Remediation 0:	No
Lead Inspection Surfaces 0:	Yes
Lead Inspection Interior Windows Deteriorated 0:	Yes
Lead Inspection Interior Windows Intact 0:	Yes
Lead Inspection Highest Xrf 1:	Not Reported
Lead Inspection Inspector Name 0:	Not Reported
Lead Inspection Inspector State 0:	СТ
Lead Inspection Inspector Type 0:	Code Enforcement Agency
Soil No Reason 0:	Not Reported
Soil 0:	Yes

EAST HAMPTON C.O. #7631 115 MAIN ST EAST HAMPTON, CT 064241105 EDR ID: U001632530

FINDINGS

UST: Underground Storage Tank Data ______ Page 305 Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the R...Full Description>>

DETAILS

▼ UST: Underground Storage Tank Data

UST:	
001.	

Facility State:	СТ
Facility Id:	42-10609
Latitude:	41.571903
Longitude:	-72.500327
Contact:	
Owner Name:	RAYSHELL WAMSLEY
Owner Address:	308 S AKARD ST
Owner City/State/Zip:	DALLAS, TX 752025315
Owner Phone:	214 464 2744
Owner Phone Ext:	Not Reported
Affiliation Type:	Billing Contact
Contact Name:	RAYSHELL WAMSLEY
Contact Title:	Not Reported
Contact EMail:	RM8416@ATT.COM
Owner Name:	AT&T CORP.
Owner Address:	308 S AKARD ST
Owner City/State/Zip:	DALLAS, TX 752025315
Owner Phone:	214 464 1477
Owner Phone Ext:	Not Reported
Affiliation Type:	Owner
Contact Name:	Not Reported
Contact Title:	Not Reported
Contact EMail:	Not Reported
Owner Name:	AT&T CORP.
Owner Address:	308 S AKARD ST
Owner City/State/Zip:	DALLAS, TX 752025315
Owner Phone:	Not Reported
Owner Phone Ext:	Not Reported
Affiliation Type:	Registrant
Contact Name:	Not Reported
Contact Title:	Not Reported
Contact EMail:	Not Reported

EAST HAMPTON C.O. #7631, 115 MAIN ST EAST HAMPTON, CT 064241105 (Continued)

Tank ID:	A1
Compartment ID:	a
Tank Status:	Permanently Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Cathodically Protected, Double Walled
Capacity:	1000
Substance:	Diesel
Date Installed:	01/01/1981
Date Last Used:	08/01/2009
Closure Status:	Tank was Removed From Ground
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	41.571760
Tank Longitude:	-72.500000
Tank ID:	B2
Compartment ID:	а
Tank Status:	Permanently Closed
Tank Material:	Asphalt Coated or Bare Steel
Secondary Material:	Not Reported
Capacity:	1000
Substance:	Heating Oil(on-site consumption)
Date Installed:	01/01/1955
Date Last Used:	08/01/1993
Closure Status:	Tank was Removed From Ground
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	Not Reported
Tank Longitude:	Not Reported
Tank ID:	B2R1
Compartment ID:	а
Tank Status:	Permanently Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Cathodically Protected, Double Walled
Capacity:	550
Substance:	Heating Oil(on-site consumption)
Date Installed:	08/01/1993
Date Last Used:	08/01/2009
Closure Status:	Tank was Removed From Ground
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed:	Spill Bucket
Overfill Installed:	Not Reported
Tank Latitude:	41.571680
Tank Longitude:	-72.499950

EAST HAMPTON C.O. #7631, 115 MAIN ST EAST HAMPTON, CT 064241105 (Continued)

NAME

UNITED STATES POSTAL SERVICE: E. HAMPTON MAIN POST OFFICE 57 MAIN ST EAST HAMPTON, CT 064249998 EDR ID: U002028139

FINDINGS

UST: Underground Storage Tank Data ______ Page 308 Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the R...Full Description>> _____

DETAILS

UST: Underground Storage Tank Data UST: Facility State: СТ Facility Id: 42-482 Latitude: 41.576713 Longitude: -72.503236 Contact: Owner Name: UNITED STATES POSTAL SERVICE **Owner Address:** 125 MAIN ST SOUTHINGTON, CT 064899998 Owner City/State/Zip: Owner Phone: 860-628-4766 Owner Phone Ext: Not Reported Affiliation Type: Owner Contact Name: Not Reported Contact Title: Not Reported Contact EMail: Not Reported Owner Name: UNITED STATES POSTAL SERVICE Owner Address: 125 MAIN ST Owner City/State/Zip: SOUTHINGTON, CT 064899998 Owner Phone: Not Reported Owner Phone Ext: Not Reported Affiliation Type: Registrant Contact Name: Not Reported Contact Title: Not Reported Contact EMail: Not Reported Owner Name: RONALD ROBBINS Owner Address: 135 GRAND ST Owner City/State/Zip: WATERBURY, CT 067019998 Owner Phone: 203-574-6590 Owner Phone Ext: Not Reported Affiliation Type: Representive RONALD ROBBINS Contact Name: Contact Title: Not Reported Contact EMail: ronald.f.robbins@usps.gov

UNITED STATES POSTAL SERVICE: E. HAMPTON MAIN POST OFFICE, 57 MAIN ST EAST HAMPTON, (Continued)

Tank ID:	A1
Compartment ID:	а
Tank Status:	Permanently Closed
Tank Material:	Asphalt Coated or Bare Steel
Secondary Material:	Not Reported
Capacity:	3000
Substance:	Heating Oil(on-site consumption)
Date Installed:	01/01/1968
Date Last Used:	09/01/1990
Closure Status:	Tank was Removed From Ground
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	Not Reported
Tank Longitude:	Not Reported
Tank ID:	A1R1
Compartment ID:	Not Reported
Tank Status:	Currently In Use
Tank Material:	Composite - Steel with Fiberglass (ACT 100)
Secondary Material:	Single Walled
Capacity:	2500
Substance:	Heating Oil(on-site consumption)
Date Installed:	09/01/1990
Date Last Used:	Not Reported
Closure Status:	Not Reported
Pipe Material:	Rigid Fiberglass Reinforced Plastic
Pipe Mode Description:	Containment Sumps @ Tanks, Double Walled
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	41.576713
Tank Longitude:	-72.503236

NAME

CENTER SCHOOL- EAST HAMKPTON SCHOOL DISTRICT 7 SUMMIT ST EAST HAMPTON, CT 064241219 EDR ID: U002174431

FINDINGS

UST: Underground Storage Tank Data Page 310 Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the R...Full Description>> \equiv

DETAILS UST: Underground Storage Tank Data UST: Facility State: СТ Facility Id: 42-552 Latitude: 41.576351 Longitude: -72.501748 Contact: TOWN OF EAST HAMPTON Owner Name: EAST HIGH ST. **Owner Address:** Owner City/State/Zip: East Hampton, CT Owner Phone: (203) 267-4468 Owner Phone Ext: Not Reported Affiliation Type: Owner Contact Name: Not Reported Contact Title: Not Reported Contact EMail: Not Reported TOWN OF EAST HAMPTON Owner Name: EAST HIGH ST. **Owner Address:** Owner City/State/Zip: East Hampton, CT Owner Phone: Not Reported Owner Phone Ext: Not Reported Affiliation Type: Registrant Contact Name: Not Reported Contact Title: Not Reported Contact EMail: Not Reported Tank ID: C-2 Compartment ID: а Tank Status: Permanently Closed Tank Material: Secondary Material: Not Reported

Asphalt Coated or Bare Steel Capacity: 3000 Substance: Heating Oil(on-site consumption) Date Installed: 09/01/1961 Date Last Used: 10/01/1990 **Closure Status:** Tank was Removed From Ground

CENTER SCHOOL- EAST HAMKPTON SCHOOL DISTRICT, 7 SUMMIT ST EAST HAMPTON, CT 064241219 (Continued)

Pipe Material: Pipe Mode Description: Spill Installed: Overfill Installed: Tank Latitude: Tank Longitude:	Bare Steel Not Reported Not Reported Not Reported Not Reported Not Reported
Tank ID:	C-3
Compartment ID:	а
Tank Status:	Currently In Use
Tank Material:	Composite - Steel with Fiberglass (ACT 100)
Secondary Material:	Not Reported
Capacity:	4000
Substance:	Heating Oil(on-site consumption)
Date Installed:	10/01/1990
Date Last Used:	Not Reported
Closure Status:	Not Reported
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	Not Reported
Tank Longitude:	Not Reported

CENTER PACKAGE STORE 93 MAIN ST EAST HAMPTON, CT 064241118 EDR ID: U003518155

FINDINGS

UST: Underground Storage Tank Data Page 312
 Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the R...Full Description>>

DETAILS

UST: Underground Storage Tank Data UST:

001.	
Facility State: Facility Id: Latitude: Longitude: Contact:	CT 42-11802 41.574670 -72.501865
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	MAUREEN HANSON Not Reported Not Reported Not Reported Operator Not Reported Not Reported Not Reported Not Reported
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	MAUREEN HANSON 14 TOWN FARM RD EAST HAMPTON, CT 064241643 (860) 267-4123 Not Reported Owner Not Reported Not Reported Not Reported Not Reported
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	MAUREEN HANSON 14 TOWN FARM RD EAST HAMPTON, CT 064241643 Not Reported Not Reported Registrant Not Reported Not Reported Not Reported

CENTER PACKAGE STORE, 93 MAIN ST EAST HAMPTON, CT 064241118 (Continued)

Tank ID:	A1
Compartment ID:	а
Tank Status:	Permanently Closed
Tank Material:	Asphalt Coated or Bare Steel
Secondary Material:	Not Reported
Capacity:	1000
Substance:	Heating Oil(on-site consumption)
Date Installed:	09/01/1983
Date Last Used:	02/01/1998
Closure Status:	Tank was Removed From Ground
Pipe Material:	Bare Steel
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	Not Reported
Tank Longitude:	Not Reported

G & S SERVICE INC. 100 MAIN ST EAST HAMPTON, CT 064241125 EDR ID: U003540776

FINDINGS

UST: Underground Storage Tank Data ______ Page 314 Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the R...Full Description>>

DETAILS

UST:

▼ UST: Underground Storage Tank Data

031.	
Facility State: Facility Id: Latitude: Longitude: Contact:	CT 42-559 41.573755 -72.501972
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	STEVEN GEOFF 100 MAIN ST EAST HAMPTON, CT 064241125 2032679557 Not Reported Operator Not Reported Not Reported Not Reported Not Reported
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	STEVEN GOFF Not Reported Not Reported Not Reported Operator Not Reported Not Reported Not Reported Not Reported
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	LEROY GOFF 100 MAIN ST EAST HAMPTON, CT 064241125 (203) 267-9368 Not Reported Owner Not Reported Not Reported Not Reported
Owner Name:	LEROY GOFF

G & S SERVICE INC., 100 MAIN ST EAST HAMPTON, CT 064241125 (Continued)

	•
Owner Address:	100 MAIN ST
Owner City/State/Zip:	EAST HAMPTON, CT 064241125
Owner Phone:	Not Reported
Owner Phone Ext:	Not Reported
Affiliation Type:	Registrant
Contact Name:	Not Reported
Contact Title:	Not Reported
Contact EMail:	Not Reported
Tank ID:	A1R1
Compartment ID:	A
Tank Status:	Temporarily Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Not Reported
Capacity:	8000
Substance:	Gasoline
Date Installed:	06/01/1999
Date Last Used:	03/10/2014
Closure Status:	Not Reported
Pipe Material:	Rigid Fiberglass Reinforced Plastic
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Flapper Device
Tank Latitude:	41.573560
Tank Longitude:	-72.501980
Tank ID:	A2
Compartment ID:	а
Tank Status:	Permanently Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Not Reported
Capacity:	8000
Substance:	Gasoline
Date Installed:	09/01/1983
Date Last Used:	Not Reported
Closure Status:	Tank was Removed From Ground
Pipe Material:	Rigid Fiberglass Reinforced Plastic
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	41.573580
Tank Longitude:	-72.501940
Tank ID:	A2HR
Compartment ID:	A
Tank Status:	Temporarily Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Not Reported
Capacity:	8000

G & S SERVICE INC., 100 MAIN ST EAST HAMPTON, CT 064241125 (Continued)

Cubatanaa	Casalina
Substance:	Gasoline
Date Installed:	09/01/1986
Date Last Used:	03/10/2014
Closure Status:	Not Reported
Pipe Material:	Rigid Fiberglass Reinforced Plastic
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Flapper Device
Tank Latitude:	41.573580
Tank Longitude:	-72.501940
Tank ID:	A3
Compartment ID:	A
Tank Status:	Temporarily Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Not Reported
Capacity:	4000
Substance:	Gasoline
Date Installed:	09/01/1986
Date Last Used:	03/10/2014
Closure Status:	Not Reported
Pipe Material:	Rigid Fiberglass Reinforced Plastic
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Flapper Device
Tank Latitude:	41.573580
Tank Longitude:	-72.501940
Task ID	5454
Tank ID:	D4R4
Compartment ID:	A
Tank Status:	Temporarily Closed
Tank Material:	Coated & Cathodically Protected Steel (sti-P3)
Secondary Material:	Not Reported
Capacity:	6000
Substance:	Diesel
Date Installed:	06/01/1999
Date Last Used:	03/10/2014
Closure Status:	Not Reported
Pipe Material:	Rigid Fiberglass Reinforced Plastic
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	41.573538
Tank Longitude:	-72.501970

J. C. BARTON CO. 11 SKINNER ST EAST HAMPTON, CT 064241747 EDR ID: U004009351

FINDINGS

UST: Underground Storage Tank Data ______ Page 317 Registered Underground Storage Tanks. UST's are regulated under Subtitle I of the R...Full Description>>

DETAILS

UST: Underground Storage Tank Data UST:

Facility State: Facility Id: Latitude: Longitude: Contact:	CT 42-480 41.572978 -72.502762
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	J.C. BARTON CO. 11 SKINNER ST EAST HAMPTON, CT 064241747 (203) 267-2538 Not Reported Owner Not Reported Not Reported Not Reported Not Reported
Owner Name: Owner Address: Owner City/State/Zip: Owner Phone: Owner Phone Ext: Affiliation Type: Contact Name: Contact Title: Contact EMail:	J.C. BARTON CO. 11 SKINNER ST EAST HAMPTON, CT 064241747 Not Reported Not Reported Registrant Not Reported Not Reported Not Reported
Tank ID: Compartment ID: Tank Status: Tank Material: Secondary Material: Capacity: Substance: Date Installed: Date Last Used: Closure Status:	A1 a Permanently Closed Asphalt Coated or Bare Steel Not Reported 10000 Gasoline 07/01/1969 10/29/2009 Not Reported

J. C. BARTON CO., 11 SKINNER ST EAST HAMPTON, CT 064241747 (Continued)

Dina Matariak	Other (Specify)
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed: Overfill Installed:	Not Reported
Tank Latitude:	Not Reported 41.572955
	-72.502783
Tank Longitude:	-12.302165
Tarly ID.	B1
Tank ID:	
Compartment ID: Tank Status:	a Dermononthy Closed
Tank Status. Tank Material:	Permanently Closed
	Asphalt Coated or Bare Steel
Secondary Material:	Not Reported
Capacity: Substance:	10000 Gasoline
Date Installed:	01/01/1950
Date Installed: Date Last Used:	01/01/1990
Closure Status:	Tank was Removed From Ground
Pipe Material:	Bare Steel
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	Not Reported
Tank Longitude:	Not Reported
Tank ID:	C1
Compartment ID:	а
Tank Status:	a Permanently Closed
Tank Material:	Asphalt Coated or Bare Steel
	Not Reported
Secondary Material:	10000
Capacity: Substance:	Gasoline
Date Installed:	08/01/1979
Date Last Used:	01/01/1990
Closure Status:	Tank was Removed From Ground
Pipe Material:	Other (Specify)
Pipe Mode Description:	Not Reported
Spill Installed:	Not Reported
Overfill Installed:	Not Reported
Tank Latitude:	Not Reported
Tank Longitude:	Not Reported

DATABASE DESCRIPTIONS

CPCS: Contaminated or Potentially Contaminated Sites

Source:	Date of Government Version: 06/15/2015
Telephone:	Database Release Frequency: Quarterly
LEAD: Lead Inspection Database	
Source:	Date of Government Version: 03/26/2014
Telephone:	Database Release Frequency: Varies

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Source: Environmental Protection Agency Telephone: 703-308-0035 Date of Government Version: 03/10/2015 Database Release Frequency: Varies

RCRA-NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Source: Environmental Protection Agency Telephone: 703-308-0035 Date of Government Version: 03/10/2015 Database Release Frequency: Varies

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Source: National Response Center, United States Coast Guard	Date of Government Version: 03/30/2015
Telephone: 202-267-2180	Database Release Frequency: Annually

BROWNFIELDS: A Listing of Brownfields Sites

Included in the listing are brownfields properties addresses by Cooperative Agreement Recipients and brownfields properties addressed by Targeted Brownfields Assessments. Targeted Brownfields Assessments-EPA's Targeted Brownfields Assessments (TBA) program is designed to help states, tribes, and municipalities--especially those without EPA Brownfields Assessment Demonstration Pilots-minimize the uncertainties of contamination often associated with brownfields. Under the TBA program, EPA provides funding and/or technical assistance for environmental assessments at brownfields linitiative to promote cleanup and redevelopment of brownfields. Cooperative Agreement Recipients-States, political subdivisions, territories, and Indian tribes become Brownfields Cleanup Revolving Loan Fund (BCRLF) cooperative agreement recipients when they enter into BCRLF cooperative agreements with the U.S. EPA. EPA selects BCRLF cooperative agreement recipients based on a proposal and application process. BCRLF cooperative agreement recipients based on a proposal and application process.

Source: Environmental Protection Agency	Date of Government Version: 06/22/2015
Telephone: 202-566-2777	Database Release Frequency: Semi-Annually
PRP: Potentially Responsible Parties A listing of verified Potentially Responsible Parties	

Source: EPADate of Government Version: 10/25/2013Telephone: 202-564-6064Database Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Source: EPA

Date of Government Version: 01/18/2015

DATABASE DESCRIPTIONS

Telephone:	Database Release Frequency: Quarterly		
SDADB: Site Discovery and Assessment Database All sites reported to Permitting, Enforcement, and Reme disposed or sites that are eligible for listing on the State	diation Division where it is suspected that hazardous waste may have bee Inventory of Hazardous Waste Disposal Sites.		
Source: Department of Environmental Protection Telephone: 860-424-3721	Date of Government Version: 04/23/2010 Database Release Frequency: No Update Planned		
	Leaking Underground Storage Tank List aking Underground Storage Tank Incident Reports. LUST records contain an inventory of reported leaking underground storage ta cidents. Not all states maintain these records, and the information stored varies by state.		
Source: Department of Environmental Protection Telephone: 860-424-3376	Date of Government Version: 07/24/2015 Database Release Frequency: Semi-Annually		
	ated under Subtitle I of the Resource Conservation and Recovery Act (RCR sible for administering the UST program. Available information varies by sta		
Source: Department of Environmental Protection Telephone: 860-424-3376	Date of Government Version: 05/26/2015 Database Release Frequency: Semi-Annually		
MANIFEST: Facility and Manifest Data Manifest is a document that lists and tracks hazardous was	ste from the generator through transporters to a TSD facility.		
Source: Department of Environmental Conservation Telephone: 518-402-8651	Date of Government Version: 08/01/2015 Database Release Frequency: Annually		
MANIFEST: Manifest information Hazardous waste manifest information			
Source: Department of Environmental Management Telephone: 401-222-2797	Date of Government Version: 12/31/2013 Database Release Frequency: Annually		
MANIFEST: Hazardous Waste Manifest Data Facility and manifest data. Manifest is a document that list facility.	ts and tracks hazardous waste from the generator through transporters to a t		
Source: Department of Environmental Protection Telephone: 860-424-3375	Date of Government Version: 07/30/2013 Database Release Frequency: No Update Planned		
SPILLS: Oil & Chemical Spill Database Oil and Chemical Spill Data.			
Source: Department of Environmental Protection Telephone: 860-424-3024	Date of Government Version: 07/28/2015 Database Release Frequency: Semi-Annually		
AIRS (AFS): Aerometric Information Retrieval System Facility S General plant level, plant air program, air program pollutar	• • • •		
Source: EPA Telephone: 800-367-1044	Date of Government Version: 07/22/2015 Database Release Frequency: Annually		
OSHA: Occupational Safety and Health Administration Specific inspection, violation and fatality/catastrophe inform	nation regarding inspections of interest.		
Source: Department of Labor Telephone: 202-693-1700	Date of Government Version: 12/31/2013 Database Release Frequency: Annually		
ENF: Enforcement Case Listing The types of enforcement actions included are administra through the Attorney General's Office.	ative consent orders, final unilateral orders and final dispositions of civil cas		
Source: Department of Environmental Protection Telephone: 860-424-3265	Date of Government Version: 07/24/2015 Database Release Frequency: Varies		

DATABASE DESCRIPTIONS

NPD	ES: Wastewater Permit Listing A listing of permits issued by the DEP.		
	Source: Department of Environmental Protection Telephone: 860-424-3832	Date of Government Version: 08/07/2015 Database Release Frequency: Varies	
PRO	PROPERTY: Property Transfer Filings A listing of sites that meet the definition of a hazardous waste establishment. They can be generators, dry cleaners, furniture strippers, etc. These sites have been sold to another owner.		
	Source: Department of Environmental Protection Telephone: 860-424-3789	Date of Government Version: 05/19/2015 Database Release Frequency: Semi-Annually	
EDR GAS STATIONS: EDR Exclusive Historic Gas Stations EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc.			
	Source: EDR, Inc. Telephone:	Date of Government Version: 02/20/2007 Database Release Frequency: Varies	
EDR DRY CLEANERS: EDR Exclusive Historic Dry Cleaners EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat,			

Source: EDR, Inc. Telephone:

cleaning/laundry, wash & dry etc.

Date of Government Version: 02/20/2007 Database Release Frequency: Varies

DISCLAIMER, COPYRIGHT AND TRADEMARK NOTICE

This is The EDR OnDemand Report. Through its continuing emphasis in online technological advancements, EDR has developed the OnDemand system, which enables EDRs customers to search EDRs databases and generate reports based on database records selected by the Client. Client acknowledges that Client has generated this Report by marking those records which Client wishes to include in the final Report. Client has not requested that EDR provide any advice, recommendation or guidance on which records to include in the final Report, and EDR had provided no such advice, recommendation or guidance. The decision of which records to include in the final Report is solely that of Client. EDR has done no checking or quality control of any of the records include in this Report or of this Report itself.

This report contains information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANYSUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OR DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, OR EXEMPLARY DAMAGES.ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.

Purchaser accepts this report "AS IS". Any analyses, estimates, ratings, or risk codes provided in this report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can produce information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2015 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.